

LINEAR DC RESISTANCE WELDING CONTROL

DC25

USER MANUAL



Copyright © 2001 – 2024 AMADA WELD TECH INC.

The engineering designs, drawings and data contained herein are the proprietary work of **AMADA WELD TECH** and may not be reproduced, copied, exhibited or otherwise used without the written authorization of **AMADA WELD TECH**.

Printed in the United States of America.

REVISION RECORD

Revision	EO	Date	Basis of Revision
A	18122	12/01	Original Release
B	19166	12/01	Energy Capacity % Limit change.
C	21594	10/07	Updated Technical Specifications.
D	42840	10/13	Updated to Miyachi America name and logo.
E	43480	11/14	Updated to Amada Miyachi America name and logo.
F	43838	08/15	Updated to Amada Miyachi America format.
G	44640	05/17	Removed Reference to Weldstat Software
H	45829	04/20	Update Company Name (Amada Weld Tech)
J	46300	04/21	Add EU Disposal Statement + Miscellaneous Updates
K	47205	01/24	Update Manual Title

FOREWORD

Thank you for purchasing an AMADA WELD TECH DC25 Linear DC Welding Control. For the rest of this manual, the DC25 will be referred to simply as the ***Power Supply***.

Upon receipt of your equipment, please thoroughly inspect it for shipping damage prior to its installation. Should there be any damage, please immediately contact the shipping company to file a claim, and notify us at:

AMADA WELD TECH INC.
1820 South Myrtle Avenue
Monrovia, California 91016
Phone: (626) 303-5676
FAX: (626) 358-8048
E-mail: info@amadaweldtech.com

The purpose of this manual is to supply operating and maintenance personnel with the information needed to properly and safely operate and maintain the DC25 Linear DC Welding Power Supply.

We have made every effort to ensure that the information in this manual is accurate and adequate. The contents of this manual are subject to change without notice.

Should questions arise, or if you have suggestions for improvement of this manual, please contact us at the above location/numbers.

AMADA WELD TECH is not responsible for any loss or injury due to improper use of this product.

Table of Contents

	Page
Chapter 1: Description	1-1
Section I: Introduction	1-1
Features	1-1
Applications	1-2
Section II: Description	1-3
Section III: Overview	1-4
Introduction	1-4
LCD Screens	1-4
Menu Screens	1-5
Data Screens	1-5
Alphanumeric Data	1-5
Operational States	1-5
Graphed Data	1-7
Section IV: Controls And Indicators	1-8
Introduction	1-8
Liquid Crystal Display (LCD) And Weld Selector Keys	1-8
Numeric Keypad And Operational Controls	1-10
Section V: Emergency Stop Switch and 24 V Jumpers	1-13
Section VI: Related Publications	1-14
Chapter 2: Getting Started	2-1
Section I: Planning For Installation	2-1
Space Requirements	2-1
Utilities	2-1
Section II: Unpacking	2-2
Section III: Electrical And Data Connections	2-3
Section IV: Setup	2-4
Manual Weld Head Connections	2-4
Air-Actuated Weld Head Connections	2-5
Relay, Data, And Communication Connections	2-6
Chapter 3: Using DC25 Welding And Monitoring Functions	3-1
Section I: Introduction	3-1
Section II: Weld Schedules	3-2
Definition	3-2
Weld Sequence Timing	3-2
Welding Applications	3-3
Weld Head Applicability	3-3
Single-Pulse Weld Profile	3-4
Applications	3-4
Description	3-4

Table of Contents (Continued)

	Page
Upslope/Downslope Weld Profile Applications	3-4
Applications	3-4
Description	3-4
Dual-Pulse Weld Profile	3-5
Applications	3-5
Description	3-5
Section III: Programmable Feedback Modes	3-7
Introduction	3-7
Current Mode	3-7
Application	3-7
Description	3-7
Voltage Mode	3-7
Application	3-7
Description	3-7
Power Mode	3-7
Application	3-7
Description	3-7
Section IV: Weld Monitor	3-8
Introduction	3-8
Active Part Conditioner (APC)	3-8
Application	3-8
Description	3-8
How It Works	3-9
Instructions	3-10
Energy Limits	3-10
Applications	3-10
Description	3-10
Pre-Weld Check	3-11
Application	3-11
Function	3-11
 Chapter 4: Operating Instructions	 4-1
Section I: Introduction	4-1
Section II: Initial Setup	4-2
Pre-Operational Checks	4-2
Connections	4-2
Power	4-2
Compressed Air	4-2
Initial Setup Instructions	4-2

	Page
Section III: Programming Weld Schedules	4-3
Introduction	4-3
Select A Weld Schedule	4-3
Enter New Values	4-3
Single-Pulse Weld Schedule	4-4
Upslope/Downslope Weld Schedule	4-5
Dual-Pulse Weld Schedule	4-6
Section IV: Programming The Weld Monitor	4-7
Section V: Programming For Active Part Conditioning	4-10
Section VI: Operation	4-12
General Operator Safety	4-12
Manual Welding	4-12
Operation	4-12
Normal Stop	4-12
Automated Welding	4-12
Operation	4-12
Normal Stop	4-13
Emergency Stop	4-13
Re-Set After Emergency Stop	4-13
Chapter 5: Setup Software	5-1
Section I: Introduction	5-1
Overview	5-1
Section II: How To Use Menu Screens	5-2
Main Menu	5-2
Setup Menus	5-2
Section III: Operator Preferences	5-4
Display Contrast	5-4
Buzzer Loudness	5-4
End Of Cycle Buzzer	5-4
Update Graph After Weld	5-5
Buzzer On Weld Stop	5-5
Section IV: System Settings	5-6
Waveform Check And Weld Fire Lockout	5-6
Waveform Check ON/OFF	5-6
Stability Check % Limit Setting	5-6
Stability Check Delay Setting	5-7
Energy Capacity % Limit Setting	5-7
Weld Fire Lockout Charge % Setting	5-8
Footswitch Weld Abort	5-8
Switch Debounce Time	5-9
Firing Switch	5-9

Table of Contents (Continued)

	Page
Input Switch Select	5-10
Mechanical Selection	5-10
OPTO Selection	5-11
PLC Selection	5-11
Control Signals Select	5-12
Weld Counter Functions	5-12
System Security	5-13
Calibration	5-14
Chain Schedules	5-14
Section V: PID Test Weld Setup	5-17
Overview	5-17
Do Test Weld Options	5-17
Ignore First/Last	5-18
Section VI: Relay Settings	5-19
Function	5-19
Programming Instructions	5-19
Section VII: Special Functions	5-21
Copy A Schedule	5-21
Reset Defaults	5-21
Reset System Parameters	5-23
Reset All Schedules	5-23
Section VIII: Communication And Data	5-24
Requirements	5-24
Communication	5-24
I.D. Number	5-25
Baud Rate	5-25
 Chapter 6: User Maintenance	 6-1
Section I: Precautions	6-1
Section II: Operator Maintenance	6-1
Section III: Troubleshooting	6-1
General Kinds of Problems	6-1
Soft	6-1
Hard	6-2
Alarm Messages	6-2
Troubleshooting	6-2
Technical Assistance	6-5
Electrode Maintenance	6-5
Parts Replacement	6-6

	Page
Chapter 7: Calibration	7-1
Section I: Introduction	7-1
Overview	7-1
Calibration Equipment Required	7-1
Calibration Points	7-2
Section II: Calibration Equipment Setup	7-3
Section III: Calibration Procedure	7-4
 Appendix A: Technical Specifications	 A-1
Appendix B: Electrical And Data Connectors	B-1
Appendix C: The Basics Of Resistance Welding	C-1
Appendix D: Quality Resistance Welding Solutions Defining The Optimum Process	D-1
Appendix E: LCD Display Messages	E-1
Appendix F: Relay Timing Diagrams	F-1
Appendix G: Repetition Rates	G-1

SAFETY NOTES

This instruction manual describes how to operate and maintain the DC25 Power Supply and provides instructions relating to its SAFE use. Procedures described herein **MUST** be performed, as detailed, by **QUALIFIED** and **TRAINED** personnel.

For **SAFETY**, and to effectively take advantage of the full capabilities of the workstation, please read this instruction manual before attempting to use the DC25 Power Supply.

Procedures other than those described in this manual, or not performed as prescribed in it, may expose personnel to electrical hazards.

After reading this manual, retain it for future reference when any questions arise regarding the proper and **SAFE** operation of the unit.

Please note the following conventions used in this manual:

WARNING: Comments marked this way warn the reader of actions which, if not followed, might result in immediate death or serious injury.

CAUTION: Comments marked this way warn the reader of actions which, if not followed, might result in either damage to the equipment, or injury to the individual if subject to long-term exposure to the indicated hazard.

**Disposal**

Properly handle and dispose of used materials.

For the disposal of electronic waste please contact AMADA WELD TECH.

LIMITED WARRANTY

GENERAL TERMS AND CONDITIONS FOR THE SALE OF GOODS

1. Applicability.

(a) These terms and conditions of sale (these “**Terms**”) are the only terms which govern the sale of the goods (“**Goods**”) by Amada Weld Tech Inc. (“**Seller**”) to the buyer identified in the Sales Quotation and/or Acknowledgment (as each defined below) to which these Terms are attached or incorporated by reference (“**Buyer**”). Notwithstanding anything herein to the contrary, if a written contract signed by authorized representatives of both parties is in existence covering the sale of the Goods covered hereby, the terms and conditions of said contract shall prevail to the extent they are inconsistent with these Terms.

(b) The accompanying quotation of sale (the “**Sales Quotation**”) provided to Buyer, and/or sales order acknowledgement (“**Acknowledgement**”) and these Terms (collectively, this “**Agreement**”) comprise the entire agreement between the parties, and supersede all prior or contemporaneous understandings, agreements, negotiations, representations and warranties, and communications, both written and oral. For clarification, after the Acknowledgement is received by Buyer, the order for Goods is binding and cannot be cancelled by Buyer for any reason and the full purchase price amount set forth in the Acknowledgement shall be due and payable by Buyer to Seller pursuant to the payment schedule set forth in the Acknowledgement unless otherwise agreed to in writing by Seller. All terms and conditions contained in any prior or contemporaneous oral or written communication which are different from, or in addition to, the terms and conditions in this Agreement are hereby rejected and shall not be binding on Seller, whether or not they would materially alter this Agreement. These Terms prevail over any of Buyer’s terms and conditions of purchase regardless whether or when Buyer has submitted its purchase order or such terms. Fulfillment of Buyer’s order does not constitute acceptance of any of Buyer’s terms and conditions and does not serve to modify or amend these Terms. Notwithstanding anything herein to the contrary, all orders for Goods must be for a minimum purchase price of \$100 or such orders will be rejected by Seller.

2. Delivery.

(a) The Goods will be delivered within a reasonable time after Seller provides Buyer the Acknowledgment, subject to availability of finished Goods. Seller will endeavor to meet delivery schedules requested by Buyer, but in no event shall Seller incur any liability, consequential or otherwise, for any delays or failure to deliver as a result of ceasing to manufacture any product or any Force Majeure Event. Delivery schedules set forth in the Acknowledgment are Seller’s good faith estimate on the basis of current schedules. In no event shall Seller be liable for special or consequential damages resulting from failure to meet requested delivery schedules.

(b) Unless otherwise agreed in writing by the parties in the Acknowledgment, Seller shall deliver the Goods to Seller’s plant in Monrovia, CA, USA (the “**Shipping Point**”) using Seller’s standard methods for packaging and shipping such Goods. Buyer shall take delivery of the Goods within three (3) days of Seller’s written notice that the Goods have been delivered to the Shipping Point. Buyer shall be responsible for all loading costs (including freight and insurance costs) and provide equipment and labor reasonably suited for receipt of the Goods at the Shipping Point. Seller shall not be liable for any delays, loss or damage in transit.

(c) Seller may, in its sole discretion, without liability or penalty, make partial shipments of Goods to Buyer, if applicable. Each shipment will constitute a separate sale, and Buyer shall pay for the units shipped whether such shipment is in whole or partial fulfillment of Buyer’s purchase order.

(d) If for any reason Buyer fails to accept delivery of any of the Goods on the date fixed pursuant to Seller’s notice that the Goods have been delivered at the Shipping Point, or if Seller is unable to deliver the Goods at the Shipping Point on such date because Buyer has not provided appropriate instructions, documents, licenses or authorizations: (i) risk of loss to the Goods shall pass to Buyer; (ii) the Goods shall be deemed to have been delivered; and (iii) Seller, at its option, may store the Goods until Buyer picks them up, whereupon Buyer shall be liable for all related costs and expenses (including, without limitation, storage and insurance).

3. Non-delivery.

(a) The quantity of any installment of Goods as recorded by Seller on dispatch from Seller’s place of business is conclusive evidence of the quantity received by Buyer on delivery unless Buyer can provide conclusive evidence proving the contrary.

(b) Seller shall not be liable for any non-delivery of Goods (even if caused by Seller’s negligence) unless Buyer gives written notice to Seller of the non-delivery within three (3) days of the date when the Goods would in the ordinary course of events have been received.

(c) Any liability of Seller for non-delivery of the Goods shall be limited to (in Seller’s sole discretion) replacing the Goods within a reasonable time or adjusting the invoice respecting such Goods to reflect the actual quantity delivered.

4. Shipping Terms. Unless indicated otherwise in the Acknowledgment, Delivery shall be made EXW (Incoterms 2010), Shipping Point, including without limitation, freight and insurance costs. If no delivery terms are specified on the Acknowledgment, the method of shipping will be in the sole discretion of Seller. Unless directed in writing otherwise by Buyer, full invoice value will be declared for all shipments.

5. Title and Risk of Loss. Title and risk of loss passes to Buyer upon delivery of the Goods at the Shipping Point. As collateral security for the payment of the purchase price of the Goods, Buyer hereby grants to Seller a lien on and security interest in and to all of the right, title and interest of Buyer in, to and under the Goods, wherever located, and whether now existing or hereafter arising or acquired from time to time, and in all accessions thereto and replacements or modifications thereof, as well as all proceeds (including insurance proceeds) of the foregoing. The security interest granted under this provision constitutes a purchase money security interest under the California Commercial Code.

6. Amendment and Modification. These Terms may only be amended or modified in a writing which specifically states that it amends these Terms and is signed by an authorized representative of each party.

MODEL DC25 LINEAR DC RESISTANCE WELDING CONTROL

7. Inspection and Rejection of Nonconforming Goods.

(a) Buyer shall inspect the Goods within two (2) days of receipt (“**Inspection Period**”). Buyer will be deemed to have accepted the Goods unless it notifies Seller in writing of any Nonconforming Goods during the Inspection Period and furnishes such written evidence or other documentation as required by Seller. “**Nonconforming Goods**” means only the following: (i) product shipped is different than identified in Buyer’s Acknowledgement; or (ii) product’s label or packaging incorrectly identifies its contents. Notwithstanding the foregoing, for shipped Goods that require field installation, the “re-verification” terms in the Acknowledgement shall apply and for custom installations, the inspection and verification shall take place at Buyer’s site immediately after the installation is completed.

(b) Seller will only accept Nonconforming Goods that are returned under Seller’s Return Material Authorization procedures then in effect (“**RMA**”). Buyer shall obtain a RMA number from Seller prior to returning any Nonconforming Goods and return the Nonconforming Goods prepaid and insured to Seller at 1820 South Myrtle Avenue, Monrovia, CA 91016 or to such other location as designated in writing by Seller for the examination to take place there. If Seller reasonably verifies Buyer’s claim that the Goods are Nonconforming Goods and that the nonconformance did not developed by use from Buyer, Seller shall, in its sole discretion, (i) replace such Nonconforming Goods with conforming Goods, or (ii) credit or refund the Price for such Nonconforming Goods pursuant to the terms set forth herein. Notwithstanding the foregoing, the only remedy for Nonconforming Goods that are custom systems is repair (not refund or replacement). No returns for Nonconforming Goods are allowed after thirty (30) days from the original shipping date.

(c) Buyer acknowledges and agrees that the remedies set forth in Section 7(a) are Buyer’s exclusive remedies for the delivery of Nonconforming Goods. Except as provided under Section 7(a) and Section 14, all sales of Goods to Buyer are made on a one-way basis and Buyer has no right to return Goods purchased under this Agreement to Seller.

8. Price.

(a) Buyer shall purchase the Goods from Seller at the prices (the “**Prices**”) set forth in Seller’s published catalogue literature in force as of the date of the Sales Quotation. However, the Prices shown in such catalogue literature or any other publication are subject to change without notice. Unless specifically stated to the contrary in the Sales Quotation, quoted Prices and discounts are firm for thirty (30) days from the date of the Sales Quotation. Unless otherwise stated, prices are quoted EXW (Incoterms 2010), Shipping Point. Unless otherwise stated in the Acknowledgement, if the Prices should be increased by Seller before delivery of the Goods to a carrier for shipment to Buyer, then these Terms shall be construed as if the increased prices were originally inserted herein, and Buyer shall be billed by Seller on the basis of such increased prices.

(b) All Prices are exclusive of all sales, use and excise taxes, and any other similar taxes, duties and charges of any kind imposed by any governmental authority on any amounts payable by Buyer. Buyer shall be responsible for all such charges, costs and taxes (present or future); provided, that, Buyer shall not be responsible for any taxes imposed on, or with respect to, Seller’s income, revenues, gross receipts, personnel or real or personal property or other assets.

9. Payment Terms.

(a) Unless otherwise provided in the Acknowledgement, if Buyer has approved credit with Seller, Buyer shall pay all invoiced amounts due to Seller within thirty (30) days from the date of Seller’s invoice. If Seller does not have Buyer’s financial information and has not provided pre-approved credit terms for Buyer, the payment must be made in cash with order or C.O.D. in US dollars. If Buyer has approved credit terms, the payment may be made by cash with order, wire transfer of immediately available funds, or check in US dollars. Certain products require a down payment. Any payment terms other than set forth above will be identified in the Acknowledgement. Notwithstanding anything herein to the contrary, all prepaid deposits and down payments are non-refundable. If a deposit is not received when due, Seller reserves the right to postpone manufacturing of Goods until payment is received. Seller will not be responsible for shipment delays due to deposit payment delays.

(b) In Seller’s sole discretion, Seller may access Buyer interest on all late payments at the lesser of the rate of 1.5% per month or the highest rate permissible under applicable law, calculated daily and compounded monthly. Buyer shall reimburse Seller for all costs incurred in collecting any late payments, including, without limitation, attorneys’ fees. In addition to all other remedies available under these Terms or at law (which Seller does not waive by the exercise of any rights hereunder), Seller shall be entitled to suspend the delivery of any Goods if Buyer fails to pay any amounts when due hereunder and such failure continues for ten (10) days following written notice thereof.

(c) Buyer shall not withhold payment of any amounts due and payable by reason of any set-off of any claim or dispute with Seller, whether relating to Seller’s breach, bankruptcy or otherwise.

10. Intellectual Property; Software License.

(a) To the extent that any Goods provided under this Agreement contains software, whether pre-installed, embedded, in read only memory, or found on any other media or other form (“**Software**”), such Software and accompanying documentation are licensed to Buyer, not sold and shall remain the sole and exclusive property of Seller or third party licensors of Seller. Seller grants Buyer a non-exclusive license to use the Software solely as provided in and in connection with the use of the Goods in which such Software is contained and in accordance with any applicable user documentation provided with such Goods and subject to the provisions of this Agreement. Certain of Seller’s Goods may include third party software such as computer operating systems. Licenses to such third party software are subject to the terms and conditions of any applicable third party software license agreements. Unless identified in the Acknowledgement, no license is granted by Seller with respect to such third party software products that may be provided with the Goods (if any). Seller makes no warranties regarding any third party software that may accompany the Goods or otherwise and such software is explicitly included in the definition of Third Party Products below.

(b) Buyer shall not copy, modify, or disassemble, or permit others to copy, modify, or disassemble, the Software, nor may Buyer modify, adapt, translate, reverse assemble, decompile, or otherwise attempt to derive source code from the Software. Buyer shall not transfer possession of the Software except as part of, or with, the Goods, and each such transfer shall be subject to the restrictions contained herein. Buyer may not sublicense, rent, loan, assign or otherwise transfer the Software or documentation, and Buyer shall retain on all copies of the Software and documentation all copyright and other proprietary notices or legends appearing therein or thereon. Seller may terminate this license upon written notice for any violation of any of the terms of this license or any material breach of any provision of this Agreement. Buyer shall immediately discontinue use of the Software upon any termination of this license or Agreement. This license shall terminate upon any termination of the Agreement.

MODEL DC25 LINEAR DC RESISTANCE WELDING CONTROL

(c) All patents, trademarks, copyrights or other intellectual property rights embodied in the Goods, including without limitation the Software, are owned by Seller and its licensors. Seller and its licensors retain all right, title and interest in such intellectual property rights. Except as expressly set forth herein, no license rights or ownership in or to any of the foregoing is granted or transferred hereunder, either directly or by implication. ALL RIGHTS RESERVED.

(d) If Buyer is the United States Government or any agency thereof, each of the components of the Software and user documentation are a “commercial item,” and “computer software” as those terms are defined at 48 C.F.R. 2.101, consisting of “commercial computer software” and “commercial computer software documentation,” as such terms are used in 48 C.F.R. 12.212. Consistent with 48 C.F.R. 12.212 and 48 C.F.R. 227.7202-1 through 227.7202-4, all United States government Buyers acquire only those rights in the Software and user documentation that are specified in this Agreement.

11. Installation and Other Services. Seller shall provide installation services (“**Installation Services**”) to Buyer if set forth in the Acknowledgment. If Installation Services are provided for in the Acknowledgment, Buyer will prepare the location for the installation consistent with Buyer’s written specifications and Buyer will install necessary system cable and assemble any necessary equipment or hardware not provided by Seller, unless agreed otherwise in writing by the parties. For Goods that will be operated on or in connection with Buyer supplied hardware or software, Buyer is responsible for ensuring that its hardware and software conform with Seller minimum hardware and software requirements as made available to Buyer. Seller shall provide other field services, such as maintenance visits and field repairs (the “**Other Services**” and together with the Installation Services, the “**Services**”) if set forth in the Acknowledgment.

12. Limited Warranty.

(a) Subject to the exceptions and upon the conditions set forth herein, Seller warrants to Buyer that for a period of one (1) year from the date of shipment (“**Warranty Period**”), that such Goods will be free from material defects in material and workmanship.

(b) Notwithstanding the foregoing and anything herein to the contrary, the warranty set forth in this Section 12 shall be superseded and replaced in its entirety with the warranty set forth on **Exhibit A** hereto if the Goods being purchased are specialty products, which include, without limitation, laser products, fiber markers, custom systems, workstations, Seller-installed products, non-catalogue products and other custom-made items (each a “**Specialty Product**”).

(c) **EXCEPT FOR THE WARRANTY SET FORTH IN SECTION 12(A), SELLER MAKES NO WARRANTY WHATSOEVER WITH RESPECT TO THE GOODS (INCLUDING ANY SOFTWARE) OR SERVICES, INCLUDING ANY (a) WARRANTY OF MERCHANTABILITY; (b) WARRANTY OF FITNESS FOR A PARTICULAR PURPOSE; (c) WARRANTY OF TITLE; OR (d) WARRANTY AGAINST INFRINGEMENT OF INTELLECTUAL PROPERTY RIGHTS OF A THIRD PARTY; WHETHER EXPRESS OR IMPLIED BY LAW, COURSE OF DEALING, COURSE OF PERFORMANCE, USAGE OF TRADE OR OTHERWISE.**

(d) Products manufactured by a third party and third party software (“**Third Party Product**”) may constitute, contain, be contained in, incorporated into, attached to or packaged together with, the Goods. Third Party Products are not covered by the warranty in Section 12(a). For the avoidance of doubt, **SELLER MAKES NO REPRESENTATIONS OR WARRANTIES WITH RESPECT TO ANY THIRD PARTY PRODUCT, INCLUDING ANY (a) WARRANTY OF MERCHANTABILITY; (b) WARRANTY OF FITNESS FOR A PARTICULAR PURPOSE; (c) WARRANTY OF TITLE; OR (d) WARRANTY AGAINST INFRINGEMENT OF INTELLECTUAL PROPERTY RIGHTS OF A THIRD PARTY; WHETHER EXPRESS OR IMPLIED BY LAW, COURSE OF DEALING, COURSE OF PERFORMANCE, USAGE OF TRADE OR OTHERWISE.** Notwithstanding the foregoing, in the event of the failure of any Third Party Product, Seller will assist (within reason) Buyer (at Buyer’s sole expense) in obtaining, from the respective third party, any (if any) adjustment that is available under such third party’s warranty.

(e) Seller shall not be liable for a breach of the warranty set forth in Section 12(a) unless: (i) Buyer gives written notice of the defect, reasonably described, to Seller within five (5) days of the time when Buyer discovers or ought to have discovered the defect and such notice is received by Seller during the Warranty Period; (ii) Seller is given a reasonable opportunity after receiving the notice to examine such Goods; (iii) Buyer (if requested to do so by Seller) returns such Goods (prepaid and insured to Seller at 1820 South Myrtle Avenue, Monrovia, CA 91016 or to such other location as designated in writing by Seller) to Seller pursuant to Seller’s RMA procedures and Buyer obtains a RMA number from Seller prior to returning such Goods for the examination to take place; and (iii) Seller reasonably verifies Buyer’s claim that the Goods are defective and that the defect developed under normal and proper use.

(f) Seller shall not be liable for a breach of the warranty set forth in Section 12(a) if: (i) Buyer makes any further use of such Goods after giving such notice; (ii) the defect arises because Buyer failed to follow Seller’s oral or written instructions as to the storage, installation, commissioning, use or maintenance of the Goods; (iii) Buyer alters or repairs such Goods without the prior written consent of Seller; or (iv) repairs or modifications are made by persons other than Seller’s own service personnel, or an authorized representative’s personnel, unless such repairs are made with the written consent of Seller in accordance with procedures outlined by Seller.

(g) All expendables such as electrodes are warranted only for defect in material and workmanship which are apparent upon receipt by Buyer. The foregoing warranty is negated after the initial use.

(h) Subject to Section 12(e) and Section 12(f) above, with respect to any such Goods during the Warranty Period, Seller shall, in its sole discretion, either: (i) repair or replace such Goods (or the defective part) or (ii) credit or refund the price of such Goods at the pro rata contract rate, provided that, if Seller so requests, Buyer shall, at Buyer’s expense, return such Goods to Seller.

(i) **THE REMEDIES SET FORTH IN SECTION 12(H) SHALL BE BUYER’S SOLE AND EXCLUSIVE REMEDY AND SELLER’S ENTIRE LIABILITY FOR ANY BREACH OF THE LIMITED WARRANTY SET FORTH IN SECTION 12(A).** Representations and warranties made by any person, including representatives of Seller, which are inconsistent or in conflict with the terms of this warranty, as set forth above, shall not be binding upon Seller.

13. Limitation of Liability.

(a) **IN NO EVENT SHALL SELLER BE LIABLE FOR ANY CONSEQUENTIAL, INDIRECT, INCIDENTAL, SPECIAL, EXEMPLARY, OR PUNITIVE DAMAGES, LOST PROFITS OR REVENUES OR DIMINUTION IN VALUE, LOSS OF INFORMATION OR DATA, OR PERSONAL INJURY OR DEATH ARISING IN ANY WAY OUT OF THE MANUFACTURE, SALE, USE, OR INABILITY TO USE ANY GOODS, SOFTWARE OR SERVICE, OR ARISING OUT OF OR RELATING TO ANY BREACH OF THESE TERMS, WHETHER OR NOT THE POSSIBILITY OF SUCH DAMAGES HAS BEEN DISCLOSED IN ADVANCE BY BUYER OR COULD HAVE BEEN REASONABLY FORESEEN BY BUYER, REGARDLESS OF THE LEGAL OR EQUITABLE THEORY (CONTRACT, TORT OR OTHERWISE) UPON WHICH THE CLAIM IS BASED, AND NOTWITHSTANDING THE FAILURE OF ANY AGREED OR OTHER REMEDY OF ITS ESSENTIAL PURPOSE.**

(b) **IN NO EVENT SHALL SELLER’S AGGREGATE LIABILITY ARISING OUT OF OR RELATED TO THIS AGREEMENT, WHETHER ARISING OUT OF OR RELATED TO**

BREACH OF CONTRACT, TORT (INCLUDING NEGLIGENCE) OR OTHERWISE, EXCEED THE TOTAL OF THE AMOUNTS PAID TO SELLER FOR THE GOODS SOLD HEREUNDER.

(c) ALL WARRANTIES SET FORTH HEREIN, DIRECT OR IMPLIED, ARE VOIDED IF THE INITIAL INSTALLATION AND START-UP OF THE SUBJECT GOOD IS NOT SUPERVISED BY AN AUTHORIZED REPRESENTATIVE OF SELLER. AFTER INSTALLATION, ANY RE-ALIGNMENT, RE-CLEANING, OR RE-CALIBRATION, PROVIDED THEY ARE NOT RELATED TO A PROVEN DEFECT IN MATERIALS OR WORKMANSHIP, SHALL BE PERFORMED BY AN AUTHORIZED REPRESENTATIVE OF SELLER AT THE CURRENT SERVICE RATES.

(d) WHERE GOODS ARE SUBJECT TO A MOVE TO ANOTHER LOCATION AFTER THE ORIGINAL INSTALLATION HAS BEEN MADE, THE WARRANTY MAY BE MAINTAINED ONLY IF SUPERVISED BY AN AUTHORIZED REPRESENTATIVE OF SELLER. SELLER, FOR A SERVICE CHARGE, WILL ARRANGE FOR AND SUPERVISE THE DISCONNECTION, TRANSPORTATION, REINSTALLATION AND START-UP OF THE EQUIPMENT. CLAIMS FOR DAMAGE IN SHIPMENT ARE THE RESPONSIBILITY OF BUYER AND SHALL BE FILED PROMPTLY WITH THE TRANSPORTATION COMPANY.

14. Return Goods Policy. Seller's products may be returned to Seller for credit within sixty (60) days of shipment subject to the following conditions.

(a) In order to return products for credit, Buyer must obtain a RMA number from Seller. Upon receipt, it must be executed by an authorized person and then returned with the Goods. Goods returned to Seller without a RMA will be returned at Buyer's expense.

(b) Goods are to be returned to Seller at 1820 South Myrtle Avenue, Monrovia, CA 91016 with Freight Prepaid. Seller will not accept collect shipments.

(c) Restocking fees will be assessed in accordance with the following schedules: (i) Goods returned within the first thirty (30) days from shipment date will be restocked less twenty percent (20%) of the amount billed on the original invoice. (ii) Goods returned over thirty (30) days of shipment but less than sixty (60) days will be restocked less thirty percent (30%) of the amount billed on the original invoice. (iii) No returns are allowed after sixty (60) days from the original shipping date.

(d) The restocking fees set forth above are the minimum fees. If a returned Good requires rework to restore it to a saleable condition, further charges will be assessed. Seller's quality assurance department will document the condition of the Goods when received by Seller and report their findings to Buyer.

(e) Notwithstanding the foregoing provisions of this Section 14, the following Goods cannot be returned, are not eligible for any credit and cannot be restocked: (i) custom or modified products and (ii) any expendable product(s) that have been used.

15. Compliance with Law and Indemnification. Buyer shall comply with all applicable laws, regulations and ordinances. Buyer shall maintain in effect all the licenses, permissions, authorizations, consents and permits that it needs to carry out its obligations under this Agreement. Buyer shall comply with all export and import laws of all countries involved in the sale of the Goods under this Agreement or any resale of the Goods by Buyer. Goods, Services and technical data delivered by Seller shall be subject to U.S. export controls. Buyer shall, and shall cause its customers to, obtain all licenses, permits and approvals required by any government and shall comply with all applicable laws, rules, policies and procedures of the applicable government and other competent authorities. Buyer will indemnify and hold Seller harmless for any violation or alleged violation by Buyer of such laws, rules, policies or procedures. Buyer shall not transmit, export or re-export, directly or indirectly, separately or as part of any system, the Goods or any technical data (including processes and Services) received from Seller, without first obtaining any license required by the applicable government, including without limitation, the U.S. government. Buyer also certifies that none of the Goods or technical data supplied by Seller under this Agreement will be sold or otherwise transferred to, or made available for use by or for, any entity that is engaged in the design, development, production or use of nuclear, biological or chemical weapons or missile technology. No Buyer information will be deemed "technical data" unless Buyer specifically identifies it to Seller as such. Buyer assumes all responsibility for shipments of Goods requiring any government import clearance. Seller may terminate this Agreement if any governmental authority imposes antidumping or countervailing duties or any other penalties on Goods. For all international shipments, Seller requires that all required Export Control documentations, including Form BIS-711 Statement by Ultimate Consignee and Purchases, are submitted by Buyer along with the purchase order. Seller reserves the right to postpone shipment until all documentations are completed and submitted to Seller. Seller will not be responsible for shipment delays due to non-compliance by Buyer of the foregoing two sentences.

16. Termination. In addition to any remedies that may be provided under these Terms, Seller may terminate this Agreement with immediate effect upon written notice to Buyer, if Buyer: (i) fails to pay any amount when due under this Agreement and such failure continues for ten (10) days after Buyer's receipt of written notice of nonpayment; (ii) has not otherwise performed or complied with any of these Terms, in whole or in part; or (iii) becomes insolvent, files a petition for bankruptcy or commences or has commenced against it proceedings relating to bankruptcy, receivership, reorganization or assignment for the benefit of creditors.

17. Waiver. No waiver by Seller of any of the provisions of this Agreement is effective unless explicitly set forth in writing and signed by Seller. No failure to exercise, or delay in exercising, any rights, remedy, power or privilege arising from this Agreement operates or may be construed as a waiver thereof. No single or partial exercise of any right, remedy, power or privilege hereunder precludes any other or further exercise thereof or the exercise of any other right, remedy, power or privilege.

18. Confidential Information. All non-public, confidential or proprietary information of Seller, including, but not limited to, specifications, samples, patterns, designs, plans, drawings, documents, data, business operations, customer lists, pricing, discounts or rebates, disclosed by Seller to Buyer, whether disclosed orally or disclosed or accessed in written, electronic or other form or media, and whether or not marked, designated or otherwise identified as "confidential," in connection with this Agreement is confidential, solely for the use of performing this Agreement and may not be disclosed or copied unless authorized in advance by Seller in writing. Upon Seller's request, Buyer shall promptly return all documents and other materials received from Seller. Seller shall be entitled to injunctive relief for any violation of this Section 18. This Section 18 does not apply to information that is: (a) in the public domain through no fault of Buyer; (b) known to Buyer at the time of disclosure without restriction as evidenced by its records; or (c) rightfully obtained by Buyer on a non-confidential basis from a third party.

19. Force Majeure. Seller shall not be liable or responsible to Buyer, nor be deemed to have defaulted or breached this Agreement, for any failure or delay in fulfilling or performing any term of this Agreement when and to the extent such failure or delay is caused by or results from acts or circumstances beyond the reasonable control of Seller including, without limitation, acts of God, flood, fire, earthquake, explosion, governmental actions, war, invasion or hostilities (whether war is declared or not), terrorist threats or acts, riot, or other civil unrest, national emergency, revolution, insurrection, epidemic, lock-outs, strikes

MODEL DC25 LINEAR DC RESISTANCE WELDING CONTROL

or other labor disputes (whether or not relating to either party's workforce), or restraints or delays affecting carriers or inability or delay in obtaining supplies of adequate or suitable materials, materials or telecommunication breakdown or power outage (each a "**Force Majeure Event**"), provided that, if the event in question continues for a continuous period in excess of thirty (30) days, Buyer shall be entitled to give notice in writing to Seller to terminate this Agreement.

20. Assignment. Buyer shall not assign any of its rights or delegate any of its obligations under this Agreement without the prior written consent of Seller. Any purported assignment or delegation in violation of this Section 20 is null and void. No assignment or delegation relieves Buyer of any of its obligations under this Agreement.

21. Relationship of the Parties. The relationship between the parties is that of independent contractors. Nothing contained in this Agreement shall be construed as creating any agency, partnership, joint venture or other form of joint enterprise, employment or fiduciary relationship between the parties, and neither party shall have authority to contract for or bind the other party in any manner whatsoever.

22. No Third-Party Beneficiaries. This Agreement is for the sole benefit of the parties hereto and their respective successors and permitted assigns and nothing herein, express or implied, is intended to or shall confer upon any other person or entity any legal or equitable right, benefit or remedy of any nature whatsoever under or by reason of these Terms.

23. Governing Law. All matters arising out of or relating to this Agreement is governed by and construed in accordance with the internal laws of the State of California without giving effect to any choice or conflict of law provision or rule (whether of the State of California or any other jurisdiction) that would cause the application of the laws of any jurisdiction other than those of the State of California.

24. Dispute Resolution.

(a) If Buyer is an entity formed under the laws of the United States of America, or any of its states, districts or territories ("**U.S. Law**"), then any dispute, legal suit, action or proceeding arising out of or relating to this Agreement shall be adjudicated and decided in the federal courts of the United States of America or the courts of the State of California in each case located in the City of Los Angeles and County of Los Angeles, California and each party irrevocably submits to the exclusive and personal jurisdiction of such courts in any such dispute, suit, action or proceeding.

(b) If Buyer is an entity formed under the laws of any country, state, district or territory other than U.S. Law, then the parties irrevocably agree that any dispute, legal suit, action or proceeding arising out of or relating to this Agreement shall be submitted to the International Court of Arbitration of the International Chamber of Commerce ("**ICC**") and shall be finally settled under the Rules of Arbitration of the ICC. The place and location of the arbitration shall be in Los Angeles, California, pursuant to the ICC's Rules of Arbitration and shall be finally settled in accordance with said rules. The arbitration shall be conducted before a panel of three arbitrators. Each party shall select one arbitrator and the two arbitrators so selected shall select the third arbitrator, who shall act as presiding arbitrator. Notwithstanding the foregoing, if the matter under dispute is \$500,000 or less, there shall only be one arbitrator who shall be mutually selected by both parties. If the party-selected arbitrators are unable to agree upon the third arbitrator, if either party fails to select an arbitrator, or in the case that only one arbitrator is required and the parties are unable to agree, then the International Court of Arbitration shall choose the arbitrator. The language to be used in the arbitral proceeding shall be English. The arbitrator(s) shall have no authority to issue an award that is contrary to the express terms of this Agreement or the laws of the State of California or applicable US Federal Law, and the award may be vacated or corrected on appeal to a court of competent jurisdiction for any such error. The arbitrator(s) shall be specifically empowered to allocate between the parties the costs of arbitration, as well as reasonable attorneys' fees and costs, in such equitable manner as the arbitrator(s) may determine. The arbitrator(s) shall have the authority to determine issues of arbitrability and to award compensatory damages, but they shall not have authority to award punitive or exemplary damages. Judgment upon the award so rendered may be entered in any court having jurisdiction or application may be made to such court for judicial acceptance of any award and an order of enforcement, as the case may be. In no event shall a demand for arbitration be made after the date when institution of a legal or equitable proceeding based upon such claim, dispute or other matter in question would be barred by the applicable statute of limitations. Notwithstanding the foregoing, either party shall have the right, without waiving any right or remedy available to such party under this Agreement or otherwise, to seek and obtain from any court of competent jurisdiction any interim or provisional relief that is necessary or desirable to protect the rights or property of such party, pending the selection of the arbitrator(s) hereunder or pending the arbitrator(s)' determination of any dispute, controversy or claim hereunder.

25. Notices. All notices, request, consents, claims, demands, waivers and other communications hereunder (each, a "**Notice**") shall be in writing and addressed to the parties at the addresses set forth on the face of the Acknowledgement or to such other address that may be designated by the receiving party in writing. All Notices shall be delivered by personal delivery, nationally recognized overnight courier (with all fees pre-paid), facsimile (with confirmation of transmission) or certified or registered mail (in each case, return receipt requested, postage prepaid). Except as otherwise provided in this Agreement, a Notice is effective only (a) upon receipt of the receiving party, upon confirmation of delivery by nationally recognized overnight courier or upon forty-eight (48) hours after being sent by certified or registered mail (as applicable), and (b) if the party giving the Notice has complied with the requirements of this Section 25.

26. Severability. If any term or provision of this Agreement is invalid, illegal or unenforceable in any jurisdiction, such invalidity, illegality or unenforceability shall not affect any other term or provision of this Agreement or invalidate or render unenforceable such term or provision in any other jurisdiction.

27. Survival. Provisions of these Terms which by their nature should apply beyond their terms will remain in force after any termination or expiration of this Order including, but not limited to, the following provisions: Compliance with Laws, Confidentiality, Governing Law, Dispute Resolution, Survival, and the restrictions on Software in Sections 10(b), (c) and (d).

CHAPTER 1

DESCRIPTION

Section I: Introduction

Features

The **DC25 Linear DC Welding Control** is a Resistance Welding Power Supply. For the rest of this manual, the DC25 will be referred to simply as the ***Power Supply***. The Power Supply has the following features:

- Programming of time in 10 μ sec increments (minimum) provides shorter weld times, less part deformation, longer electrode life, and greater weld strength with more part ductility.
- Built-in Liquid Crystal Display (LCD) shows a graphical "trace" of weld current, voltage, power and resistance, plus alphanumeric peak and average values.
- Up to 99 individual Weld Schedules (sometimes referred to as *weld profiles*) can be programmed and stored. Weld schedules can be used individually or in sequence with others using the "chain schedules" function. You can also use schedule # 00 as a "scratch pad" for developing schedules.
- Easy-to-set limits establish process window for acceptable quality.
- Weld limits and user programmable relays can be used in conjunction with visual and audible signals for operators and automation interface.
- Active Part Conditioning (APC) compensates for varying part conditions and oxide layers.
- Rear-mounted RS-232 and RS-485 connectors allow for remote programming, weld schedule selection, and data logging for SPC purposes.
- Calibration traceable to NIST standards.
- Password protection provides process security.


Applications

The Power Supply is ideal for microjoining applications, which require exceptional control and highest quality throughput. The Power Supply has a closed-loop feedback circuit that allows the user to program **constant current**, **constant voltage**, or **constant power** welding pulses. *Chapter 3, Using DC25 Welding and Monitor Functions*, describes the Power Supplies functions and how to use them for different welding applications.

The Power Supply requires only single-phase input power and can supply weld power up to 4,000 amps. The advanced linear control circuit provides instantaneous update of the welding pulse in response to changes in the resistance of the work piece during the weld. This level of control is essential to achieve consistent welds in applications where the resistance changes dramatically.

The graphical display and intuitive weld monitor make understanding the weld and the weld optimization process easy. Data output provides the necessary process documentation for critical applications and permits data logging for SPC purposes.

Section II: Description

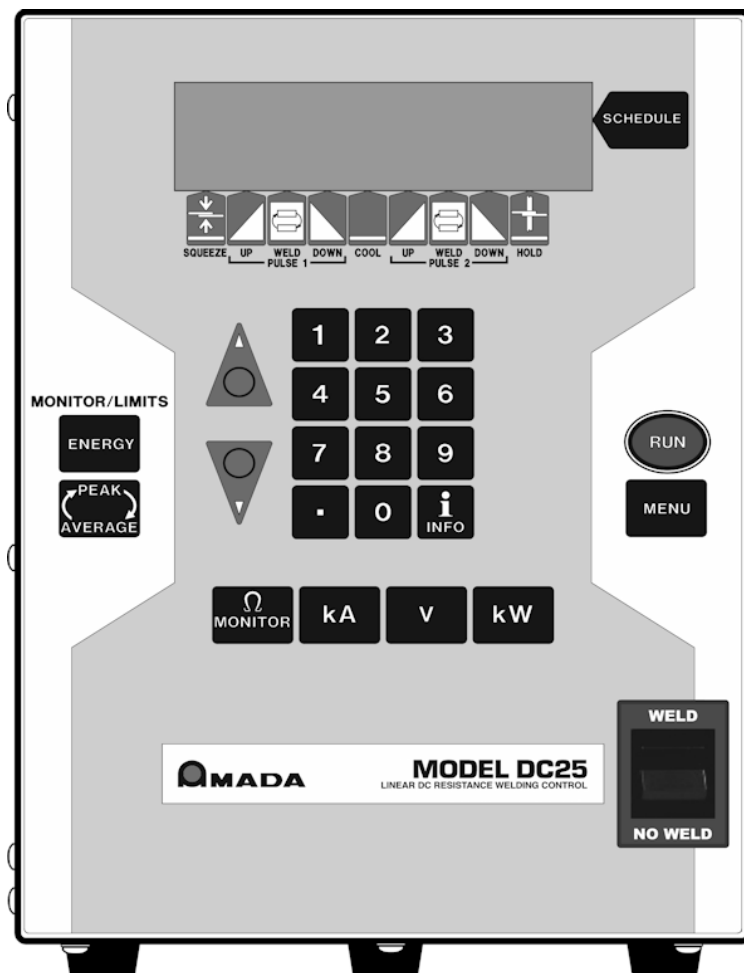

DC25 Front Panel

The front panel contains all the controls and indicators necessary to operate the Power Supply. You can program the Power Supply using the data input keys and information appearing in the Liquid Crystal Display (LCD). Descriptions for each button and display are in *Section IV* of this chapter, *Controls and Indicators*.

All electrical connectors, data connectors, and the **ON / OFF** switch are located on the rear panel of the Power Supply. Connection instructions are described in *Chapter 2, Getting Started*.

Complete technical specifications for the Power Supply are listed in *Appendix A, Technical Specifications*.

Connector pin identification and specifications are listed in *Appendix B, Electrical and Data Connectors*.

DC25 LINEAR DC RESISTANCE WELDING CONTROL

Section III: Overview

Introduction


The front panel of the Power Supply contains the **Liquid Crystal Display (LCD)**, and pushbutton **keys** (Weld Selector Keys, Numeric Keypad, and Operational Controls). Each is described in *Section IV, Controls and Indicators*. The LCD and the front panel keys are used together when programming and operating the Power Supply. Instructions on how to do this are in *Chapter 4, Operating Instructions*.

The LCD displays all of the setup, programming, and operating information for the Power Supply. The front panel keys allow you to enter data for programming custom weld schedules, customizing the operating parameters of the Power Supply, and operating your welding equipment. The keys also allow you to program the precise voltage, current, power, and time of each energy pulse into individual weld schedules, which may contain one or two weld pulses. Weld schedules consist of:

- Squeeze time before the weld pulse(s) [after the firing input is given]
- The time and energy for each weld period
- Cooling time between Pulse 1 and Pulse 2 [if two pulses are used]
- Hold time after the welding pulse(s)

You can program and store up to 99 different weld schedules to meet a variety of welding applications.

LCD Screens

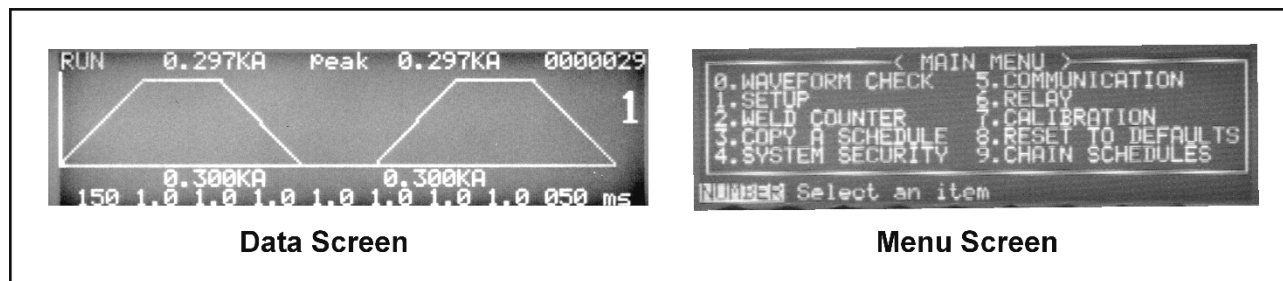

LCD Display Screens

The LCD displays two types of screens: **Data** screens and **Menu** screens.

NOTE: The purpose of this section is to describe the *content* of LCD screens. For clarity, LCD screens are shown here *without* the Weld Selector keys located directly under the display.


Menu Screens

Menu screens are text screens that allow you to select and customize the operating parameters of the Power Supply and performance of the welding equipment. Each menu screen lists several choices, with some offering additional menu screens listing more choices. The numeric keypad is used to select choices from the menu.

Data Screens

The Data screens display the information necessary to program, run, and monitor welds. Data is displayed in both alphanumeric and graphic form on the same screen. The graph displays **time** values from left to right, and **energy** values from bottom to top, showing the waveform of the weld schedule. The waveform gives you an easy-to-see "before and after" comparison of how you programmed the weld, and how the weld was actually performed.

Alphanumeric Data

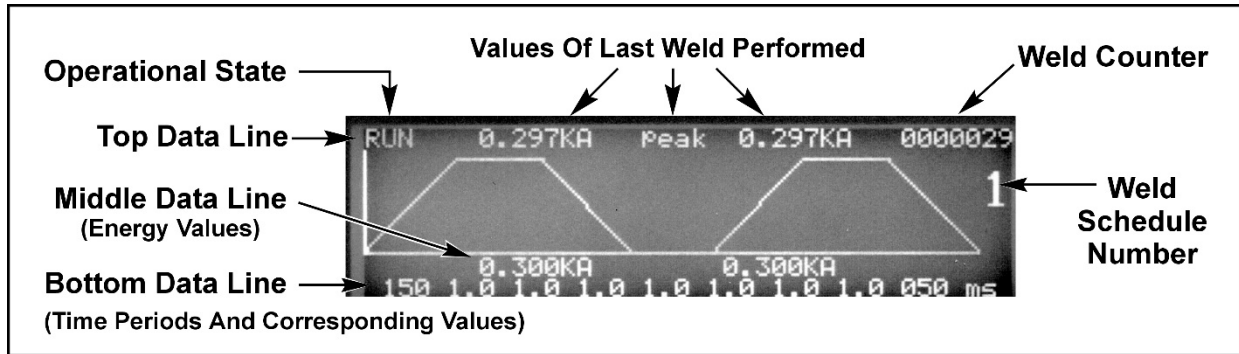

Alphanumeric Data

Alphanumeric data is displayed on three lines. Operating instructions will refer to alphanumeric data as the **Top Line**, **Middle Line**, and **Bottom Line** as shown above. *Chapter 4, Operating Instructions*, describes how to enter alphanumeric data, and how to select between voltage, current, power, peak/average display, and operational states.

Operational States

Each **Data Screen** displays the current operational state of the Power Supply in the **Top Line** of data (left side). Menu Screens do not display the operational state, but the menu itself indicates the Power Supply is in the **MENU** state. The following table describes each of the Power Supplies operational states.

CHAPTER 1: DESCRIPTION

DC25 Operational States


STATE	DESCRIPTION
RUN	This state indicates the Power Supply is ready to weld and waiting for a start signal. Press the RUN key on the front of the Power Supply to put the Power Supply in this state.
NO WELD	In this state, the Power Supply does not deliver weld energy to the weld head heads in order to prevent electrical shock. This state is used for cleaning electrodes or adjusting the air regulators on air actuated weld. If a start signal is received, the Power Supply will execute its programmed weld schedule(s) -- but no energy will go to the weld head, and the LCD will display a WELD SWITCH IN NO WELD POSITION alarm. The WELD/NO WELD switch toggles the Power Supply between the WELD and NO WELD states.
PROGRAM	In this state, the weld time and energy values can be modified and new schedules can be selected. From the RUN state, press any one of the WELD SELECTOR KEYS to put the Power Supply in the PROGRAM state.
TEST	When a weld schedule is changed, the Power Supply has the capability of performing a TEST weld in order to optimize the feedback control loop and produce the fastest rise-time, minimum-overshoot weld pulse. The Power Supply can be programmed to ALWAYS do a test weld after a schedule is changed, ASK to do a test weld after a schedule is changed, or only IF REQUIRED , do a test weld after a schedule is changed.
STANDBY	When an air actuated weld head is being used, the Power Supply will go to the STANDBY state when the footswitch is pressed.
SQUEEZE	When a start signal has been received, the Power Supply enters the SQUEEZE state for the duration programmed in the schedule. An adequate amount of squeeze time should be programmed to allow the weld head to settle before the WELD period begins. The default SQUEEZE time is 150ms (milliseconds). NOTE: In addition to the debounce time, there is a delay of no greater than 2.5ms before the start signal is recognized by the Power Supply.
WELD	The WELD period begins after SQUEEZE time has ended and includes both weld pulses as well as the Cool time between Pulse 1 and Pulse 2.
HOLD	The HOLD period begins after the WELD period ends and lasts for the duration programmed in the schedule. An adequate amount of hold time should be programmed to allow the electrodes to sink the heat away from the welded parts. The default HOLD time is 50ms. It is during the HOLD time that the weld strength is formed.
END	The Power Supply will enter the END state after the HOLD period if the firing switch or footswitch has not yet been released.
MONITOR	This state allows you to view waveforms of weld voltage, current, power, and resistance . Press the ENERGY key to go to the MONITOR state. The LCD will show the actual trace of energy of the last weld performed. You can also view the peak or average energy value for each weld pulse as selected by pressing the PEAK/AVERAGE key. If a start signal is received while in the MONITOR state, the Power Supply will execute the programmed weld schedule and the waveform trace will update with the new weld data. The operational state will then read RUN , and the LCD screen will show the monitored data.
ALARM	The Power Supply automatically goes into an alarm state when it recognizes any alarm condition (these are described in detail in <i>Appendix E, LCD Display Messages</i>).

DC25 LINEAR DC RESISTANCE WELDING CONTROL

DC25 Operational States

STATE	DESCRIPTION
MENU	Pressing the MENU key puts the Power Supply in the MENU state, which displays the MAIN MENU on the LCD. A series of menu and sub-menu screens enable you to change the Power Supplies operating parameters (see <i>Chapter 4, Operating Instructions</i>).

Graphed Data

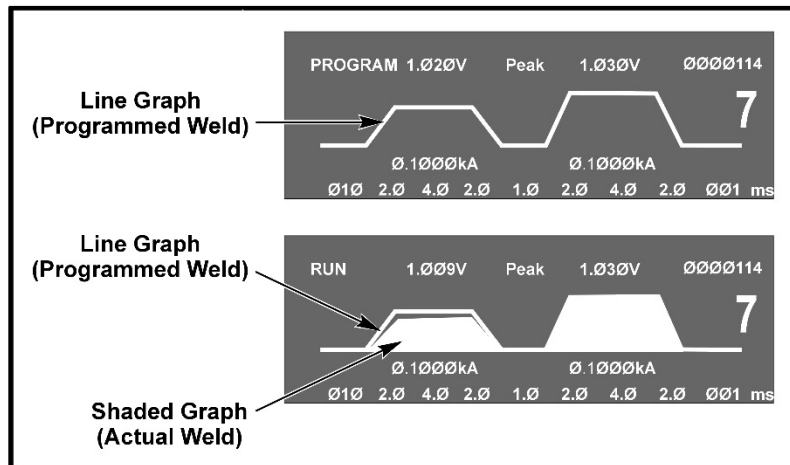

Graphed Data

Line Graph. When you enter data to program a weld schedule, the Power Supply automatically draws the data in graphic form, a line graph [or *waveform*] of a **programmed** weld schedule. As you enter data on the keypad, you will see the graph change as you program new data. When you have entered all the data, you will see the completed waveform.

Shaded Graph. After each weld is performed, the LCD displays a white, **shaded graph** showing the waveform of the actual weld pulse. The LCD now displays both graphs together, allowing you to visually compare the line graph to the shaded graph to see if the weld was completed properly.

The actual weld energy delivered [**shaded graph**] is dependent on the load resistance, including cables, the weld head, and parts to be welded. A missing area of the **shaded graph** indicates that the Power Supply is not able to deliver the programmed energy, most likely due to the load resistance. If the front part of the shaded graph is missing, the load resistance is not allowing the Power Supply to instantly deliver the programmed energy. You can compensate for this by using the upslope feature when programming a weld schedule [see *Chapter 3, Using DC25 Welding and Monitoring Functions* and *Chapter 4, Operating Instructions*]. The data lines on the LCD may also display alarm messages showing that the weld was inhibited, stopped, or terminated and the reason why the action was taken.

Section IV: Controls and Indicators

Introduction


The Controls and Indicators on the front panel of the Power Supply are grouped in two clusters:

- **Liquid Crystal Display (LCD) and Weld Selector Keys**
- **Numeric Keypad and Operational Controls**

Various functions of the Power Supply may require the use of buttons or keys from each cluster. This section describes each button and key on the front panel. Descriptions are given in the order they appear on the front panel from left-to-right, and from the top of the panel to the bottom.





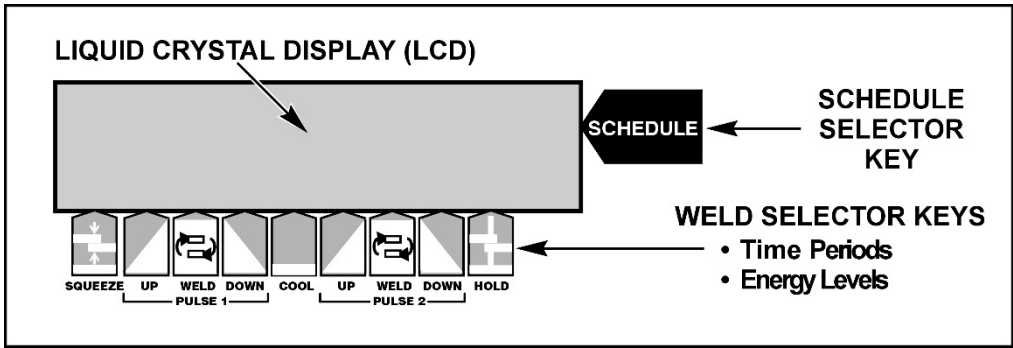



Step-by-step instructions on how to use the controls and indicators are in *Chapter 4. Operating Instructions*. Operating Instructions will list the buttons and keys in the sequential order necessary to perform each task.

Liquid Crystal Display (LCD) and Weld Selector Keys

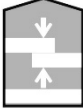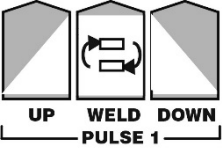


LCD and Weld Selector Keys


KEY	FUNCTION
	Press to view and select a <i>Weld Schedule</i> . After pressing the SCHEDULE key, you can use either the ▲ ▼ (up/down) keys on the front panel to scroll through the 99 stored <i>Weld Schedules</i> , or use the numeric keypad to enter the two-digit number of the desired schedule.
	Weld Selector Keys. A group of nine keys used to program the time periods and energy levels for each complete weld schedule.

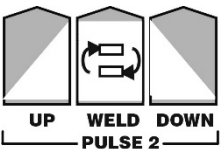



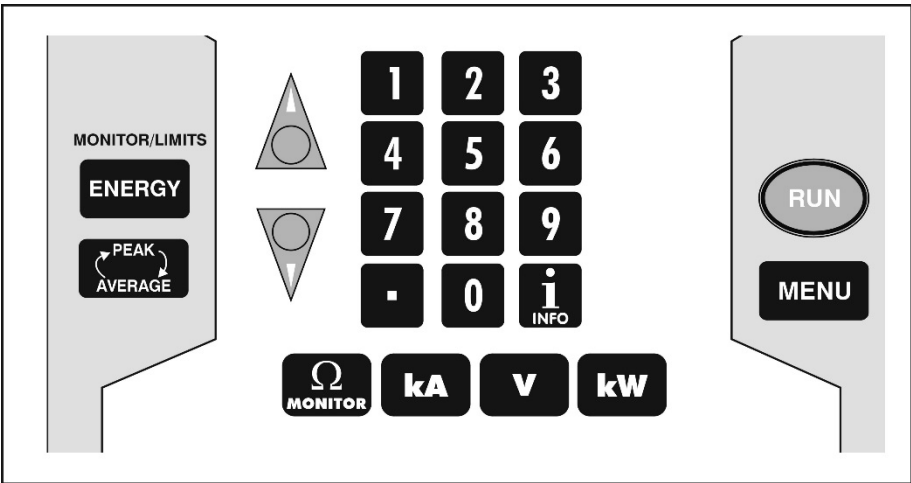


KEY	FUNCTION
 SQUEEZE	<p>Press to enter the squeeze time before the weld. To select the value, use either the ▲ ▼ (up/down) keys, or use the numeric keypad to enter the numbers. The squeeze time will start after a firing signal is given to the Power Supply.</p> <p>NOTE: In addition to the debounce time, there is a delay of no greater than 2.5 ms before the start signal is recognized by the Power Supply.</p>
 UP WELD DOWN PULSE 1	<p>A group of 3 individual keys used to program the time and energy for Pulse 1. Each key is described below.</p>
 UP	<p>Press to enter the amount of time Weld Pulse 1 upslope. To select the value, use either the ▲ ▼ (up/down) keys, or use the numeric keypad to enter the numbers.</p>
 WELD	<p>This switch toggles between the middle and bottom data lines on the LCD. To enter weld energy values (energy level and feedback mode), press the switch to highlight the middle line. To enter weld time values [in milliseconds], press the WELD switch again to highlight the bottom line. To select energy and time values, use either the ▲ ▼ (up/down) keys, or use the numeric keypad to enter the numbers and decimal point. To select feedback mode, press the kA, V, or kW key.</p>
 DOWN	<p>Press to enter the amount of time for Weld Pulse 1 downslope. To select the value, use either the ▲ ▼ (up/down) keys, or use the numeric keypad to enter the numbers and decimal point.</p>
 COOL	<p>Press to enter the amount of time for the cool period. To select the value, use either the ▲ ▼ (up/down) keys, or use the numeric keypad to enter the numbers and decimal point.</p>
 UP WELD DOWN PULSE 2	<p>A group of three individual keys that program Pulse 2. These keys have the exact same function as the Pulse 1 Keys.</p>
 HOLD	<p>Press to enter the amount of time for the hold period after the weld. To select the value, use either the ▲ ▼ (up/down) keys, or use the numeric keypad to enter the numbers.</p>

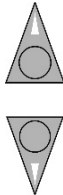Numeric Keypad and Operational Controls




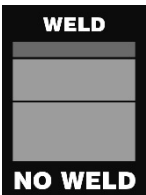


Numeric Keypad and Operational Controls

KEY	FUNCTION
<div>MONITOR/LIMITS</div> <div>ENERGY</div> <div>PEAK AVERAGE</div>	Monitor/Limits - a group of two keys that allows you to view monitor data and set limits of welding parameters. If the weld exceeds pre-set limits, the Power Supply can be programmed to initiate alarms and/or interrupt welds.
ENERGY	Displays the energy limits monitor allowing you to view the graphic waveform trace of the selected parameter. Welding in the MONITOR state allows you to watch and verify welds as they are being made. Welding can be automatically interrupted when the programmed limit value of current , voltage or power has been reached. Using the RELAY MENU screens, you can also program relays to provide an output alarm signal when limits are exceeded.
PEAK AVERAGE	Switches the display between the peak welding energy and the average welding energy readings. Data is displayed in the top data line on the LCD.
	Press to: <ul style="list-style-type: none">• Increment (increase) or decrement (decrease) numeric values on the display• Scroll the weld schedule numbers up and down.

KEY	FUNCTION
	Numeric Keypad <ul style="list-style-type: none"> • Enter or modify weld period time and energy values. • Enter or modify monitor and limit values. • Directly recall a specific weld schedule. • Select menu items when MENU screens are displayed.
	Press to insert a decimal point into the time and energy values you enter.
	Press to display the version number of the Power Supply software and other pertinent information about the Power Supply.
	Press to return to the RUN state or to clear alarms. When using any MENU screen, press this key to exit the menu.
	Press to display the MENU screen. <i>Chapter 4, Operating Instructions</i> describes how to use the different MENU options.
	When in the MONITOR state, press to view the resistance waveform of the last weld. The resistance waveform and values are provided as a reference and are designed to provide an illustration of the resistance change during the weld.
<p>NOTE: The kA, V, and kW keys are used to:</p> <ul style="list-style-type: none"> • Set the feedback mode for Pulse 1 and Pulse 2 in the weld schedule. • Set the feedback parameters for upper and lower monitor limits. • Select the monitor mode to be viewed on the LCD display. 	
	<p>When PROGRAM is displayed, this key is used to set current as the feedback mode for Pulse 1 or Pulse 2. First, use the WELD key to highlight the energy field, then enter the desired output level with the numeric keypad, then press the kA key to change the feedback mode to current.</p> <p>When MONITOR or RUN is displayed in the MONITOR state, this key is used to set current as the limit parameter for Pulse 1 or Pulse 2. First, use the WELD key to highlight the energy field, then enter the desired limit level with the numeric keypad, and then press the kA key to change the limit parameter to current.</p>

CHAPTER 1: DESCRIPTION


KEY	FUNCTION
	(continued) When MONITOR or RUN is displayed in the MONITOR state, press the kA key to view the current graph on the LCD display.
	<p>When PROGRAM is displayed, this key is used to set voltage as the feedback mode for Pulse 1 or Pulse 2. First, use the WELD key to highlight the energy field, then enter the desired output level with the numeric keypad, and then press the V key to change the feedback mode to voltage.</p> <p>When MONITOR or RUN is displayed in the MONITOR state, this key is used to set voltage as the limit parameter for Pulse 1 or Pulse 2. First, use the WELD key to highlight the energy field, then enter the desired limit level with the numeric keypad, and then press the V key to change the limit parameter to voltage.</p> <p>When MONITOR or RUN is displayed in the MONITOR state, press the V key to view the voltage graph on the LCD display.</p>
	<p>When PROGRAM is displayed, this key is used to set power as the feedback mode for Pulse 1 or Pulse 2. First, use the WELD key to highlight the energy field, then enter the desired output level with the numeric keypad, and then press the kW key to change the feedback mode to power.</p> <p>When MONITOR or RUN is displayed in the MONITOR state, this key is used to set power as the limit parameter for Pulse 1 or Pulse 2. First, use the WELD key to highlight the energy field, then enter the desired limit level with the numeric keypad, and then press the kW key to change the limit parameter to power.</p> <p>When MONITOR or RUN is displayed in the MONITOR state, press the kW key to view the power graph on the LCD display.</p>
	<p>WELD position - when a weld is initiated, the Power Supply delivers energy to the weld head.</p> <p>NO WELD - allows the Power Supply to execute a complete weld sequence but does not deliver energy to the weld head. This function is useful for testing and adjusting the weld head before operation, and when cleaning electrodes.</p>

Section V: Emergency Stop Switch and 24V Jumpers

The Power Supply is shipped with two 25-pin mating plugs installed on the two I/O connectors on the rear panel of the Power Supply. These two plugs, connected to **I/O Connector A** and **I/O Connector B** are pre-wired with two jumpers for the **24 V Power** signals and a shorted two-wire lead for the **Emergency Stop Switch** connection. For connector pin identification and specifications, including the 24 V Power signals, see *Appendix B, Electrical and Data Connectors*.

NOTE: The Power Supply will not function if these plugs are not installed.

The plug connected to **I/O Connector A** is pre-wired with a two-wire lead for the *Emergency Stop Switch*. The lead wires are shorted together [normally closed] and secured with a wire nut.

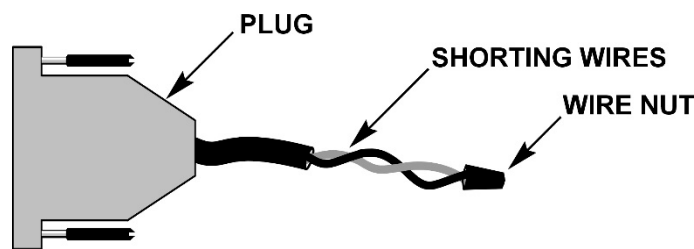

Emergency Stop Switch Shorting Wires

NOTE: For clarity, the tag attached to the shorting wires containing instructions in several languages is not shown here. The tag (with the complete text) is shown in *Appendix B, Electrical and Data Connectors*.

You may operate the Power Supply with or without an Operator Emergency Stop Switch. For operation *without* an Emergency Stop Switch, leave the two wires of the emergency stop lead shorted together (closing the circuit).

To operate *with* an Emergency Stop Switch, connect a normally closed, emergency stop switch across the two wires of the emergency stop lead. This switch, when actuated (opening the circuit), will immediately stop the weld cycle and retract the weld head. This emergency stop does not require the intervention of the microprocessor.

To restart the Power Supply after an emergency stop, press the **RUN** key on the front panel. Verify that the desired schedule is still displayed on the front panel, and then resume welding.

For user convenience, pins 9 and 13 of **I/O Connector B** have an additional input to stop the functioning of the unit. This input will stop weld current and raise the weld head. This input requires the microprocessor to be operational and is not the emergency stop for the unit.

Section VI: Related Publications

Related publication, which you may wish to obtain from AMADA WELD TECH is:

- *SL-300A Fast Response Weld Head System*, Part Number 990-115.

Please consult your representative to obtain this information.

CHAPTER 2

GETTING STARTED

Section I: Planning for Installation

Space Requirements

We recommend that the Power Supply be installed in a well-ventilated area that is free from excessive dust, acids, corrosive gasses, salt, and moisture. Other installation considerations are:

- Allow sufficient clearance around both sides and the back for power and signal cable runs.
- Allow ample workspace around the Power Supply so that it will not be jostled or struck while welding.
- The work surface must be level, stable, free from vibration, and capable of supporting the combined weight of the total welding system.
- The Power Supply must be far enough from the weld head to avoid contact with weld splash.
- Assure that there are no sources of high-frequency energy close by.

Dimensions and weight are:

Height:	12.75 in.	(324 mm)
Width:	9.25 in.	(235 mm)
Depth:	23.5 in.	(597 mm)
Weight:	52 lb	(24 kg)

Utilities

Power requirements will vary depending on your configuration.

Model DC25: 115 volts AC, 15 amps

Model DC25/230: 230 volts, AC, 10 amps

The power cable for the 230 volt version of the Power Supply (Model DC25/230) is not supplied with a wall connector due to the variety of connectors used by different countries. You will need to install the appropriate power cable and connector on the Power Supply before installation and setup. The input power wiring diagram is in *Appendix B, Electrical and Data Connectors*.

If you will require compressed air and cooling water service for the weld head, please refer to the weld head manufacturer's user's manual for service specifications.

Section II: Unpacking

As you unpack the shipping container, find the Shipping Kit List. Verify that contents of the container agree with the kit list. The Power Supply is shipped to you completely assembled and ready-to-use. The available accessories for the Power Supply are:


- 2-Level Foot Switch
- Weld Head appropriate for the welding application
- Input / Output Mating Connectors
(for use on cables connecting the Power Supply to external equipment)

Verify that the equipment shows no signs of damage. If you see any damage, please contact the carrier. Also, contact AMADA WELD TECH immediately by telephone, FAX, or the postal or e-mail address shown in the Foreword of this manual.

NOTE: Save the packing material. Carefully place the packing materials back in the packing boxes and store for future shipping.

Section III: Electrical and Data Connections

All connections between the Power Supply, switches, the weld head, and external equipment, such as PLC and data, are made on the rear panel.

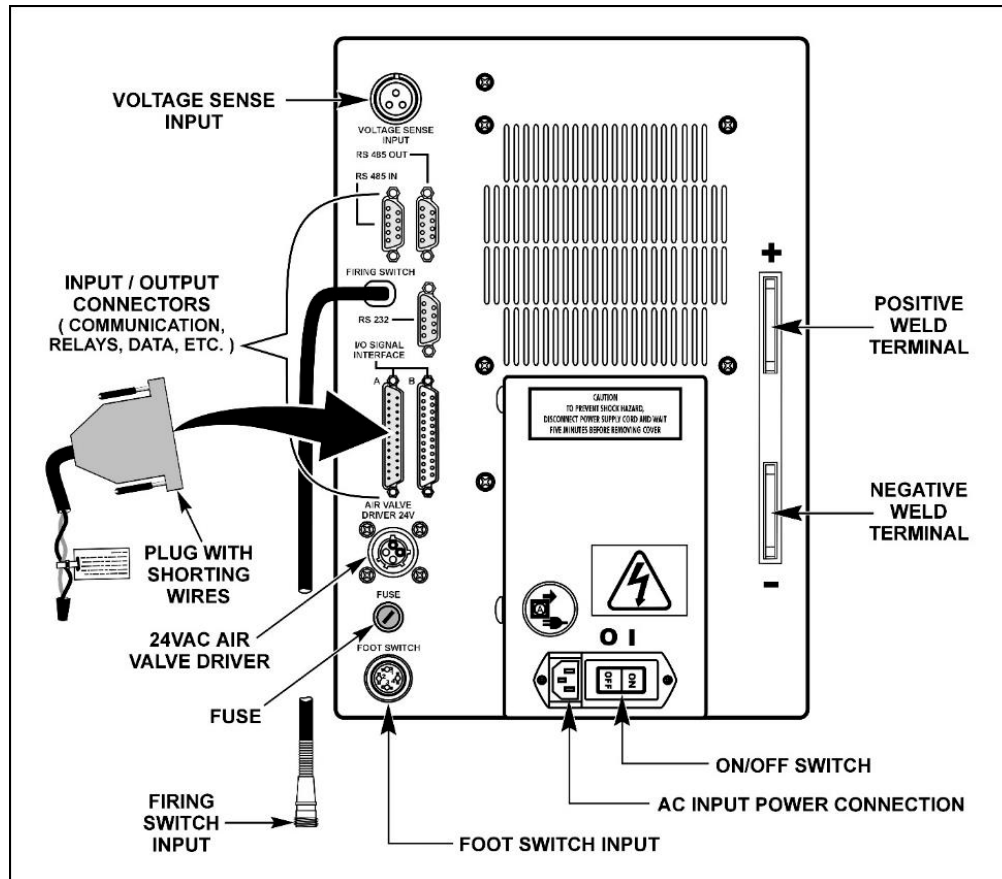

DC25 Rear Panel Connections


NOTE: The Power Supply is shipped with **two** 25-pin mating plugs installed on the two I/O connectors on the rear panel (the plug for Connector B is not shown for clarity). The Power Supply will *not* function if these plugs are not installed. The plug connected to I/O Connector A is pre-wired with a two-wire lead for the *Emergency Stop Switch*. For details, see *Chapter 1, Section V, Emergency Stop Switch And 24V Jumpers*.

NOTE: Wiring of cables and connectors going to the Power Supply should **only** be done by qualified service personnel. Connector pin identification and specifications for the rear panel connectors are located in *Appendix B. Electrical And Data Connectors*.

NOTE: For clarity, illustrations in the rest of this manual do not show the power cable connected to the Power Supply, even though the power cable **must** be connected in order to operate the Power Supply.

Section IV: Setup

Manual Weld Head Connections

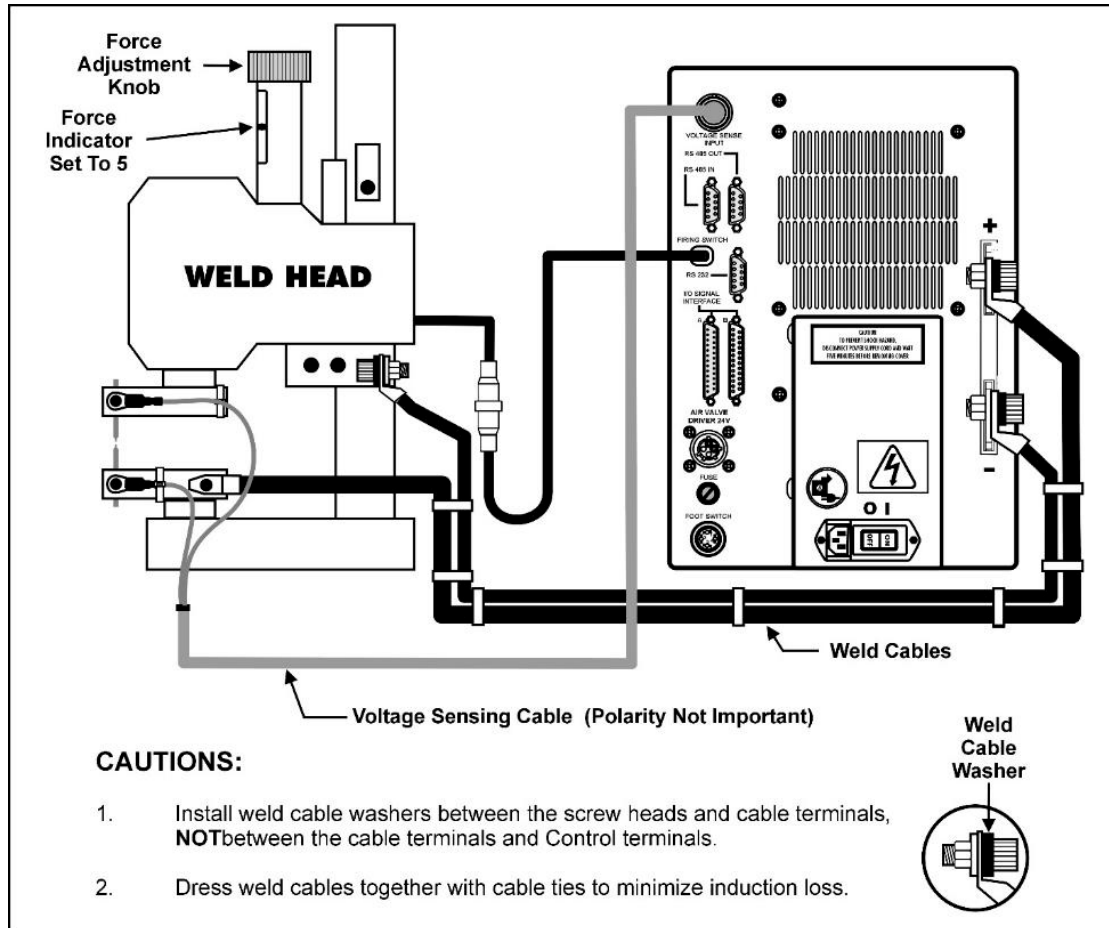


Manual Weld Head Connections

- 1 Connect one end of a weld cable to the negative (-) weld terminal on the Power Supply.
- 2 Connect one end of the second weld cable to the positive (+) weld terminal on the Power Supply.
- 3 Connect the other end of the two weld cables to the weld head.
- 4 Dress the weld cables together with cable ties to minimize induction losses.
- 5 Attach the voltage sensing cable connector to the **VOLTAGE SENSE INPUT** connector.
- 6 Install electrodes in the weld head electrode holders.
- 7 Attach voltage sensing cables to the screws on the electrode holders as shown below.

- 8 Using a cable tie as a strain relieve, attach each voltage sensing lead to its corresponding electrode holder so that the lead terminals will not break away under heavy production operating conditions.
- 9 Connect the Firing Switch cable connector from the Power Supply to the firing switch cable connector from the weld head.

Air-Actuated Weld Head Connections

If you are using an air-actuated weld head, you will need to make the following two connections in addition to the manual weld head connections.

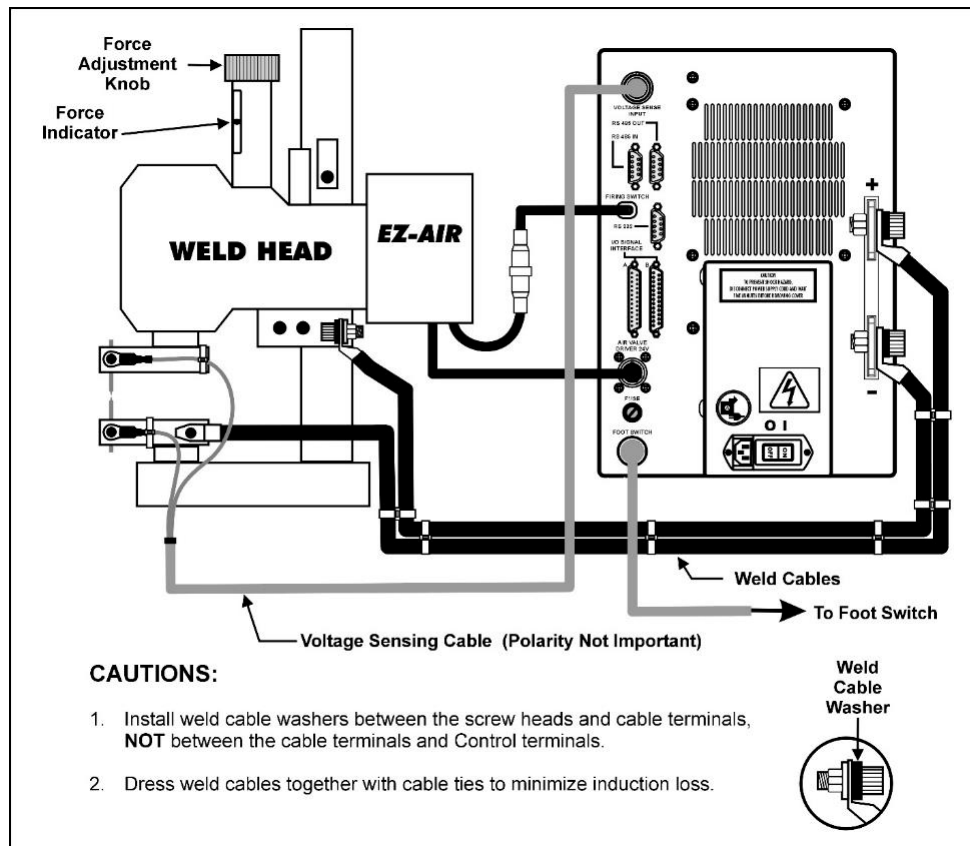

Air Head Connections

- 1 Connect the Model FS1L or FS2L Foot Switch cable connector to the Power Supply connector marked **FOOT SWITCH**.
- 2 Connect the weld head air valve solenoid cable connector to the Power Supply connector marked **AIR VALVE DRIVER 24V**.

NOTE: This connector provides 24 VAC power only. It will not drive 115 VAC air valves. Refer to the weld head manufacturer's manual.

Relay, Data, And Communication Connections

For the Power Supply programmable relay connections, PLC, data logging, or other I/O connections, you will have to fabricate the appropriate connecting cables. For the Power Supply connector pin identification and specifications, see *Appendix B, Electrical and Data Connectors*.

CHAPTER 3

Using DC25

Welding and Monitoring Functions

Section I: Introduction

To ensure accurate, consistent welds, the Power Supply delivers extremely precise pulses of energy to the weld head. Each pulse is comprised of weld-time and weld-energy (**voltage**, **current**, or **power**) values pre-programmed by the user. The Power Supply is a closed-loop welding control using internal and external sensors to measure the weld-energy delivered to the weld head. Weld-energy feedback instantly goes to the Power Supplies logic circuits that actively correct the pulse to compensate for any variation in part resistance. The Power Supply also has several monitor functions that give you remarkable control over the welding and production process. Together, these features ensure precise, consistent welds, higher productivity, a lower rejection rate, and longer electrode life.

Before operating the Power Supply, it is important to know how to match the Power Supplies capabilities to specific weld applications. This chapter provides **Weld**, **Feedback**, and **Monitor** details in the following sections:

- **Weld Schedules**
 - **Single-Pulse**
 - **Upslope/Downslope**
 - **Dual-Pulse**
- **Programmable Feedback Modes**
- **Weld Monitor**
 - **Active Part Conditioner**
 - **Energy Limits**
 - **Pre-Weld Check**

Chapter 4, Operating Instructions, contains the step-by-step instructions on how to program each of the functions above.

Section II: Weld Schedules

Definition


Weld Schedule is the name given to each of 99 separate *weld profiles* stored in the Power Supply, numbered from **01 - 99**. A weld profile is the graphic representation [or *waveform*] of the numeric weld-time and weld-energy values. **NOTE:** There is an additional weld schedule numbered **00**, which can be used as a "scratch pad" to develop new weld schedules.

When time and energy values are entered using the numeric keypad, the Power Supply displays a line-graph of the weld profile on the LCD screen. You can see the graph change as you enter new time and energy values.

Weld profiles may be programmed for **single-pulse**, **upslope/downslope**, or **dual-pulse** operation. Weld schedules may also use special monitoring features of the Power Supply such as **Energy Limit**, **Active Part Conditioner**, and **Pre-Weld Check**. These features are described later in this chapter.




Weld Sequence Timing

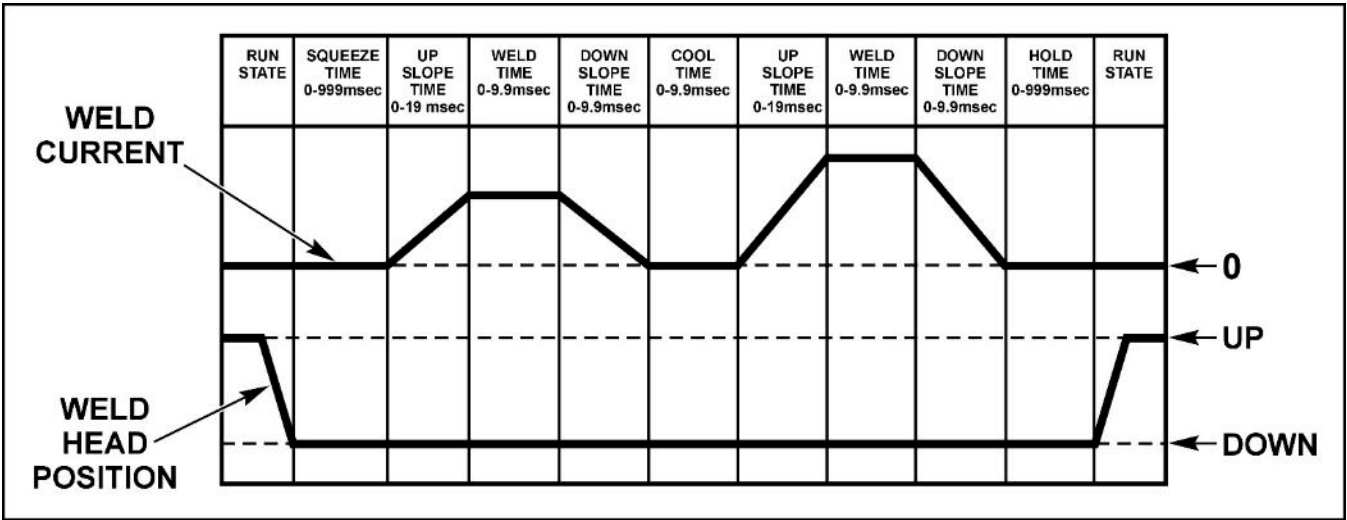A weld schedule is a unique heat profile programmed in constant **current**, **voltage**, or **power** that is applied over a fixed time period, to resistance weld different parts. The entire weld can include all of the following time periods: Squeeze Time, Upslope 1, Weld Pulse 1, Downslope 1, Cool Time, Upslope 2, Weld Pulse 2, Downslope 2, and Hold Time. The sample dual-pulse profile [or *waveform*] below shows the weld current and the corresponding position of the weld head. The graph labeled **WELD CURRENT** displays on the LCD when you schedule a weld profile.



Sample Weld Sequence (Dual-Pulse)

Welding Applications

Weld Pulse Profile		Typical Application
Single-Pulse		Can be used for many of spot-welding applications. Use on flat parts without plating, or on conductive parts such as those made of copper or brass.
Upslope/Downslope		Upslope/Downslope should be used for the majority of spot welding applications. Weld round parts, parts that are not flat, spring steel parts, or heavily plated or oxidized parts.
Dual-Pulse		Use for spot welding parts with plating. First pulse can be used to displace plating or oxides and the second pulse to achieve the weld.

For a detailed coverage of resistance welding theory, please refer to *Appendix C, The Basics of Resistance Welding*.

Weld Head Applicability

The Power Supply is best used with AMADA WELD TECH force-fired, manual weld heads or air actuated weld heads. For manually actuated weld heads, the weld sequence begins when the force-firing switch closes. For force fired, air actuated weld heads, the weld sequence begins when both levels of a two-level foot switch are closed and the force firing switch in the air actuated weld head closes.

When the Power Supply is used with any air actuated weld head, the squeeze period must be long enough to allow sufficient time for the electrodes to close and apply the required weld force to the parts before the weld current begins. Weld current begins when the squeeze period ends. In addition, the hold period can be used to automatically keep the electrodes closed on the parts after weld current has terminated to provide additional heat sinking or parts cooling. The weld strength is formed during the hold period.

CHAPTER 3: USING DC25 WELDING FUNCTIONS


Single-Pulse Weld Profile

Applications

- Flat parts that do not have any plating or heavy oxides.
- Conductive parts made of copper or brass.

Description

Single-Pulse is a term used by the industry to describe the simplest heat profile used for many resistance spot-welding applications.

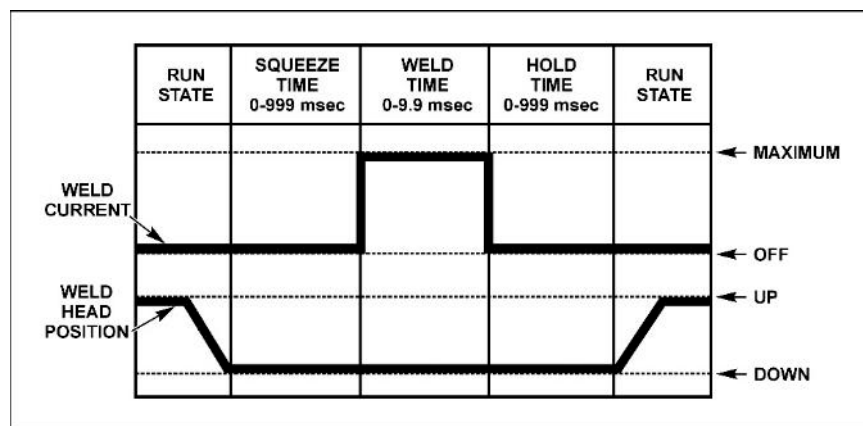

Single-Pulse Weld Profile

Upslope/Downslope Weld Profile

Applications


- Round or non-flat parts and most resistive materials.

Description

Upslope allows a gradual application of weld energy which permits the parts to come into better contact with each other reducing the electrode-to-part contact resistances. Upslope can allow a lighter electrode force to be used, resulting in a cleaner appearance by reducing electrode indentation, material pickup and electrode deformation. It can also be used to displace plating and/or oxides, reduce flashing and spitting, or reduce thermal shock when welding parts containing glass-to-metal seals.

CHAPTER 3: USING DC25 WELDING FUNCTIONS

Downslope (annealing) assists in the grain refinement of certain heat-treatable steels, and prevents cracking in aluminum and other materials by reducing the cooling rate. Annealing is not typically used for welding small parts.

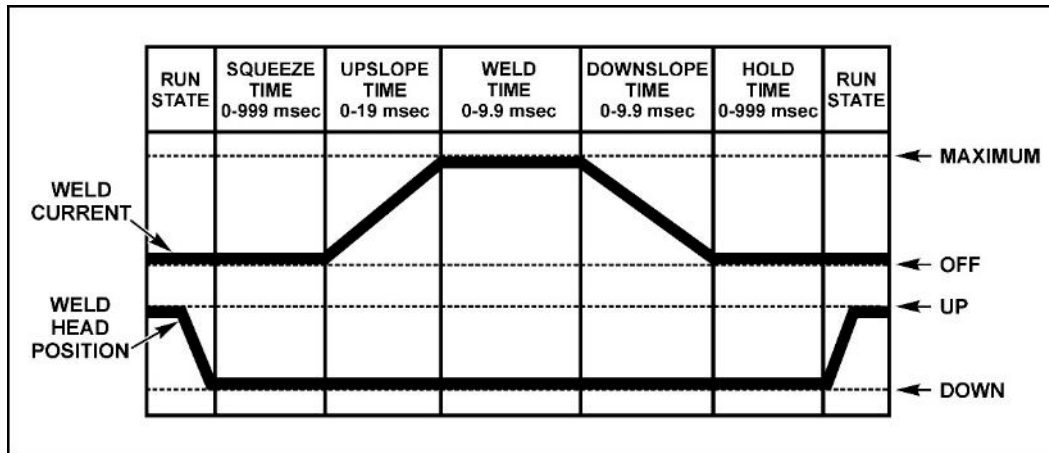

Upslope / Downslope Weld Profile


Dual-Pulse Weld Profile

Applications

- Flat-to-flat parts.
- Round-to-round parts.
- Round-to-flat small parts that may or may not be plated.

Description

Adding upslope to the front of both weld periods allows a reduction in electrode force. This results in a cleaner appearance by reducing electrode indentation, material pickup and electrode deformation.

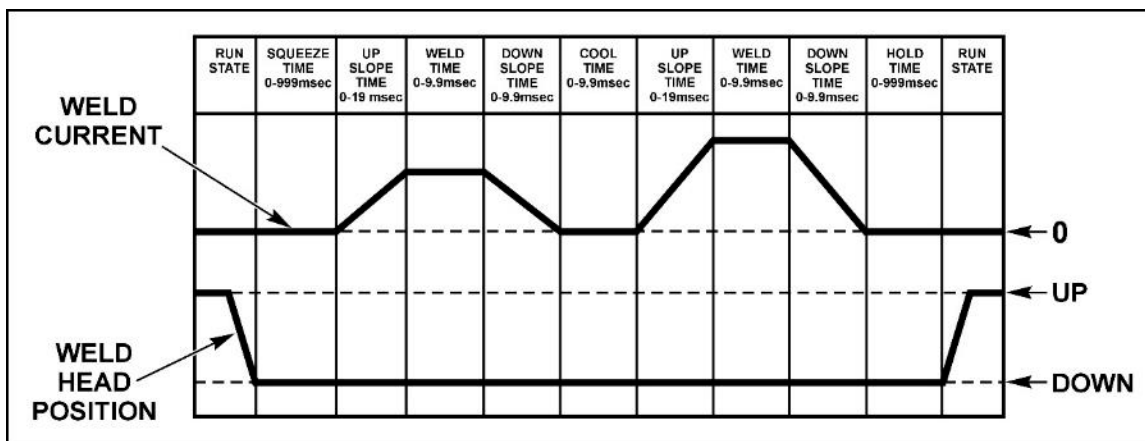

DC25 LINEAR DC RESISTANCE WELDING CONTROL

CHAPTER 3: USING DC25 WELDING FUNCTIONS

Upslope will also help to displace plating and/or oxides, reduce flashing and spitting, and reduce thermal shock when welding parts containing glass-to-metal seals. In the normal application of dual-pulse, the Pulse 1 weld period provides sufficient heat to displace the plating or oxides, seat the electrodes against the base metals, and force the parts into intimate contact. The cool period allows time to dissipate the heat generated during Pulse 1.

The Pulse 2 weld period completes the structural weld. The Pulse 2 weld current is typically greater than the Pulse 1 weld current by a factor of 3, as the first pulse significantly reduces the resistance of the interface between the parts. The purpose for the downslope period following either welding pulse is to control grain refinement in brittle parts by slowly reducing the weld current to zero during the downslope period.

The dual-pulse weld profile is very valuable for pre-checking gross parts positioning problems and reducing parts scrap. Use the Pulse 1 weld at 0.100 kA and 2.0 ms as a pre-check pulse. Experiment with upper and lower limit values that you can use to inhibit the Pulse 2 weld if the test conditions measured by the Pulse 1 weld are out of limits.

NOTE: Upslope is required when a lower limit value is programmed.

Section III: Programmable Feedback Modes

Introduction

The feedback mode (**current, voltage, power**) is one of the selections entered when programming a weld schedule. Programming weld schedules is explained in *Chapter 4, Operating Instructions*.

Current Mode

Application

- **Flat parts where the part-to-part and electrode-to-part contact is controlled and consistent.**

Description

This mode delivers the programmed current regardless of work piece resistance changes. This compensates for slight changes in part thickness without affecting weld quality.

Voltage Mode

Application

- **Ideal for welding round or non-flat parts.**

Description

This mode controls the voltage across the work piece during welding. It helps to compensate for part misplacement and force problems and automatically reduces weld splash, which is often associated with non-flat parts and wire welds.

Power Mode

Application

- **Breaking through surface oxides and plating.**
- **Automated applications where part or electrode surface conditions can vary over time.**

Description

This mode precisely varies the weld current and voltage to supply consistent weld energy to the parts. The power mode has been shown to extend electrode life in automated applications.

NOTE: In a dual-pulse weld profile, a different feedback mode can be used for each pulse. For example, a constant power first pulse can be used to break through plating in combination with a constant current second (welding) pulse.

Section IV: Weld Monitor

Introduction

The Power Supplies feedback sensors not only control weld energy output, but they can also be used to monitor each weld. The Power Supplies monitor features allow you to view graphic representations of welds, visually compare programmed welds to actual welds, look at peak or average energy values, set upper and lower limits for welds, and make use of these features:

- Active Part Conditioner (APC)
- Energy Limits
- Pre-Weld Check

Active Part Conditioner (APC)

Application

- **Displace surface oxides and contamination.**
- **Reduce contact resistances before delivering the main weld energy.**

Description

In the production environment, it is common to see large variations in:

- Oxide and contamination.
- Plating thickness and consistency.
- Shape and fit up.
- Contact resistances due to varying part fit up.


In order for a weld to occur, the surface oxides and contamination must be displaced to allow proper current flow through the parts. Levels of oxide and contamination vary from part to part over time, which can have an adverse effect on the consistency of the welding process. If production parts are plated, there can also be a plating process variation over time resulting in inconsistent welds. These minor material variations are a major cause of process instability, and it is best welding practice to seek to minimize their effect.

Active Part Conditioner is designed to cope with material contamination, material variation, and can be programmed to apply the exact power to the parts required to displace oxide or contaminants. In addition, the “Part Conditioner” pulse will terminate at a precise current flow preventing the sudden high flow, which occurs when the oxide is displaced. This prevents weld splash and material expulsion, which occurs as a result of an excessively fast heating rate. Part conditioning can help to reduce variations in contact resistance from part to part caused by different fit up of parts. It will stabilize the contact resistances before the main welding pulse, therefore reducing variation from weld to weld.

How It Works


Both **constant current** feedback and **constant voltage** feedback modes are limited in their ability to deal with varying levels of part contamination and oxide. If **constant current** feedback were used, the power supply would ramp the voltage to very high levels in order to achieve current flow through the oxide. This rapid input of current is likely to cause splash, especially with round parts. **Constant voltage** mode is not ideal for this purpose either, as the voltage will be restricted from reaching sufficient levels to break down the oxide.

Constant power is ideal for this purpose. As the power supply tries to achieve constant power to the weld, it raises the voltage to high levels early in the output waveform, since current cannot flow due to the oxide. As the high voltage breaks down the oxide layer, more current flows to the weld and the voltage and resistance drop. It will achieve this in a controlled fashion to maintain constant power to the weld.

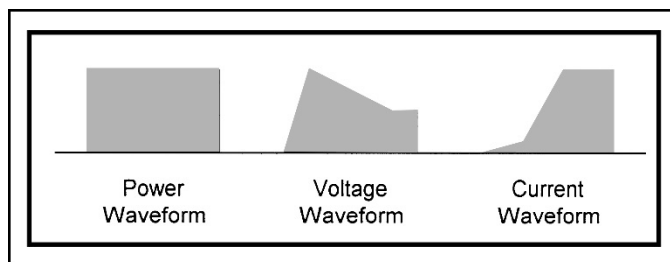

Constant Power Waveform with Corresponding Voltage and Current Waveforms

Active Part Conditioning uses a dual-pulse output. The first pulse is programmed for **constant power**, and the second for either **constant current**, **constant voltage**, or **constant power**. (**Constant voltage** is used if there is still a chance of weld splash). The purpose of a dual-pulse operation is to enable the first pulse to target displacement of oxides and good fit up, the second pulse achieves the weld.

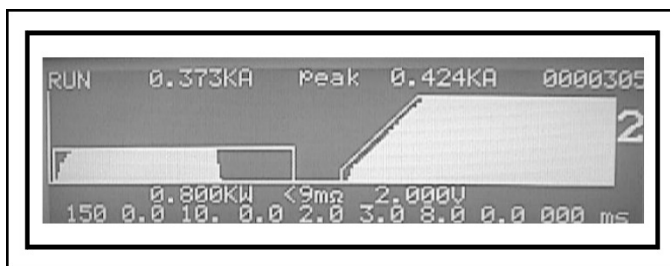

Active Part Conditioning Waveform

The use of a current limit monitor for the first pulse enables the pulse to be terminated when a predetermined amount of current flow is achieved. The rise of the current waveform is proof positive that the oxide is breaking down and the parts are fitting up together, ready to weld. The first pulse, therefore, should be programmed to be much longer than generally required. The power supply will terminate the pulse based on the reading of current in the power supply's monitor.

CHAPTER 3: USING DC25 WELDING FUNCTIONS

Instructions

Instructions for programming for Active Part Conditioning are listed in *Chapter 4, Operating Instructions*.

Energy Limits

Applications

- **Part-to-part positioning problems.**
- **Electrode-to-part positioning problems.**
- **Parts with narrow weld window.**

Energy Limits can be used in two different ways:

- To detect work piece resistance changes that occur when parts are positioned incorrectly at the weld head. In this case, the energy limits will prevent blowouts, parts damage, and electrode damage. Limits can be set to terminate the weld if this occurs.
- To stop the weld when a sufficient **current**, **voltage**, or **power** level is reached. Using limits in this way ensures a more consistent input of energy, which produces consistently good welds.


Description

This function terminates the weld energy during the welding process if pre-set weld **current**, **voltage**, or **power** limits are exceeded. In addition to inhibiting the weld, the Power Supply has four programmable relay outputs which can be used to trigger alarms to signal operators of weld faults, or signal automation equipment to perform pre-programmed actions, such as stopping the production line so the faulty weld piece can be removed.

The monitor measures the weld energy parameters during the weld period and compares the measurements against the programmed limits. If any of the programmed limits are exceeded, the energy limits monitor sets the Power Supply to a state selected from the **OUT OF LIMITS ACTION** menu. In addition, the Power Supplies relays can be programmed to trigger alarms, or trigger an action in an automated welding system.


Note: When using the energy limits monitor, always select a monitor mode that is *different* from the feedback mode. For example:

- If you are welding in **constant current**, monitor **voltage**.
- If you are welding in **constant voltage**, monitor **current**.
- If you are welding in **constant power**, monitor **current** or **voltage**.

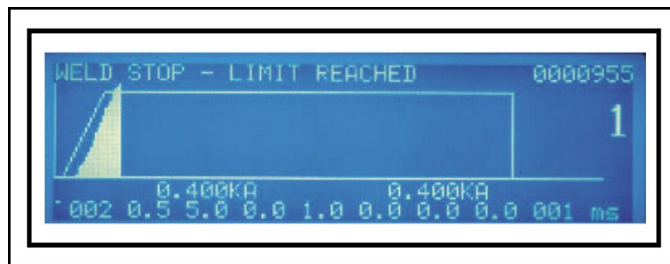

Example 1: Energy Limit Weld Termination

Example #1: In the profile above, the weld current is exceeding the selected upper limit before the end of the welding cycle. The spike in the current waveform indicates that parts were misplaced. In this case, the operator has selected the option to terminate the weld energy under this condition, so the energy limits monitor terminates the Pulse 1 weld and inhibits the Pulse 2 weld if it had been programmed.

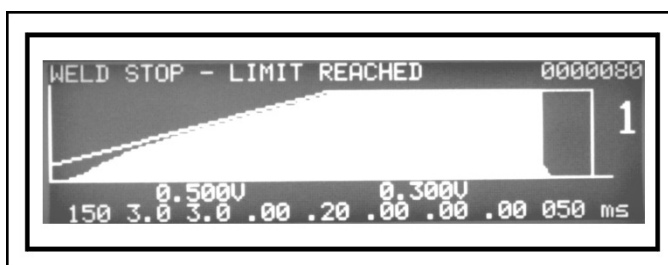

Example 2: Sufficient Current Level

Example #2: In the profile above, the weld current limit is at a sufficient level to get a good weld.

Pre-Weld Check

Application


- Detect Misaligned or Missing parts.

Function

This is used to see if parts are misaligned or missing *before* a welding pulse is delivered to the weld head. If a part is missing or misaligned, you do *not* want the machine to weld because the result would be an unacceptable weld and/or damaged electrodes.

Pre-Weld Check is similar to **Energy Limits**, however in this case Pulse 1 should be very **short** (1 - 2 milliseconds), and the current should be **low**, about 10 % of the Pulse 2 current. Pulse 1 should be used as a measurement pulse and should *not* perform a weld.

CHAPTER 3: USING DC25 WELDING FUNCTIONS

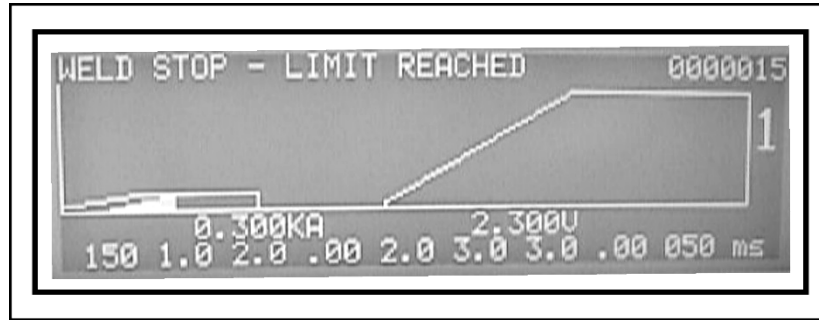

Pre-Weld Check Waveform

Example: To detect misaligned parts, use constant current and set upper and lower voltage limits for Pulse 1. If parts are **misaligned**, the work piece resistance will be higher, so the voltage will be higher. If parts are **missing**, voltage will be lower. In either case, the Pulse 1 upper or lower limits will be exceeded, and Pulse 1 can be inhibited.

NOTE: You must have **upslope** programmed into the pulse in order to set a lower limit.

In addition to inhibiting the weld, the Power Supply has four programmable relay outputs which can be used to trigger alarms to signal operators of weld faults or signal automation equipment to perform pre-programmed actions, such as stopping the assembly line so the faulty weld piece can be removed.

CHAPTER 4

OPERATING INSTRUCTIONS

Section I: Introduction

This Chapter tells you how to turn the Power Supply on, use menu screens to customize operating parameters, match the Power Supply to your welding system, and how to operate the Power Supply. This chapter is divided into the following sections:

- Initial Setup
- Programming Weld Schedules
- Programming The Weld Monitor
- Programming For Active Part Conditioning
- Operation

Before operating the Power Supply, you must be familiar with the following:

- The **location** and **function** of Controls and Indicators. For more information, see *Chapter 1* of this manual.
- How to **select** and **use** the Power Supply functions for your specific welding applications. For more information, see *Chapter 3, Using DC25 Welding and Monitoring Functions*.
- The principles of resistance welding and the use of programmed weld schedules. For more information, see *Appendix C, The Basics of Resistance Welding*.

For additional information on the welding process, see *Appendix D, Quality Resistance Welding Solutions, Defining the Optimum Process*.

Section II: Initial Setup

Pre-Operational Checks

Always perform these checks *before* attempting to operate the Power Supply.

Connections

Verify that the Power Supply has been connected to a manual or air-actuated weld head as described in *Chapter 2* of this manual. Verify that the Emergency Stop Switch shorting wires are connected *or* verify that an Emergency Stop Switch is connected properly.

Power

Verify that power is connected as described in *Chapter 2* of this manual.

Compressed Air


If you are using an air-actuated weld head, verify that compressed air is connected as described in the appropriate sections of your weld head manual. Turn the compressed air ON, and adjust it according to the instructions in your weld head manual.

Initial Setup Instructions

- 1 Adjust the weld head force adjustment knob for a force appropriate for your welding application. A good starting point is the mid-point in the range of the weld head force.
- 2 Set the **WELD/NO WELD** switch on the Power Supply front panel to the **NO WELD** position. In this position, the Power Supply will operate the weld head *without* producing weld energy.

NOTE: When you are ready to perform a weld, be sure to set this switch back to the **WELD** position.

- 3 Turn the **ON/OFF** switch on the rear panel of the Power Supply to the **ON** position. The default **RUN** screen will be displayed. You will use this screen to enter welding parameters.

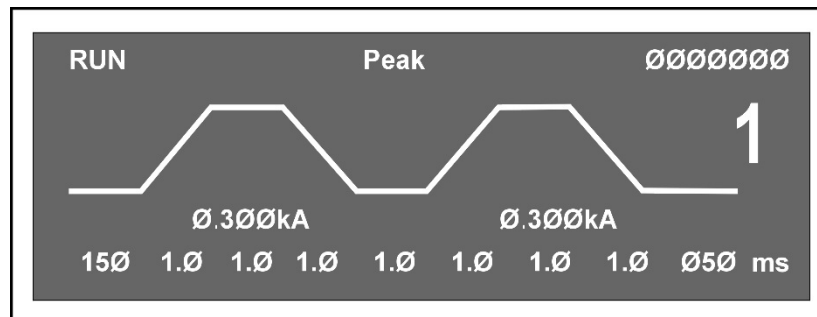


Default RUN Screen

Section III: Programming Weld Schedules

Introduction

The Power Supply comes with 99 factory-installed weld schedules, numbered from **01** through **99**. Each schedule is set to the same preset value and looks like the display on the right. See *Chapter 3, Using DC25 Welding And Monitoring Functions* for descriptions of the features available in weld schedules.

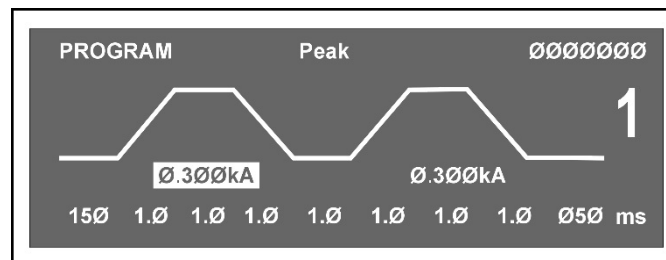

The process of **Programming** a weld schedule consists of:

- **Select** a weld schedule.
- **Enter** new values in the selected schedule.

NOTE: For reference and convenience, you might want to keep a written list of your programmed weld schedule values using the two-digit weld schedule number.

Select a Weld Schedule

- 1 To select weld schedules, first make sure that the **RUN** state is displayed on the LCD. If not, press the **RUN** button on the front of the Power Supply.
- 2 Press the **SCHEDULE** button on the right of the Power Supply.
- 3 Use *either* of the methods below to select a schedule:
 - Use the **▲ ▼** (Up/Down) buttons to scroll through the list.

OR

 - Use the numeric keypad to enter the two-digit number of the schedule you want.

 
Enter New Values












Some welding applications require no more than a simple weld schedule, programmed for Single-Pulse, Upslope/Downslope, or Dual-Pulse operation. For other applications, you may want to use the **Energy Limits Monitor** or **Active Part Conditioning** features of the Power Supply. To **enter new values**, follow the instructions for Single-Pulse, Upslope/Downslope, or Dual-Pulse weld schedules on the following pages.

NOTE: If different energy values are entered for Pulse 1 and Pulse 2, the Power Supply will require a minimum of 1.0 ms Cool Time. If different feedback modes are programmed for a dual pulse weld, the Power Supply will require a minimum of 1.0 ms Cool Time. If a Cool Time is set lower than 1.0 ms, but not zero, the Power Supply will default to 1.0 ms Cool Time.

CHAPTER 4: OPERATING INSTRUCTIONS












Single-Pulse Weld Schedule

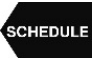

- 1  Press the **SCHEDULE** button, then select a Weld Schedule using **either** the ▲ ▼ arrows or the numeric keypad.
- 2  Press the **SQUEEZE** button to enter the squeeze time before the weld. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **999** ms. **NOTE:** We recommend 150 ms.
- 3  Press the **PULSE 1 UPSLOPE** button to enter the amount of time for the Weld Pulse 1 **upslope**. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter **0** ms.
- 4  Press the **PULSE 1 WELD** key to **highlight** the **bottom line** of the LCD to enter the weld time. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **9.9** ms.
- 5  Press the **PULSE 1 WELD** key again to **highlight** the **middle line** of the LCD to enter **weld energy**. Use the numeric keypad to enter the **energy level** or use the ▲ ▼ arrows. The Power Supply output ranges are:
 - **Current:** from **0.100** → **4.000** kiloamps.
 - **Voltage:** from **0.100** → **9.9** volts.
 - **Power:** from **0.100** → **9.9** kilowatts.
- 6 Perform **one** of the following:
 -  Press the **kA** key to program **current** as the feedback mode.
 -  Press the **V** key to program **voltage** as the feedback mode.
 -  Press the **kW** key to program **power** as the feedback mode.
- 7  Press the **PULSE 1 DOWNSLOPE** key to enter the amount of time for the Weld Pulse 1 **downslope**. Use the numeric keypad or the ▲ ▼ arrows. Enter **0** ms.
- 8  Press the **COOL** key to enter the amount of time for the cool period after Pulse 1. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter **1.0** ms.
- 9 Program Pulse 2 by repeating Steps 3 through 7 above using the keys for Pulse 2, entering the value **0** in each step.
- 10  Press the **HOLD** key to enter the amount of time for the hold period after the weld. Use the numeric keypad or the ▲ ▼ arrows. Enter a time between **0** and **999** ms. We recommend at least **50** ms as weld strength is formed in the hold time.

Upslope/Downslope Weld Schedule



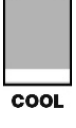




- 1  Press the **SCHEDULE** button, then select a Weld Schedule using **either** the ▲ ▼ arrows **or** the numeric keypad.
- 2  Press the **SQUEEZE** button to enter the squeeze time before the weld. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. We recommend 150 ms.
- 3  Press the **PULSE 1 UPSLOPE** button to enter the amount of time for the Weld Pulse 1 **upslope**. Use the numeric keypad or the ▲ ▼ arrows to enter the time. Enter a time between **0** and **19** ms. A good starting point is **5** ms.
- 4  Press the **PULSE 1 WELD** key to **highlight** the **bottom line** of the LCD to enter the weld time. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **9.9** ms.
- 5  Press the **PULSE 1 WELD** key again to **highlight** the **middle line** of the LCD to enter **weld energy**. Use the numeric keypad to enter the **energy level** or use the ▲ ▼ arrows. The Power Supply output ranges are:
 - **Current:** from **0.100** → **4.000** kiloamps.
 - **Voltage:** from **0.100** → **9.9** volts.
 - **Power:** from **0.100** → **9.9** kilowatts.
- 6 Perform **one** of the following:
 -  Press the **kA** key to program **current** as the feedback mode.
 -  Press the **V** key to program **voltage** as the feedback mode.
 -  Press the **kW** key to program **power** as the feedback mode.
- 7  Press the **PULSE 1 DOWNSLOPE** key to enter the amount of time for the Weld Pulse 1 **downslope**. Use the numeric keypad or the ▲ ▼ arrows to enter the time. Enter a time between **0** and **9.9** ms. A good starting point is **5** ms.
- 8  Press the **COOL** key to enter the amount of time for the cool period after Pulse 1. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter **1.0** ms.
- 9 Program Pulse 2 by repeating Steps 3 through 7 above using the keys for Pulse 2, entering the value **0** in each step.
- 10  Press the **HOLD** key to enter the amount of time for the hold period after the weld. Use the numeric keypad or the ▲ ▼ arrows. Enter a time between **0** and **999** ms. We recommend at least **50** ms as weld strength is formed in the hold time.




CHAPTER 4: OPERATING INSTRUCTIONS




Dual-Pulse Weld Schedule




- 1  Press the **SCHEDULE** button, then select a Weld Schedule using **either** the ▲ ▼ arrows **or** the numeric keypad.
- 2  Press the **SQUEEZE** button to enter the squeeze time before the weld. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. We recommend 150 ms.
- 3  Press the **PULSE 1 UPSLOPE** button to enter the amount of time for the Weld Pulse 1 **upslope**. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **19** ms.
- 4  Press the **PULSE 1 WELD** key to **highlight** the **bottom line** of the LCD to enter the weld time. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **9.9** ms.
- 5  Press the **PULSE 1 WELD** key again to **highlight** the **middle line** of the LCD to enter **weld energy**. Use the numeric keypad to enter the **energy level** or use the ▲ ▼ arrows. The Power Supply output ranges are:
 - **Current:** from **0.100** → **4.000** kiloamps.
 - **Voltage:** from **0.100** → **9.9** volts.
 - **Power:** from **0.100** → **9.9** kilowatts.


Perform *one* of the following to program the Pulse 1 feedback mode:





-  Press the **kA** key to program **current** as the feedback mode.
-  Press the **V** key to program **voltage** as the feedback mode.
-  Press the **kW** key to program **power** as the feedback mode.


- 7  Press the **PULSE 1 DOWNSLOPE** key to enter the amount of time for the Weld Pulse 1 **downslope**. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **9.9** ms.
- 8  Press the **COOL** key to enter the amount of time between Pulse 1 and Pulse 2. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **99** ms. We recommend at least 2 ms.
- 9 Program Pulse 2 by repeating Steps 3 through 7 above using the keys for Pulse 2, entering appropriate values for Pulse 2.
- 10  Press the **HOLD** key to enter the amount of time for the hold period after the weld. Use the numeric keypad to enter the time or use the ▲ ▼ arrows. Enter a time between **0** and **999** ms. We recommend at least **50** ms.




Section IV: Programming the Weld Monitor


- 1  Press the **SCHEDULE** button, then select a Weld Schedule using **either** the ▲ ▼ arrows **or** the numeric keypad. Fire the welder and view the output waveform (shaded graph) on the display.

- 2  Press the **ENERGY** key to access the **MONITOR** screen.

- 3 Perform a weld and view the trace of the weld parameter, use the    or  key to view the desired waveform.

- 4  Toggle the Pulse 1 weld time/energy selector key to select the **upper limit** field for the weld period. Use the numeric keypad or the ▲ ▼ arrows to enter the **upper limit** value for the Pulse 1 weld period. The Power Supply can monitor:
 - **Current:** from 0 → 4.8 kiloamps.
 - **Voltage:** from 0 → 9.9 volts.
 - **Power:** from 0 → 9.9 kilowatts.

- 5 Perform **one** of the following to program the Pulse 1 monitor limit mode:
 -  Press the **kA** key to program **current** as the limit mode.
 -  Press the **V** key to program **voltage** as the limit mode.
 -  Press the **kW** key to program **power** as the limit mode.

- 6  Toggle the Pulse 1 weld time/energy selector key to select the **lower limit** field for the weld period. Enter the lower limit value for the Pulse 1 weld period.
NOTE: In order for a Pulse 1 **lower limit** to be programmed, you must *first* program a Pulse 1 upslope in the weld schedule.
 The lower limit mode (current, voltage, or power) will automatically be the same as the upper limit mode programmed in Step 5.

- 7 From the **MONITOR** screen, press the **Pulse 1 UP** weld period key. This will bring up the **PULSE 1 MONITOR LIMITS** screen. This feature allows you to modify the time that the limits are active during Pulse 1. When this feature is not being used, the Upper Limit is active during the entire upslope, weld and downslope periods. If the measured output value is greater than the limit at any point during those three periods, an alarm will occur. This is equivalent to checking the peak value during those three periods.
 The Lower Limit is active during the weld period only. If the measured output is less than the limit during the weld period, an alarm will occur. It does not use an average value; it looks at every point during the weld period.

CHAPTER 4: OPERATING INSTRUCTIONS


7 (continued) Use the numeric keypad to select from the following choices:

- a) LOWER LIMIT IGNORE 1ST :0.0 ms
- b) LOWER LIMIT IGNORE LAST :0.0 ms
- c) UPPER LIMIT IGNORE 1ST :0.0 ms
- d) UPPER LIMIT IGNORE LAST :0.0 ms

8 Use the numeric keypad or ▲▼ arrow keys to enter the time, in milliseconds, that the limit will ignore. Press **MENU** to return to the **PULSE 1 MONITOR LIMITS** screen.

NOTE: The Upper and Lower limits must be a minimum of 0.5 milliseconds in length. The DC25 will automatically adjust the **IGNORE 1ST** or **IGNORE LAST** time as appropriate if too much time is entered.

9 Use the numeric keypad to make another choice or press the **ENERGY** key to view the **MONITOR** screen. The dashed lines on the monitor screen will reflect the changes you made to the limits.

10  Press the **COOL** weld period key. This will bring up the **PULSE 1 OUT OF LIMITS ACTION** screen. This screen allows you to select the action that the Power Supply will take if the Pulse 1 upper or lower limits are exceeded. You have **four** choices:

PULSE 1 OUT OF LIMITS ACTION

- 1. **none**
- 2. **STOP DURING PULSE 1**
- 3. **INHIBIT PULSE 2**
- 4. **APC: STOP PULSE 1/ALLOW PULSE 2**

NUMBER Select, **MENU** Previous menu

- **NONE** takes no action if upper or lower energy limits are exceeded.
- **STOP DURING PULSE 1** stops the weld immediately during Pulse 1, and prevents Pulse 2 from firing (if applicable).
- **INHIBIT PULSE 2** stops the weld at the end of Pulse 1, and prevents Pulse 2 from firing. This function will not operate if both pulses are joined *without* a cool time.
- **APC: STOP PULSE 1/ALLOW PULSE 2** stops Pulse 1 immediately after upper limit is exceeded, but allows Pulse 2 to fire. This function will not operate if both pulses are joined *without* a cool time.

NOTES:

- Power Supply will not allow you to enter a lower limit.
- See "Active Part Conditioner" in *Chapter 3*.

11 After making your selection the display will automatically return to the monitor screen.

12 Program the upper and lower limits for Pulse 2 by repeating Steps 4 through 7 above using the keys for Pulse 2, entering appropriate values for Pulse 2.


NOTE: The monitor limit mode (current, voltage, or power) for Pulse 2 can be different than the monitor limit mode for Pulse 1.

13



Press the **HOLD** period key. This will bring up the **PULSE 2 OUT OF LIMITS ACTION** screen.

This screen allows you to select the action that the Power Supply will take if the Pulse 2 upper or lower limits are exceeded. You have **two** choices:

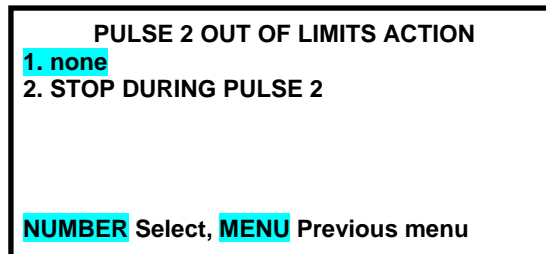


- **NONE** takes no action if upper or lower energy limits are exceeded.
- **STOP DURING PULSE 2** stops **PULSE 2** immediately after upper or lower energy limits are exceeded.

14

After you have made your selection, the display will automatically return to the **MONITOR** screen.

NOTE: The Power Supply adds dotted lines to the appropriate graph to show the *programmed limits*.

The screen on the right shows how the **Limits** and **Alarm** actions appear when an actual weld trace is displayed on the LCD.

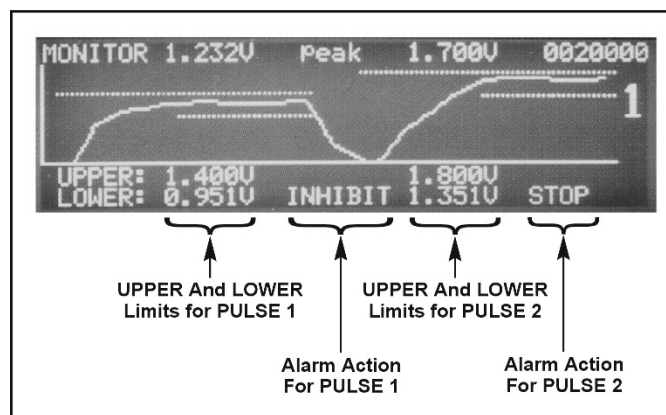








NOTE: All lower limits apply only to the Pulse 1 and Pulse 2 **WELD** periods. Lower limits do *not* cover any upslope or downslope periods. All upper limits apply to the entire Pulse 1 and Pulse 2 periods, including their upslope and downslope periods.

Section V: Programming For Active Part Conditioning

Before you program for Active Part Conditioning, make sure you are familiar with these procedures described in this manual:

- *Chapter 3, Using DC25 Welding And Monitoring Functions*
- *Chapter 4, Section III, Programming Weld Schedules*
- *Chapter 4, Section IV, Programming The Weld Monitor*

- 1  Press the **SCHEDULE** button, and then select a Weld Schedule using **either** the ▲▼ arrows **or** the numeric keypad.
- 2 Program a single pulse for **Constant Power** operation. Program the power level and weld time to cause slight sticking between the two parts. Make a few welds and pull them apart. Increase or decrease the power setting until a light tack weld is achieved.
- 4  Push the **ENERGY** button to monitor the waveforms for **voltage, resistance, current, and power**.
- 5  Push the voltage **V** key and observe the high peak of the voltage waveform.
- 5  Push the **Ω MONITOR** (resistance) key and observe the resistance waveform. This should appear to begin high, then start to drop as a tack weld is made and oxides are removed.
- 5  Push the current **kA** (current) key and observe the current waveform starting to rise as the oxidization breaks down. If the current waveform starts to flatten, this is an indication that the resistance has stabilized and the parts have come into closer contact.
- 6  Push **RUN** and optimize the energy and time setting of Pulse 1 (constant power) to provide an adequate tack weld and also a current waveform (view in the monitor screen) that has started to flatten out, but is still rising. This indicates that a full melt has not yet occurred.
- 7  Push the **ENERGY** button to switch to **MONITOR** mode. Program an upper current limit on the **MONITOR** screen.

NOTE: You can toggle between peak and average readings by pressing the **PEAK/AVERAGE** button.



8



Press the **COOL** weld period key. This will bring up the **PULSE 1 OUT OF LIMITS ACTION** screen.

PULSE 1 OUT OF LIMITS ACTION

1. none
2. STOP DURING PULSE 1
3. INHIBIT PULSE 2
4. APC: STOP PULSE 1/ALLOW PULSE 2

NUMBER Select, **MENU** Previous menu

9

Select **4. APC: STOP PULSE 1/ALLOW PULSE 2.**

NOTE: For details, see "Active Part Conditioner" in *Chapter 3*.

10




Since different levels of oxide require different amounts of time to reach the current limit, return to the **RUN** screen and extend the programmed weld time (usually double the time works). This will ensure that there will be enough time for the current to rise and reach the limit, even with heavily oxidized parts.

11

Try welds with varying amounts of oxide present (clean and dirty). The power supply terminates the first pulse when your programmed current is reached. A clean part will reach the current limit sooner and the pulse will terminate early. A dirty part will require more time before the oxide is broken down and current can flow.

12

Program your second welding pulse as normal to achieve a strong weld. Constant voltage is recommended for round parts and constant current for flat parts. An upslope may be required to restrict the current flow early in the second pulse and avoid weld splash.

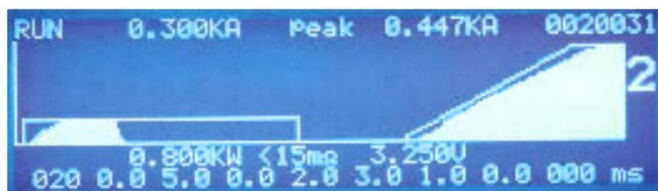

Section VI: Operation

General Operator Safety

ALWAYS wear safety goggles and other appropriate safety equipment when you are **performing a welding operation**.

Manual Welding

Operation

- 1 Verify that all components of your welding system have been properly connected and turned ON.
- 2 Verify that all welding components are operating properly and ready for use.
- 3 Verify that you have programmed the Power Supply with all necessary schedules for your welding application.
- 4 Set the **WELD/NO WELD** switch on the front panel to the **WELD** position.
- 5 Select the desired weld schedule and begin welding using normal operating procedures.

Normal STOP

When finished welding, turn the Power Supply OFF.

Automated Welding

Operation

- 1 Verify that all components of your welding system have been properly connected and turned ON.
- 2 Verify that all welding components are operating properly and ready for use.
- 3 Verify that you have programmed the Power Supply with all necessary schedules for your welding application.
- 4 Verify that the Automation and Communication software has been properly programmed.
- 5 Perform all software Test and Setup procedures to verify that the PLC is communicating properly with the Power supply.
- 6 Set the **WELD/NO WELD** switch on the front panel to the **WELD** position.
- 7 Begin welding using normal automation operating procedures.

Normal STOP

- 1 When finished welding, follow the **Turn Off/Power Down** procedures established for your automated welding system.
- 2 Turn the Power Supply OFF -- *unless* the procedures for your automated welding system require leaving it ON.

EMERGENCY STOP

NOTE: Connections for an external Emergency Stop Switch are described in Appendix B.

- 1 Push the Operator Emergency Stop Switch any time necessary to prevent injury to personnel or damage to weld pieces or the welding system.
- 2 Clear the condition that caused the operator to hit the Operator Emergency Stop Switch.

Re-Set After EMERGENCY STOP

- 1 Clear the condition that caused the **EMERGENCY STOP** condition (whether initiated by an Operator or by a programmed action from the PLC).
- 2 Inspect the electrodes, weld head, and weld cables to make sure there are no shorts or damage that could prevent normal welding.
- 3 Inspect the production area to verify it is ready to continue welding.
- 4 Press the **RUN** key on the front of the Power Supply and verify the desired weld schedule is displayed on the LCD.
- 5 Continue to weld following normal automation procedures.

CHAPTER 5

SETUP SOFTWARE

Section I: Introduction

Overview

The Power supply contains internal software that gives you a great deal of flexibility in the setup and use of your welding system. The Power Supply software displays various menu screens on the LCD, each containing prompts telling you which of the Power Supplies front panel controls to use in order to customize operating parameters, set the Power Supply for use in an automated welding system, and program communication settings for use with data-gathering devices such as a host computer.

This chapter is divided into the following sections:

How to Use Menu Screens	<ul style="list-style-type: none">• Main Menu	<ul style="list-style-type: none">• Setup Menus
Operator Preferences	<ul style="list-style-type: none">• Display Contrast• Buzzer Loudness• End Of Cycle Buzzer	<ul style="list-style-type: none">• Update Graph After Weld• Buzzer On Weld Stop
System Settings	<ul style="list-style-type: none">• Waveform Check• Footswitch Weld Abort• Switch Debounce Time• Firing Switch• Input Switch Select	<ul style="list-style-type: none">• Control Signals Select• Weld Counter Functions• System Security• Calibration• Chain Schedules
PID Test Weld Setup	<ul style="list-style-type: none">• Overview• Do Test Weld Options	<ul style="list-style-type: none">• Ignore First/Last
Relay Settings	<ul style="list-style-type: none">• Function	<ul style="list-style-type: none">• Programming Instructions
Special Functions	<ul style="list-style-type: none">• Copy A Schedule	<ul style="list-style-type: none">• Reset Defaults<ul style="list-style-type: none">–Reset System Parameters–Reset All Schedules
Communication and Data	<ul style="list-style-type: none">• Requirements• Communication	<ul style="list-style-type: none">• I.D. Number• Baud Rate

Before programming the Power Supply, you must be familiar with the **location** and **function** of the LCD and front panel controls. If you need more information, see *Chapter 1* of this manual.

Section II: How to Use Menu Screens

Main Menu

All of the Power Supplies programming functions are accessed through the **MAIN MENU**. To go to the **MAIN MENU**, press the **MENU** key on the front of the Power Supply.

Each menu screen lists several choices, with some offering additional screens (sub-menus) listing more choices.

MAIN MENU

0. WAVEFORM CHECK

1. SETUP

2. WELD COUNTER

3. COPY A SCHEDULE

4. SYSTEM SECURITY

5. COMMUNICATION

6. RELAY

7. CALIBRATION

8. RESET TO DEFAULTS

9. CHAIN SCHEDULES

NUMBER

Select an item

Always look at the prompt at the bottom of each menu screen. These prompts vary from screen to screen, but they all tell you what action to take, how to go to the next menu screen (if applicable), and how to return to the **MAIN MENU**. Some prompts display **NUMBER**, which means that you should use the numeric keypad to enter the number of a desired function listed on the menu. Some prompts display **▲▼** which means that you should use the UP or DOWN keys on the front panel to take the next action. Other prompts may **highlight** a specific key, which means you should press the key indicated to take the next action.

When using menu screens, you can return to the **RUN** screen at any time simply by pushing the **RUN** button on the front panel.

Setup Menus

SETUP menus are accessed in sequence: **MAIN MENU** **SETUP 1** **SETUP 2** **SETUP 3**.

- 1

From the **MAIN MENU**, press **1** to go to the **SETUP 1** menu.
- 2

To go to the **SETUP 2** menu, press the **▼** (down) key.

SETUP 1

1. FOOTSWITCH WELD ABORT

2. SWITCH DEBOUNCE TIME

3. FIRING SWITCH

4. INPUT SWITCH SELECT

5. CONTROL SIGNALS SELECT

:

OFF

: 10ms

: AUTO

: MECH OPEN

: MECH OPEN

NUMBER

Select,

MENU

 Main menu,

▼

 Page 2

NOTE: The **SETUP 2** menu is *only* available through the **SETUP 1** or **SETUP 3** menus.

- 3 To go to the **SETUP 3** menu, press the ▼ (down) key.

SETUP 2		
1. DISPLAY CONTRAST	:	080%
2. BUZZER LOUDNESS	:	030%
3. END OF CYCLE BUZZER	:	OFF
4. UPDATE GRAPH AFTER WELD	:	ON
5. BUZZER ON WELD STOP	:	OFF
NUMBER Select, MENU Main menu, ▲▼ Page		

NOTE: The **SETUP 3** menu is *only* available through the **SETUP 2** menu.


- 4 To scroll back through **SETUP 2** and **SETUP 1** menus, press the ▲ (UP) key.
- 5 When you have finished programming the desired functions, press the **MENU** key on the front panel to return to the **MAIN MENU**.

SETUP 3 -- PID TEST WELD		
1. DO TEST WELD	:	ALWAYS
2. IGNORE FIRST/LAST	:	0.2 ms
NUMBER Select, MENU Main menu, ▲ Page 2		

Section III: Operator Preferences


Display Contrast

- 1 Go to the **SETUP 2** menu.
- 2 Press the **1** key to access the **DISPLAY CONTRAST** adjustment screen.
- 3 Use the **▲▼** keys to adjust the screen contrast for comfortable viewing in the shop environment and different ambient lighting conditions.
- 4 Press **MENU** to return to the previous screen, *or* keep pressing the **MENU** key to return to the **MAIN MENU**.

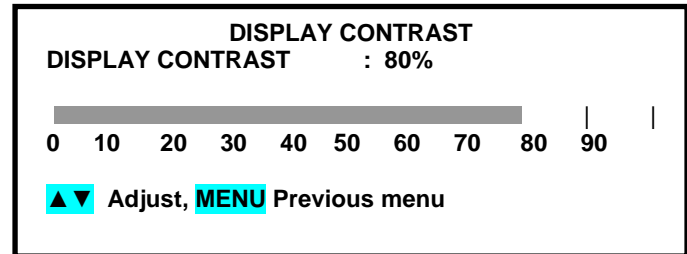

Buzzer Loudness

- 1 Go to the **SETUP 2** menu.
- 2 Press the **2** key to access the **BUZZER LOUDNESS** adjustment screen.
- 3 Use the up **▲** and **▼** keys to adjust the buzzer tone so that it can be heard against shop background noise.
- 4 Press **MENU** to return to the previous screen, *or* keep pressing the **MENU** key to return to the **MAIN MENU**.

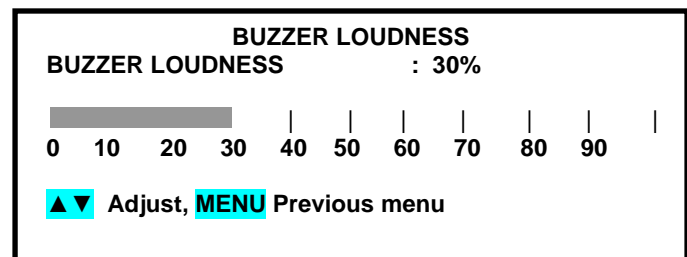


End Of Cycle Buzzer

- 1 Go to the **SETUP 2** menu.
- 2 Press the **3** key to toggle the end of cycle buzzer **ON** or **OFF**.

NOTE: This function is normally used with manually actuated weld heads. **ON** means that an audible signal will be given at the end of each weld process to signal the operator to release the foot pedal.

- 3 Press the **MENU** key to return to the **MAIN MENU**.

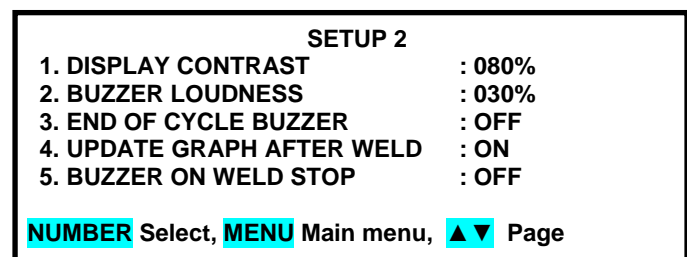

Update Graph After Weld

- 1 Go to the **SETUP 2** menu.
- 2 Press the **4** key to toggle the update function **ON** or **OFF**.

NOTE: **ON** means that the actual weld energy profile (shaded graph) will overlay the programmed weld profile (line graph) on the LCD after each weld is made. The weld graph is useful for detecting a faulty weld, which will be indicated by the shaded graph not filling completely. **OFF** gives you the fastest operating time (multiple welds per second) for automated welding because the control processor does *not* have to redraw the screen.

- 3 Keep pressing the **MENU** key on the front panel to return to the **MAIN MENU**.

SETUP 2		
1. DISPLAY CONTRAST	:	080%
2. BUZZER LOUDNESS	:	030%
3. END OF CYCLE BUZZER	:	OFF
4. UPDATE GRAPH AFTER WELD	:	ON
5. BUZZER ON WELD STOP	:	OFF
NUMBER Select, MENU Main menu, ▲▼ Page		

Buzzer On Weld Stop

This function *only* applies to weld schedules that have **STOP ON PULSE 1** or **STOP ON PULSE 2** programmed in the monitor (refer to *Chapter 4, Section IV, Programming the Weld Monitor*). **ON** means that an audible signal will be given when a limit is reached.

- 1 Go to the **SETUP 2** menu.
- 2 Press the **5** key to toggle the buzzer function **ON** or **OFF**.
- 3 Keep pressing the **MENU** key on the front panel to return to the **MAIN MENU**.

SETUP 2		
1. DISPLAY CONTRAST	:	080%
2. BUZZER LOUDNESS	:	030%
3. END OF CYCLE BUZZER	:	OFF
4. UPDATE GRAPH AFTER WELD	:	ON
5. BUZZER ON WELD STOP	:	OFF
NUMBER Select, MENU Main menu, ▲▼ Page		

NOTE: After setting Operator Preferences, press the **RUN** button on the front panel to perform welding.

Section IV: System Settings

Waveform Check and Weld Fire Lockout

Even though the Power Supply optimizes the output pulse, misaligning parts or operating at the outer edges of the Power Supplies operational range may degrade the waveform. The **WAVEFORM CHECK** feature, which includes **STABILITY CHECK** and **ENERGY CAPACITY LIMIT**, can be used to confirm that the proper waveform was produced.

The **WELD FIRE LOCKOUT** feature guarantees that the capacitor bank is charged to a user defined percentage before the Power Supply is allowed to fire. This advanced feature prevents poor welds caused by operating at too high of a repetition rate, which can deplete the capacitor bank charge.

These features are totally independent of Weld Monitor features described in Chapter 3 of this manual.

Waveform Check ON/OFF

- 1 From the **MAIN MENU**, press **0** to get to the **WAVEFORM CHECK** menu.
- 2 Press the **1** key to toggle **WAVEFORM CHECK ON** or **OFF**.

WAVEFORM CHECK	
1. WAVEFORM CHECK	: ON
2. STABILITY CHECK % LIMIT	: 07 % 0/ 0
3. STABILITY CHECK DLY(ms)	: 1.0 msec
4. ENERGY CAPACITY % LIMIT	: 05 % 0/ 0
5. WELD FIRE LOCKOUT CHRG%	: 95 % 0

NUMBER Select, **MENU** Main menu

Stability Check % Limit Setting

- 1 From the **WAVEFORM CHECK** menu, press the **2** key to access the **STABILITY CHECK % LIMIT** screen.
- 2 Use the numeric keypad to enter the % limit. This limit is the allowable average deviation from the set point for the weld pulse after the delay period.
- 3 Press **MENU** to return to the **WAVEFORM CHECK** menu. The **STABILITY CHECK % LIMIT** line will display your programmed setting along with deviation readings from the Pulse 1 and Pulse 2 of the most recent weld.

STABILITY CHECK % LIMIT	
STABILITY CHECK % LIMIT:	07

NUMBER Change, **MENU** Previous menu

Stability Check Delay Setting

- 1 From the **WAVEFORM CHECK** menu, press the **3** key to access the **STABILITY CHECK DLY (ms)** screen.

Use the numeric keypad to enter the delay period in milliseconds. This period, at the start of the pulse, will not be used when the average deviation is calculated.

- 2 Press **MENU** to return to the **WAVEFORM CHECK** menu.

STABILITY CHECK DLY(ms)	
STABILITY CHECK DLY(ms):	20
NUMBER Change, MENU Previous menu	

Energy Capacity % Limit Setting

- 1 From the **WAVEFORM CHECK** menu, press the **4** key to access the **ENERGY CAPACITY % LIMIT** screen.
- 2 Use the numeric keypad to enter the capacity % limit. This limit is the % below the set point the energy is allowed to be at the end of the weld pulse.
- 3 Press **MENU** to return to the **WAVEFORM CHECK** menu. The **ENERGY CAPACITY % LIMIT** line will display your programmed setting along with the Pulse 1 and Pulse 2 **ENERGY CAPACITY** readings from the most recent weld.

ENERGY CAPACITY % LIMIT	
ENERGY CAPACITY % LIMIT:	07
NUMBER Change, MENU Previous menu	

CHAPTER 5: SETUP SOFTWARE

Weld Fire Lockout Charge % Setting

- 1 From the **WAVEFORM CHECK** menu, press the **5** key to access the **WELD FIRE LOCKOUT** screen.
- 2 Use the numeric keypad to enter the required amount of energy in the capacitor bank before the next weld is allowed.
- 3 Press **MENU** to return to the **WAVEFORM CHECK** menu. The **WELD FIRE LOCKOUT CHRG%** line will display your programmed setting along with the actual **% CHARGE** from the most recent weld.

WELD FIRE LOCKOUT CHRG%	
WELD FIRE LOCKOUT CHRG%:	90
NUMBER	Change, MENU Previous menu

Footswitch Weld Abort

- 1 Go to the **SETUP 1** screen.
- 2 Press the **1** key to toggle between **FOOTSWITCH WELD ABORT ON** and **FOOTSWITCH WELD ABORT OFF**.

STATE	PREFERRED APPLICATION	FUNCTION
ON	Human operated welding stations where the operator holds parts.	Allows you to abort the weld process by releasing the foot switch used with an air-actuated weld head. Will also terminate the welding sequence <i>if</i> the footswitch is opened before the firing switch is initiated.
OFF	Computer or PLC controlled welding stations. Also, for human operated stations where tooling holds the parts, and where the welding sequence can be initiated with a single momentary start pulse.	Once the footswitch (second level of a two level footswitch) and firing switches have both been closed , the welding sequence will continue to its conclusion regardless of footswitch or firing switch position.

- 3 Keep pressing the **MENU** key on the front panel to return to the **MAIN MENU**.

Switch Debounce Time

The contacts of mechanical firing switches "bounce" when they close. The switch debounce time function allows you to specify that the initiation switch contacts must remain closed for 10, 20, or 30 ms before the weld period can be initiated, thereby avoiding false starts caused by the switch contact bouncing. In addition to the debounce time, there is a delay of no greater than 2.5 ms before the start signal is recognized by the Power Supply.

NOTE: The factory default debounce time is 10ms.

- 1 Go to the **SETUP 1** screen.
- 2 Press the **2** key to access the **SWITCH DEBOUNCE TIME** menu.

SWITCH DEBOUNCE TIME	
1.	NONE
2.	10ms
3.	20ms
4.	30ms
NUMBER Select MENU Previous menu	

- 3 Select the required debounce time by pressing the **1**, **2**, **3**, or **4** key. The LCD will automatically return to the **SETUP 1** screen and the **SWITCH DEBOUNCE TIME** line will now reflect your time selection.

NOTE: **NONE** represents a debounce time of **0** ms. Use **NONE** for interfacing with the AMADA WELD TECH SL-320A Electronic Weld Force Control.

- 4 Press **MENU** to return to the **MAIN MENU**.

Firing Switch

- 1 Go to the **SETUP 1** screen.
- 2 Press the **3** key to get the **FIRING SWITCH** menu.
- 3 Press the **1**, **2**, or **3** key to select switch type. The LCD will automatically return to the **SETUP 1** menu with your selection highlighted.

FIRING SWITCH	
1.	AUTO
2.	NONE
3.	REMOTE
NUMBER Select, MENU Previous menu	

NOTE:

- **AUTO** accepts a single pole, double pole, or optical firing switch input, typically from an AMADA WELD TECH weld head. Firing switch activation indicates that the weld head has reached the set weld force and is ready for the weld energy sequence (including squeeze time) to start.
- **NONE** is used when welding with a non force-fired weld head. With **NONE** selected, a footswitch closure activates the 24 VAC Air Valve Driver and initiates the weld energy

CHAPTER 5: SETUP SOFTWARE

sequence (including squeeze time). Sufficient squeeze time must be programmed in the weld schedule to allow the weld head to close and the weld force to stabilize before the weld current starts.

NOTE: In addition to the debounce time, there is a delay of no greater than 2.5 ms before the start signal is recognized by the Power Supply.

- **REMOTE** can be used in automated applications or when using a PLC to control the weld head. The weld energy sequence is initiated via the Remote Schedule Select input lines, which also select the weld schedule number. (Refer to *Appendix B, Electrical and Data Connectors*, for I/O connector pin connections and specifications.)

- 4 Press **MENU** to return to the **MAIN MENU**.

Input Switch Select

Selects the type of external switch to be used by the **Firing Switch** and **Foot Switch** inputs, and how these switches are activated.

- 1 Go to the **SETUP 1** menu.
- 2 Press **4** for the **INPUT SWITCH SELECT** menu.

INPUT SELECT SWITCH
1. MECHANICAL
2. OPTO
3. PLC

NUMBER Select, **MENU** Previous menu

Mechanical Selection

This selection accepts dry contact, single, or double pole switch or reed relay devices. This is the factory default setting and will run AMADA WELD TECH weld heads.

- 1 From the **INPUT SWITCH SELECT** menu, press **1** for the mechanical switch select menu.
- 2 Press the **1** or **2** key to select how the input mechanical switches will initiate the Power Supply. The display automatically returns to the **SETUP 1** menu.

INPUT SELECT SWITCH
1. MECHANICAL SWITCH NORMAL OPEN
2. MECHANICAL SWITCH NORMAL CLOSED

NUMBER Select, **MENU** Previous menu

- **Mechanical Switch Normal Open:** Initiate the Power Supply by closing the mechanical switches.
- **Mechanical Switch Normal Closed:** Initiate the Power Supply by opening the mechanical switches

NOTE: You will get an **INPUT SWITCH ALARM** *unless* you close the **Firing Switch** and **Foot Switch** inputs before selecting the Normal Closed option.

OPTO Selection

This selection accepts an opto coupler switch for eliminating switch debounce problems.

- 1 From the **INPUT SWITCH SELECT** menu, press **2** to display the opto switch select menu.
- 2 Press the **1** or **2** key to select how the input opto switches will initiate the Power Supply. The display automatically returns to the **SETUP 1** menu.

INPUT SELECT SWITCH
1. OPTO COLLECTOR NORMAL OPEN
2. OPTO COLLECTOR NORMAL CLOSED

NUMBER Select, **MENU** Previous menu

- **OPTO SWITCH NORMAL OPEN:** Turn **ON** the open collector output transistor of the opto isolator to initiate the Power Supply.
- **OPTO SWITCH NORMAL CLOSED:** Turn the open collector output transistor of the opto isolator **OFF** to initiate the Power Supply.

NOTE: You will get an **INPUT SWITCH ALARM** *unless* you close the **Firing Switch** and **Foot Switch** inputs before selecting the Normal Closed option.

PLC Selection

This option is used only if you are using an automated welding system. This selection accepts +24 VDC from a PLC as a source for activating the **Firing Switch** and **Foot Switch** inputs. For detailed electrical interface information on these input switch selections, see *Appendix B, Electrical And Data Connectors*.

- 1 From the **INPUT SWITCH SELECT** menu, press the **3** key to display the **PLC** select menu.

NOTE: **PLC 0VDC TURN ON** initiates the Power Supply from a PLC source by changing the PLC voltage from +24 VDC to 0 VDC.

PLC +24VDC TURN ON initiates the Power Supply from a PLC source by changing the PLC voltage from 0 VDC to +24 VDC.

NOTE: You will get an **INPUT SWITCH ALARM** *unless* you have 0 VDC on the **Firing Switch** and **Foot Switch** inputs before selecting the +24 VDC Turn On option.

- 2 Press the **1** or **2** key to select how the PLC input switches will initiate the Power Supply. The display automatically returns to the **SETUP 1** menu.

INPUT SWITCH SELECT
1. PLC 0VDC TURN ON
2. PLC +24VDC TURN ON

NUMBER Select, **MENU** Previous Menu

CHAPTER 5: SETUP SOFTWARE

Control Signals Select

This option selects the type of external switch to be used by the **Schedule Selection**, **Process Inhibit**, and **ISTOP** inputs and how these switches are activated.

- 1 From the **SETUP 1** menu, press **5** for the **CONTROL SIGNALS SELECT** menu.
- 2 Follow the **INPUT SWITCH SELECT** instructions on *the previous two pages*, the procedures are identical for **CONTROL SIGNALS SELECT**.
- 3 Press **MENU** to return to the **MAIN MENU**.

CONTROL SIGNALS SELECT	
1.	MECHANICAL
2.	OPTO
3.	PLC
NUMBER Select, MENU Previous menu	

Weld Counter Functions

- 1 From the **MAIN MENU**, press the **2** key. This will bring up the **WELD COUNTERS** screen. Use steps 2 through 5 below to reset each counter.
- 2 Press the **1**, **2**, **3** or **4** key to select the desired weld counter.

WELD COUNTERS	
1.	TOTAL WELDS : 0000000
2.	OUT OF LIMITS HIGH : 0000000
3.	OUT LIMITS LOW : 0000000
4.	WITHIN LIMITS : 0000000
NUMBER Select, MENU Previous Menu	

NOTE: The example to the right shows the **TOTAL WELDS** screen.

- 3 To reset the counter, press **0** on the numeric keypad. To input a preset number, use the numeric keypad.

WELD COUNTER	
TOTAL WELDS	: 0017429
NUMBER Change, <input type="radio"/> Restore, MENU Menu	

NOTE: If you accidentally reset the wrong counter, press the **.** (period/decimal point) key. The original count will reappear.

- 4 Press the **MENU** key to return to the **WELD COUNTERS** screen.
- 5 When all counters have been reset, press the **MENU** key to return to the **MAIN MENU**.

System Security

- 1 From the **MAIN MENU**, press the **4** key to get the **SYSTEM SECURITY** screen.

SYSTEM SECURITY

1. SCHEDULE LOCK : OFF

2. SYSTEM LOCK : OFF

3. CALIBRATION LOCK : OFF

NUMBERS Select, **MENU** Previous menu

NOTE:

- **SCHEDULE LOCK** prevents unauthorized users from selecting any weld schedule other than the displayed schedule, and from changing any weld energy/time parameters within the weld schedule.
- **SYSTEM LOCK** prevents unauthorized users from changing any energy/time parameters within weld schedules, but does allow different schedules to be selected. This function also prevents any changes to menu settings.
- **CALIBRATION LOCK** prevents unauthorized users from modifying any of the calibration settings.

NOTE: All security options use the *same* procedure to enter a security code and to turn off the security code.

- 2 Press the **1** key to select **SCHEDULE LOCK**. This will bring up the **CHANGE STATUS** screen.

CHANGE STATUS

PASSWORD : █-----

NUMBERS for code followed by **PERIOD**

- 3 Enter a 7-digit number, from 0000001 to 9999999, in the code field, then enter a period. This will bring up the **SYSTEM SECURITY** menu screen, this time **with SCHEDULE LOCK: ON**. With **ON** selected, all other weld schedules are locked out and cannot be modified or used for welding.
- 4 To unlock the Power Supply from security protection, return to the **CHANGE STATUS** screen and enter the code that you entered in Step 2. This will bring up the **SYSTEM SECURITY** menu screen, this time with **SCHEDULE LOCK: OFF**.
- 5 If you forget the security code and wish to unlock the Power Supply from security protection:
 - a Return to the **CHANGE STATUS** screen.
 - b Enter a security code of **414**, followed by a period.
- 6 Keep pressing the **MENU** key to return to the **MAIN MENU**.

Calibration

NOTE: Calibration should *only* be performed by authorized personnel.

- 1 From the **MAIN MENU**, press the **7** key to access the first **CALIBRATION** screen.
- 2 Follow the calibration procedures in *Chapter 7, Calibration*.

CAUTION

CALIBRATION SHOULD BE PERFORMED BY A QUALIFIED TECHNICIAN ONLY. REFER TO MANUAL FOR CALIBRATION SETUP.

Next, **MENU** menu

Chain Schedules

This feature allows you to automatically change from any weld schedule to any other schedule after a preset count, creating a "chain" of schedules that can accommodate a variety of welding needs. For example:

- A single work piece requires four welds, two weld points require the same weld schedule, each of the other two points require different weld schedules.

In this case you would program a sequence, or "chain," that looks like this: **Schedule 01** [2 times] → **Schedule 02** [1 time] → **Schedule 03** [1 time] → **Schedule 01**. This sequence will repeat, or "loop," until you turn **Chain Schedules OFF**.

- Some applications require a lower current for a number of welds after the electrodes have been replaced or resurfaced. Once the electrodes have been "seasoned", the current can be increased as required. If the electrodes require 100 welds to "season", Schedule 01 can be programmed with a lower current and Schedule 02 can be programmed with a higher current. The chain would look like this: **Schedule 01** [100 times] → **Schedule 02** [1 time] → **Schedule 02** [1 time].

In this chain, Schedule 02 will just keep repeating *after* the 100 welds made using Schedule 01. When the electrodes are replaced or resurfaced, you can manually switch back to Schedule 01 to restart the sequence.

You can program any of the Power Supplies 99 stored schedules to chain to any other schedule, or back to itself as in the second example above. The chain code becomes part of each weld schedule. You can turn the **Chain Schedules** feature **ON** or **OFF**, or re-program chains, any time you want.

- 1 From the **MAIN MENU**, press the **9** key to go to the **CHAIN SCHEDULES** menu.

NOTE: You should program, or "setup," the chain of schedules you want *before* you turn this feature **ON**.

- 2 Press the **1** key to toggle **CHAIN SCHEDULES ON** or **OFF**.
- 3 From the **CHAIN SCHEDULE** menu, press the **2** key to go to the **CHAIN SCHEDULE SETUP** menu.

CHAIN SCHEDULES
1. CHAIN SCHEDULE :OFF
2. SETUP CHAIN SCHEDULES

NUMBER Select, **MENU** Previous menu

CHAIN SCHEDULE SETUP

SCHEDULE NUMBER	WELD COUNT	NEXT
01	0001	01
02	0001	02
03	0001	03
04	0001	04

▲▼ scroll, **SCHEDULE** select, **MENU** menu

- 4 Use the ▲▼ (Up/Down) keys on the front panel to scroll vertically through the schedules to **highlight** the weld count for the schedule you want to chain.

CHAIN SCHEDULE SETUP

SCHEDULE NUMBER	WELD COUNT	NEXT
04	0001	04
05	0001	05
06	0001	06
07	0001	07

▲▼ scroll, **SCHEDULE** select, **MENU** menu

- 5 Use the numeric keypad to enter the number of times you want this schedule to weld before going to the next schedule.

CHAIN SCHEDULE SETUP

SCHEDULE NUMBER	WELD COUNT	NEXT
04	0001	04
05	0002	05
06	0001	06
07	0001	07

▲▼ scroll, **SCHEDULE** select, **MENU** menu

- 6 Use the **SCHEDULE** key to move the highlight horizontally to select **NEXT**.

CHAIN SCHEDULE SETUP

SCHEDULE NUMBER	WELD COUNT	NEXT
04	0001	04
05	0002	05
06	0001	06
07	0001	07

▲▼ scroll, **SCHEDULE** select, **MENU** menu

- 7 Use the numeric keypad to enter the number of the next schedule in the chain.

- 8 Use the **SCHEDULE** key to move the highlight horizontally back to the **WELD COUNT** column. Repeat Steps 4 through 8 to program the rest of the chain.


- 9 When you finish programming the chain, press the **MENU** key to return to the **CHAIN SCHEDULES** menu.

- 10 Press the **1** key to toggle between **ON** or **OFF**.

CHAPTER 5: SETUP SOFTWARE

- 11 Press the **RUN** key on the front panel, then use the ▲▼ (Up/Down) keys to select the first weld schedule in the chain you want to use. The Power Supply will now weld in the "chain" mode until you turn the **Chain Schedules** feature **OFF**.

NOTE: When **Chain Schedules** is turned **ON**, the LCD screen changes to show the chain information on the right side of the screen.

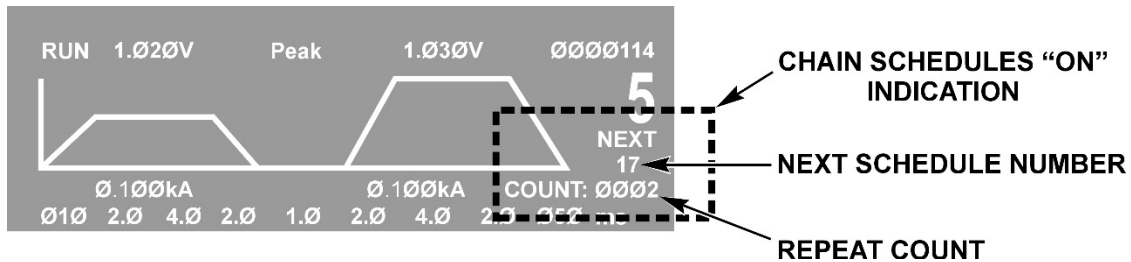

Below the current schedule number, you can see the number of times the current schedule will be repeated, and the number of the next schedule in the chain.

Section V: PID Test Weld Setup

Overview

The Power Supply is designed to "learn" the load of specific pieces to be welded by performing a test weld. Once it has "learned" the load (resistance), it can automatically adjust itself to deliver the optimum output waveform: the fastest rise time without overshoot, and the smoothest waveform possible. To do this, the Power Supply does a **Test Weld** of the actual pieces you want to weld during production. The Test Weld is done on the first weld performed after a change to the weld schedule has been made. Test Welds are *only* done for schedules programmed for **voltage (V)** and/or **power (kW)** feedback. Test Welds are not done for schedules programmed for only **current (kA)** feedback.

The Power Supply allows you to set the conditions for when the Test Welds will be done and also allows you to specify the length of time at the beginning and end of the weld pulse to be ignored by the Test Weld when calculating the load resistance.

- 1 From the **MAIN MENU**, press **1** to access the **SETUP 1** screen.
- 2 Press the ▼ down arrow key to access the **SETUP 3 – PID TEST WELD** menu screen.

SETUP 3 - PID TEST WELD	
1. DO TEST WELD	: ALWAYS
2. IGNORE FIRST/LAST (ms)	: 0.2 ms
NUMBER Select, MENU Main menu, ▲ Page 2	

Do Test Weld Options

The **DO TEST WELD** menu screen allows you choose *when* the Power Supply performs Test Welds.

The three options for **DO TEST WELD** are:

- If Required
- Ask
- Always

Regardless of the option chosen, a **TEST WELD** will be performed any time the schedule's feedback mode is changed to **voltage** or **power**. If the **V** or **kW** keys are pressed when the energy level field is selected (highlighted) in the **PROGRAM** state, the Power Supply will treat this as if the feedback mode was changed and do a **TEST WELD**, whether the feedback mode was actually changed or not. Changes to monitor settings, such as energy limits and actions, do not cause the Power Supply to perform a **TEST WELD**.

CHAPTER 5: SETUP SOFTWARE

The **DO TEST WELD** options are:

- IF REQUIRED** The Power Supply will only do a Test Weld when the feedback mode is changed to **voltage** or **power** as described above.
- ASK** The Power Supply will do a Test Weld when the feedback mode is changed to **voltage** or **power** as described above. The Power Supply will also prompt the operator if a Test Weld should be done (**TEST WELD? [MENU]=NO, [RUN]=YES**) when **time values**, **voltage levels**, or **power levels** are changed on the schedule.
- ALWAYS** The Power Supply will do a Test Weld when the feedback mode is changed to **voltage** or **power** as described above. The Power Supply will also do a Test Weld when **time values**, **voltage levels**, or **power levels** are changed on the schedule.

- 1 From the **SETUP 3** menu screen, press the **1** key to access the **DO TEST WELD** screen.
- 2 Press the **1, 2, or 3** key to select the desired option.
- 3 The display will automatically return to the **SETUP 3** menu screen.

DO TEST WELD

1. IF REQD
2. ASK
3. ALWAYS

NUMBER Select, MENU Previous menu

Ignore First/Last

- 1 From the **SETUP 3** menu screen, press the **2** key to access the **IGNORE FIRST/LAST** screen.
- 2 Use the numeric keypad to enter the time in milliseconds that the Power Supply ignores when calculating the load resistance during the PID Test Weld. The delay time prevents the Power Supply from measuring noise early in the test weld and allows for more accurate load resistance to be measured.
- 3 Press **MENU** to return to the **SETUP 3** menu screen.

IGNORE FIRST/LAST

IGNORE FIRST/LAST : 0.2ms

NUMBER Change, MENU Previous menu

Section VI: Relay Settings

Function

The Power Supplies four relays can be programmed to activate outputs under eight user-programmed conditions. Relay connections are made through the 25-pin connector **I/O Signal Interface A** on the rear of the Power Supply. See *Appendix B, Electrical And Data Connectors* for pin connections. *Appendix F, Relay Timing Diagrams* provides the timing sequences for the four relays.

Programming Instructions

NOTE: Programming for each of the relays is *identical*.

- 1 From the **MAIN MENU**, press the **6** key to get the **RELAY** menu.

RELAY	
1. RELAY 1	: ON WHEN ALARM
2. RELAY 2	: ON WHEN ALARM
3. RELAY 3	: ON WHEN ALARM
4. RELAY 4	: ON WHEN ALARM
NUMBER Select, MENU Previous menu	

- 2 From the **RELAY** menu, press the **1**, **2**, **3**, or **4** key to select a relay menu.
- 3 Press the **1** key to toggle the relay contact signal state: **ON** (closed) or **OFF** (open).

RELAY 1	
1. SET RELAY TO	: ON
2. WHEN	: ALARM
NUMBER Select, MENU Previous menu	

- 4 Press the **2** key to select the **WHEN** menu. This menu allows you to choose when the relay is activated. The **WHEN** states are described on the next page.
- 5 Use the numeric keypad to select when the relay will energize. The display screen automatically returns to the **WHEN** menu.

WHEN	
1. WELD	6. P1 LOW LIMIT
2. END OF WELD	7. P2 HIGH LIMIT
3. ALARM	8. P2 LOW LIMIT
4. OUT OF LIMITS	
5. P1 HIGH LIMIT	
NUMBER Select, MENU Previous menu	

CHAPTER 5: SETUP SOFTWARE

- **WELD** When welding, the relay output signal will start within 5 ms after the start of **SQUEEZE** and will stay energized for 0 - 150 ms after the end of the **HOLD** period.
- **END OF WELD** When welding, the relay output signal will start 0 - 150 ms after the end of the **HOLD** period and will stay energized for 350 - 450 ms. If another weld is initiated within this time, the **END OF WELD** relay will be reset at the start of the next weld. The relay will still close in the event of an aborted weld.
- **ALARM** The relay output signal will start when the Power Supply senses certain **ALARM** conditions (with the *exception* of **OUT OF LIMITS** alarms) and will stay energized until the **ALARM** state is cleared by pressing the **RUN** button (refer to *Appendix E, LCD Display Messages*).
- **OUT OF LIMITS** The relay will switch when the Power Supply senses any **OUT OF LIMITS** condition. It will start 0 – 150 ms after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld (refer to *Appendix E, LCD Display Messages*).
- **P1 HIGH LIMIT** The relay signal will switch when the Power Supply senses that the Pulse 1 energy is higher than the programmed upper limit. It will start 0 – 150 ms after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld (refer to *Appendix E, LCD Display Messages*).
- **P1 LOW LIMIT** The relay signal will switch when the Power Supply senses that the Pulse 1 energy is lower than the programmed lower limit. It will start 0 – 150 ms after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld (refer to *Appendix E, LCD Display Messages*).
- **P2 HIGH LIMIT** The relay signal will switch when the Power Supply senses that the Pulse 2 energy is higher than the programmed upper limit. It will start 0 – 150 ms after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld (refer to *Appendix E, LCD Display Messages*).
- **P2 LOW LIMIT** The relay signal will switch when the Power Supply senses that the Pulse 2 energy is lower than the programmed lower limit. It will start 0 – 150 ms after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld (refer to *Appendix E, LCD Display Messages*).

- 6 Press the **MENU** key to return to the **RELAY** screen.
- 7 Repeat Steps 2 through 6 to program the other relays as needed.
- 8 Press **MENU** to return to the **MAIN MENU**.

Section VII: Special Functions

Copy A Schedule

- 1 From the **MAIN MENU**, press the **3** key to get to the **COPY SCHEDULE** screen.

NOTE: There are two fields in the **COPY SCHEDULE** screen. These fields determine which schedule will be copied (**source**) and which schedule will be overwritten (**destination**). Both fields initially contain the number of the schedule most recently displayed.

COPY SCHEDULE
COPY SCHEDULE [**1**] TO SCHEDULE [1]

NUMBERS followed by **SCHEDULE**

- 2 Use the numeric keypad to enter the number of the **source** schedule.
- 3 Press the schedule key to select the **destination** schedule number field.
- 4 Use the numeric keypad to enter the number of the **destination** schedule.
- 5 Press the schedule key. The contents of the source schedule will be copied to the destination schedule, overwriting the previous contents of the destination schedule.

NOTE: All monitor settings and limits are also copied.

Reset Defaults

The Power Supply is manufactured and shipped with the factory-set defaults. Any of these settings may be changed.

Defaults for Setup Menu 1

SYSTEM PARAMETER	DEFAULT SETTING
Foot Switch Weld Abort	OFF
Switch Debounce Time	10 ms
Firing Switch	AUTO
Input Switch Select	MECH OPEN
Control Signals Select	MECH OPEN

Defaults for Setup Menu 2

SYSTEM PARAMETER	DEFAULT SETTING
Display Contrast	080 %
Buzzer Loudness	030 %
End of Cycle Buzzer	OFF
Update Graph After Weld	ON
Buzzer On Weld Stop	OFF

Defaults for Setup Menu 3

SYSTEM PARAMETER	DEFAULT SETTING
Do Test Weld	ALWAYS
Ignore First/Last	0.2 ms

Defaults for Waveform Check and Weld Fire Lockout

SYSTEM PARAMETER	DEFAULT SETTING
Waveform Check	ON
Stability Check % Limit	007 % 0/ 0
Stability Check Delay	2.0 ms
Energy Capacity % Limit:	05 % 0/ 0
Weld Fire Lockout Charge	90 %

Defaults for Communication Menu

SYSTEM PARAMETER	DEFAULT SETTING
Communication Role	CLIENT
RS-485 ID Number	01
Baud Rate	9600

Defaults for Chain Schedules Menu

SYSTEM PARAMETER	DEFAULT SETTING
Chain Schedules	OFF

Defaults for Relay Menu

SYSTEM PARAMETER	DEFAULT SETTING
Relays 1 through 4	ON WHEN ALARM

It is common to change system and schedule settings when you customize the Power Supply for specific welding needs. If you wish to reset the Power Supply to the original default settings, go to the **MAIN MENU**, then press the **8** key to get the **RESET DEFAULTS** menu.

This menu allows you to reset all system programmed parameters and all weld schedules to the original factory default settings.

RESET DEFAULTS

1. RESET SYSTEM PARAMETERS
2. RESET ALL SCHEDULES
EPROM DATE: XX-XX-XX XX:XX VX.XX

NUMBER Select, **MENU** Previous menu

Reset System Parameters

- 1 From the **MAIN MENU**, press the **8** key to go to the **RESET DEFAULTS** menu.
- 2 From **RESET DEFAULTS**, press the **1** key to go to the **RESET SYSTEM PARAMETERS?** menu.
- 3 Press the **2** key to select **YES**. This will automatically reset the system parameters to the factory defaults and return the screen to the **RESET DEFAULTS** menu.
- 4 Press **MENU** to return to the **MAIN MENU**.

RESET SYSTEM PARAMETERS?

1. NO
2. YES

NUMBER Select, **MENU** Previous menu

Reset All Schedules

- 1 From the **RESET DEFAULTS** menu, press the **2** key to get to the **RESET ALL SCHEDULES?** menu.
- 2 Press the **2** key to select **YES**. This will automatically reset all weld schedule parameters to the factory defaults and return the display to the **RESET DEFAULTS?** screen.
- 3 Press **MENU** to return to the **MAIN MENU**.

RESET ALL SCHEDULES?

1. NO
2. YES

ALL WELD SCHEDULES ARE RESET
NUMBER Select, **MENU** Previous menu

Section VIII: Communication and Data

Requirements

The following menu screens tell you how to set the Power Supplies communication and data options.

Specific details on the data communications is described in the 990-661 - Serial Data Communications manual. This manual describes cables, connections, RS-232 operation, RS-485 operation, sample weld reports, data collection, and how to use remote commands. The manual also lists all of the commands that the Power Supply will respond to, and instructions on how to format commands sent to the Power Supply so it will respond properly.

Communication

- 1 From the **MAIN MENU**, press the **5** key to go to the **COMMUNICATION** menu (shown with default settings).
- 2 From the **COMMUNICATION** menu, toggle the **1** key to select **HOST** or **CLIENT**. The **COMMUNICATION ROLE** line will now reflect your role selection.

COMMUNICATION	
1. COMMUNICATION ROLE	: CLIENT
2. I.D. NUMBER	: 01
3. BAUD RATE	: 9600

NUMBER Select, **MENU** Previous menu

- In the **HOST** role, the Power Supply will:
 - Send weld data to the host computer after each weld operation.
 - Send text data to a serial printer, providing a printout of the average voltage and current values for each weld, generating a "paper history" of welds performed.
- In the **CLIENT** role, the Power Supply will send weld data only when requested by the host computer.

NOTE: For weld data collection and host computer control information, refer to the 990-661 - Serial Data Communications Manual, which describes how to use the **HOST** and **CLIENT** options.

- 3 Press **MENU** to return to the **MAIN MENU**.

I.D. Number

The host computer may be used to talk with multiple Power Supplies using a single RS-485 communications line. Each Power Supply sharing that line *must* have a unique identification number. To enter an identification number for the Power Supply, proceed as follows:

- 1 From the **MAIN MENU**, press the **5** key to go to the **COMMUNICATIONS MENU**.
- 2 From the **COMMUNICATIONS MENU** screen, press the **2** key to get the **I.D. NUMBER** entry screen.
- 3 Enter a two-digit number, from **01** to **99**, in the **I.D. NUMBER** field.
- 4 Press the **MENU** key to get the **COMMUNICATION** menu screen. This time the **I.D. NUMBER** line will display your I.D. number entry.
- 5 Press **MENU** to return to the **MAIN MENU**.

I.D. NUMBER	I.D. NUMBER
	: 01
NUMBER Change, MENU Previous menu	

Baud Rate

The baud rate at which the data is sent must match the baud rate of the host computer. To enter the baud rate, proceed as follows:

- 1 From the **COMMUNICATION** menu, press the **3** key to get the **BAUD RATE** selection screen.
- 2 Use the numeric keypad to select the baud rate of the receiving device. The display automatically returns to the **COMMUNICATION** menu, which shows the new baud rate.
- 3 Press **MENU** to return to the **MAIN MENU**.

	BAUD RATE
1. 1200	6. 19.2K
2. 2400	7. 28.8K
3. 4800	
4. 9600	
4. 14.4K	
NUMBER Change, MENU Previous menu	

CHAPTER 6

USER MAINTENANCE

Section I: Precautions

General Operator Safety

ALWAYS wear safety goggles and other appropriate safety equipment when you are **performing a welding operation**.

Section II: Operator Maintenance

The Power Supply does not require any Operator Maintenance other than calibration. To ensure consistently accurate welds, AMADA WELD TECH recommends that you calibrate the Power Supply at least once a year. For calibration instructions, please refer to *Chapter 7, Calibration*.

Section III: Troubleshooting

The Power Supply is designed with reliability as a top user priority. From time to time, however, you may run into a problem and need some help to get back to normal operation. Reading this Chapter will speed up the process.

General Kinds of Problems

It has been our experience that most resistance welding power supply "problems" are caused by lack of material control, process control, and electrode tip surface maintenance. The problems that you might encounter fall into two groups: **Soft** and **Hard**.

Soft

The problem is transient, and you can correct it by resetting the system or parameter limits. For example, you should ensure that:

- Correct force is set at the weld head
- Correct weld energy and time is set at the Power Supply
- The equipment is set up properly
- All electrical connections are tight
- Electrode alignment allows flush contact with the weld pieces
- Electrodes are properly dressed

CHAPTER 6: USER MAINTENANCE

Hard

The problem is embedded in the system and some form of repair will be needed. For example, repair might include replacing a broken weld head flexure.

In either case, you may telephone the AMADA WELD TECH Applications Laboratory for assistance by calling the telephone number listed in the Foreword and asking for the Applications Laboratory.

Alarm Messages

Built-in automatic self-test and self-calibration routines will bring up alarm messages on the display screens. These messages will usually let you know what action is required of you to correct the reason for the alarm. For a complete listing of the alarm messages, what they mean, and what to do about them, please refer to *Appendix E, LCD Display Messages*.

Troubleshooting

The following Troubleshooting Chart is a comprehensive listing of system and equipment problems, and their probable cause.

Troubleshooting Chart	
PROBLEM	CAUSE (In Order of Probability)
Air-operated weld head will not close	Air valve driver cable not connected. (Check that the Power Supply switches to STANDBY state when footswitch is activated). Blown fuse located on the Rear Panel. (Valve Driver Fuse: 3.15 A, 125 VAC minimum, Slow-Blow). Check that the air supply is properly connected to the weld head.
Electrode Damage	Excessive current/energy set at the Power Supply. Excessive or insufficient weld head force. Wrong electrode tip shape. Misaligned parts. Excessive weld time set at the Power Supply. Contaminated weld piece surface/ plating. Wrong electrode material. Contaminated electrode surface.

Troubleshooting Chart	
PROBLEM	CAUSE (In Order of Probability)
Electrode Sparking	<p>Excessive current/energy set at the Power Supply.</p> <p>Insufficient weld head force.</p> <p>Slow weld head follow-up.</p> <p>Incompatible weld piece projection design.</p> <p>Misaligned parts.</p> <p>Contaminated weld piece surface/ plating.</p> <p>Wrong electrode tip shape.</p> <p>Wrong electrode material.</p> <p>Contaminated electrode surface.</p>
Electrode Sticking	<p>Contaminated weld piece surface/ plating.</p> <p>Wrong electrode material/ tip shape.</p> <p>Insufficient weld head force.</p> <p>Excessive current/energy set at the Power Supply.</p> <p>Misaligned parts.</p> <p>Excessive weld time set at the Power Supply.</p> <p>Contaminated electrode surface.</p> <p>Slow weld head follow-up.</p>
EMERGENCY STOP message is displayed on the LCD, and fans all stop, but the Emergency Stop Switch is not activated.	<p>Blown fuse located on internal Power Distribution & Fan Controller Board.</p> <p>Contact AMADA WELD TECH for support.</p>
Insufficient Weld Nugget	<p>Insufficient current/ energy set at the Power Supply.</p> <p>Wrong electrode material/ tip shape.</p> <p>Worn/mushroomed electrodes.</p> <p>Insufficient weld time set at the Power Supply.</p> <p>Incorrect weld head polarity.</p> <p>Misaligned parts.</p> <p>Contaminated weld piece surface/ plating.</p> <p>Excessive weld head force.</p> <p>Insufficient weld head force.</p> <p>Contaminated electrode surface.</p> <p>Incompatible weld piece projection design.</p> <p>Slow weld head follow-up.</p> <p>Incompatible weld piece materials.</p> <p>No cover gas on weld piece.</p>

CHAPTER 6: USER MAINTENANCE

Troubleshooting Chart	
PROBLEM	CAUSE (In Order of Probability)
LCD Display is blank, fans are still operational.	Blown fuse located on internal Bias Power Supply. Contact AMADA WELD TECH for support.
LCD is operational, the Power Supply will attempt to fire, but no energy is provided to the weld and the graphs in the RUN screen will not fill in.	Possible open circuit in the secondary circuit. Electrodes did not close properly. Possible blown fuse located on internal Capacitor Charging Power Supply. Contact AMADA WELD TECH for support.
Metal Expulsion	Excessive current/energy set at the Power Supply. Insufficient weld head force. Misaligned parts. Slow weld head follow-up. Incompatible weld piece projection design. Contaminated weld piece surface/ plating. Incompatible weld piece materials. Contaminated electrode surface. Wrong electrode tip shape. No cover gas on weld piece. Excessive weld time set at the Power Supply. Misaligned parts.
Weld Piece Discoloration	Excessive weld time set at the Power Supply. No cover gas on weld piece. Excessive current/energy set at the Power Supply. Insufficient weld head force. Contaminated weld piece surface/ plating. Wrong electrode material/tip shape. Contaminated electrode surface.
Weld Piece Overheating	Excessive weld time set at the Power Supply. Excessive current/energy set at the Power Supply. Misaligned parts. Insufficient weld head force. Incompatible weld piece materials. Wrong electrode material/tip shape. Contaminated electrode surface.

Troubleshooting Chart	
PROBLEM	CAUSE (In Order of Probability)
Weld Piece Warping	Excessive weld time set at the Power Supply. Excessive weld head force. Incompatible weld piece projection design. Incompatible weld piece materials. Wrong electrode tip shape. Excessive current/energy set at the Power Supply.

Technical Assistance

If you need further technical assistance, please contact either your authorized service agent or **AMADA WELD TECH** by telephone or FAX, or at the postal or e-mail addresses shown in the *Foreword* of this manual.

Electrode Maintenance

When a welding schedule has been suitable for a particular welding application over many welds, but poor quality welds are now resulting, electrode deterioration could be the problem. If you need to increase welding current to maintain the same weld heat, the electrode tip has probably increased in surface area (mushroomed), effectively decreasing weld current density, thus cooling the weld. Try replacing the electrodes.

The rough surface of a worn electrode tip tends to stick to the work pieces. So, periodic tip resurfacing (dressing) is required to remove pitting, oxides and welding debris from the electrode. You should limit cleaning of an electrode on the production line to using a # 600 grit, silicon carbide electrode polishing disk. If you must clean a badly damaged tip with a file, you must use a polishing disk after filing to ensure the electrode faces are smooth.

The best method of preventing electrode problems is to regularly re-grind electrode tip surfaces and shapes in a certified machine shop.

CHAPTER 6: USER MAINTENANCE

Parts Replacement

There are no replaceable parts for the Power Supply, other than the protection fuse for the 24 volt Air Valve Driver.

Fuse

DESCRIPTION	LOCATION
3.15 A, 125 VAC minimum, Slow-Blow	Rear Panel

WARNING

- Only qualified technicians should perform internal adjustments or replace parts.
- Removal of the unit cover could expose personnel to high voltage.
- Removal of the unit cover may void the warranty.

CHAPTER 7

CALIBRATION

Section I: Introduction

Overview

Calibration instructions are displayed on the series of screens displayed on the Control's LCD. There are only two Calibration *setups*, or equipment connections. After you connect the Control to the calibration equipment as instructed, follow the instructions shown on each LCD screen. While some of the instructions may appear slightly different, the procedures are essentially the same.

It takes approximately one hour to calibrate the Control if working by yourself, faster with an assistant. Once you are familiar with the calibration process, it will become faster and easier to do.

After performing these procedures, the Control will store the calibration values in RAM, where they will be used as standards for the operational welding parameters.

NOTE: Only authorized personnel should perform this procedure.

Calibration Equipment Required

This equipment is required for calibration:

- 2 weld cables, No. 2/0, 1 ft (30 cm) long (Pt # 2/0 BB12)
- 2,500 micro-ohm coaxial shunt resistor accurate to $\pm 0.5\%$.

Source for shunt resistor (Model K-2000-4, 150 Watts, Mod .0025):

T & M Research Products, Inc.

139 Rhode Island Street NE
Albuquerque, New Mexico 87108

Telephone: (505) 268-0316

E-Mail: www.tandmresearch.com


- Calibration Kit, Pt # 4-35914-01
 - Filter Assembly (Pt # 4-36835-01)
 - Special Calibration Cable (Pt # 4-35913-01)
 - Standard BNC Cable (Pt # 205-157)
 - BNC "T-Connector" (Pt # 250-486)
- Digital oscilloscope, Tektronix 724C or equivalent
- 2-wire, normally open switch for weld initiation, mating connector (Pt # 520-001)

The waveforms displayed on the oscilloscope screen will vary from pulse to pulse. To calibrate the Control, adjust the energy output to the *average* value of each pulse displayed on the oscilloscope.

CHAPTER 7: CALIBRATION

Calibration Points


The term *Calibration Points* refers to the various values that need to be calibrated in order for the Control to operate and monitor accurately. There are 12 *Calibration Points*. The instructions in *Section II, Calibration Procedure* tell you how to perform the procedures, the illustration below gives a quick overview of the process.

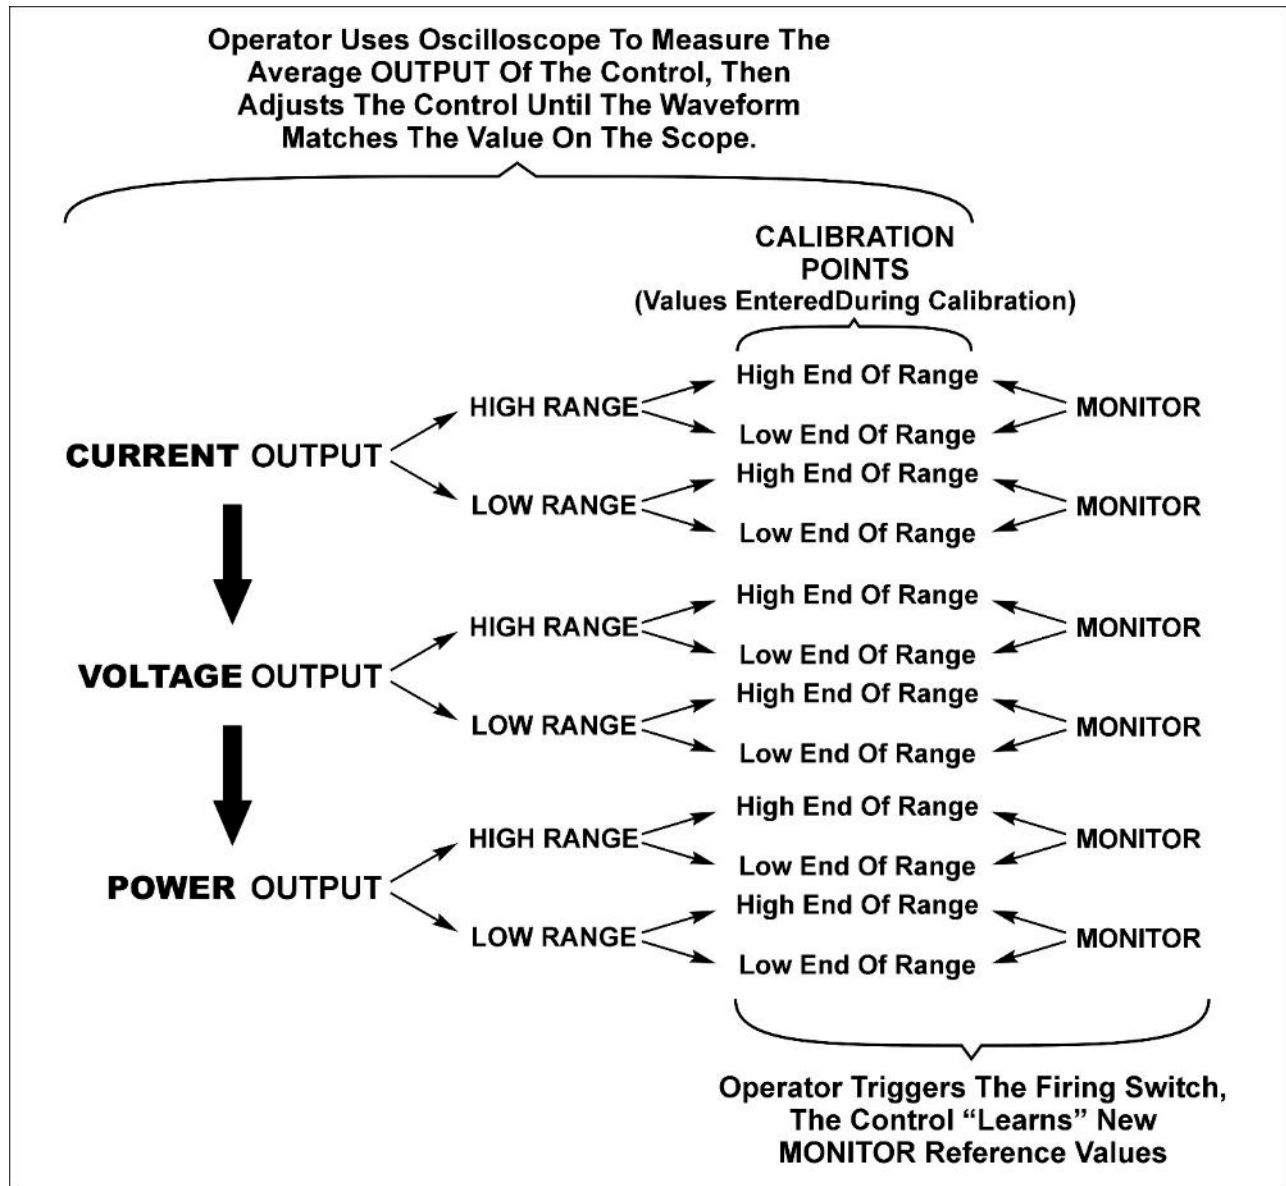

Calibration Points

Section II: Calibration Equipment Setup

Get the required calibration equipment listed in *Section I* and set it up as shown below.

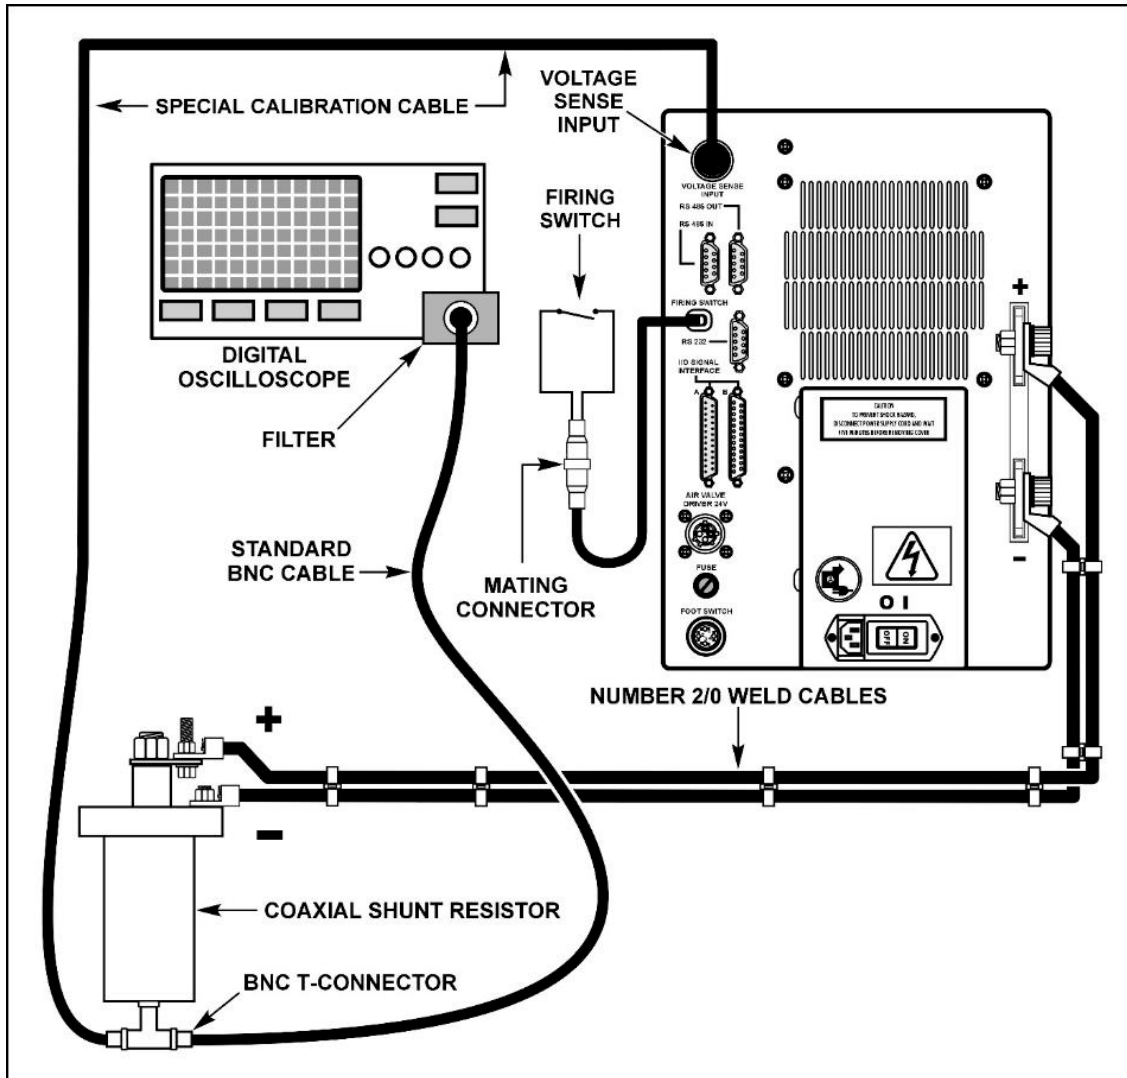

Calibration Setup

NOTES

The ground of the oscilloscope should be isolated from the ground of the electrical "live" by an isolation transformer or other means.

The filter in the Calibration Kit goes between the BNC cable and the oscilloscope input.

Section III: Calibration Procedure

- 1 Verify that the equipment is connected as shown in **Calibration Setup**.
- 2 Turn the Control **ON**.
- 3 Press the **MENU** key to bring up the **MAIN MENU** screen.
- 4 Press the **7** key to select **CALIBRATION**.

MAIN MENU

0. WAVEFORM CHECK	5. COMMUNICATION
1. SETUP	6. RELAY
2. WELD COUNTER	7. CALIBRATION
3. COPY A SCHEDULE	8. RESET DEFAULTS?
4. SYSTEM SECURITY	9. CHAIN SCHEDULES

NUMBER Select an item

- 5 From the first calibration screen, press the keypad down ▼ key to the **PRE-CALIBRATION** screen.

CAUTION

CALIBRATION SHOULD BE PERFORMED BY A QUALIFIED TECHNICIAN ONLY. REFER TO MANUAL FOR CALIBRATION SETUP.

▼ Next, **MENU** menu

- 6 From the **PRE-CALIBRATION** screen, press the **3** key to **RESET CALIBRATION** *before* performing the following procedures.
- 7 At the screen prompt, press the **2** key for **YES** to confirm that you want to reset calibration.

PRE-CALIBRATION


1. TEST DC25 (T-232 REQUIRED)
2. CALIBRATE DC25
3. RESET CALIBRATION
4. TEST SERIAL PORT

▼ **NUMBER** Select, **MENU** Previous menu

- 8 From the **PRE-CALIBRATION** screen, press the **2** key to start the sequence of on-screen calibration instructions.
- 9 The next screen is **CALIBRATION SHUNT**, which requires you to enter the actual value of the 2,500 micro-ohm shunt (the value is printed on the exterior of the shunt). Enter the value using the numeric keypad, then go to the next screen.

NOTE: The prompts at the *bottom* of the screen that tell you how to go to the next screen may vary from screen to screen. To go to the next screen, press the key indicated by the prompt.

- 10 Follow the instructions on the calibration screens. Each screen will show you the desired energy output value for that calibration step. Use the oscilloscope to measure the output, then use the ▲ ▼ keys to adjust the Control output to the correct *average* value.

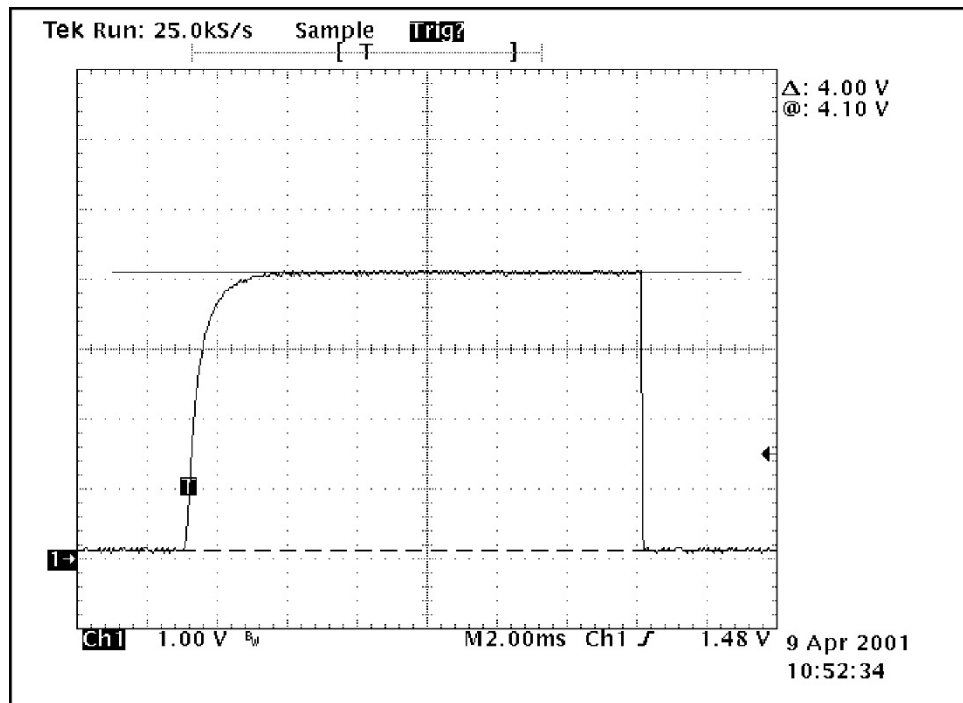

Oscilloscope Display of Average Output

NOTE: Some screens will tell you to fire the Control 5 times when setting the Monitor, others will tell you to keep firing until the desired value is reached. You *must* wait a **minimum of 2 seconds** between firing pulses for calibration to be accurate.

- 11 Continue to follow the instructions on the LCD screens.
- 12 When calibration is complete, keep pressing the **MENU** button on the front of the Control until the **MAIN MENU** is displayed on the LCD.
- 13 Disconnect the Control from the "Calibration Setup," then re-connect the Control as required for your welding system.
- 14 Press the **RUN** button to return to normal operation.

APPENDIX A

TECHNICAL SPECIFICATIONS

General

The DC25 is a linear DC resistance welding power supply that sends energy directly into a weld without the use of a welding transformer. It is capable of executing any weld function at low current, voltage or power levels with high stability and good control.

Note: The specifications listed in this Appendix may be changed without notice.

DESCRIPTION	VALUE	NOTES
Input Line Voltage (1 phase): Model DC25/115 Model DC25/230	Standard nominal voltages and suggested breaker ratings: 115 VAC, 15 A 230 VAC, 10 A	
Line Voltage Tolerance: (referred to nominal)	115 + 15% / -10% 230 + 15% / -10%	All functions perform normally All functions perform normally
Input kVA: (max demand):	DC25/115: 1.5 kVA DC25/230: 1.5 kVA	To be used for sizing ac input power service
Output Capability: (max available to load):	Based on load	See Appendix G, Repetition Rates
Output Current/Steps: (Programmable)	0.100 – 4.000 kA 1 A steps	Actual achievable output based on load. See Appendix G, Repetition Rates
Output Voltage/Steps: (Programmable)	0.100 – 9.9 V 1 mV steps	Actual achievable output based on load. See Appendix G, Repetition Rates
Output Power/Steps: (Programmable)	0.100 – 9.9 kW 1 W steps	Actual achievable output based on load. See Appendix G, Repetition Rates
Weld Periods:	0-19 ms Upslope 0-9.9 ms Weld 0-9.9 ms Downslope	
Duty Cycle:	Based on load	See Appendix G, Repetition Rates
Weld Control: (Average values are regulated)	Weld Current, Voltage, or Power with simultaneous limits on one unregulated parameter	
Weld Control Ripple: (At power line frequency)	2% of energy setting, peak to peak	Worst case
Steady State Regulation During Line Fluctuations:	Output: +/- 2% of reading	Line voltage within + 15% / -10% tolerance.

APPENDIX A: TECHNICAL SPECIFICATIONS

DESCRIPTION	VALUE	NOTES
Regulation During Load Resistance Fluctuation:	Current: $\pm 2\%$ of setting ± 10 A Voltage: $\pm 2\%$ of setting ± 0.05 V Power: $\pm 5\%$ of setting ± 50 W	Load variation from 0.5 to 10 milliohms, exclusive of ripple. After weld time of 2 ms.
Steady state Control Accuracy:	Current: $\pm 2\%$ of setting ± 10 A Voltage: $\pm 2\%$ of setting ± 0.05 V Power: $\pm 5\%$ of setting ± 50 W	After weld time of 2 ms.
Current, Voltage, Power Repeatability:	All modes: $\pm 2\%$	Weld to weld repeatability with fixed load resistance and input line voltage, steady state.
Rise Time:	Limited by external secondary circuit	
Data Communications:	Remote capability to upload / download weld schedule; monitor welds; set up parameters; select schedule; and read weld results buffer	
Weld Monitor:	Range: Current from 0 to 4.8 kiloamps Voltage from 0 to 9.9 volts Power from 0 to 9.9 kilowatts	User selectable limits on peak values of one of three parameters: current, voltage, or power. When a parameter goes outside of limits, the unit can be set to report the error, terminate the weld, or inhibit a second pulse. APC functionality also included.
Current Monitoring Accuracy:	The sum of $\pm 2\%$ of setting and ± 10 A Reference is actual current delivered.	Average value after settling time.
Voltage Monitoring Accuracy:	The sum of $\pm 2\%$ of setting and ± 0.05 V at values greater than 0.1 V Reference is actual voltage delivered.	Average value after settling time. Voltage monitoring is not guaranteed below 0.1 V.
Power Monitoring Accuracy:	The sum of $\pm 5\%$ of setting and ± 50 W Reference is actual power delivered	Average value after settling time.

APPENDIX A: TECHNICAL SPECIFICATIONS

Mechanical Characteristics		
DESCRIPTION	VALUE	NOTES
Size:	12.75" H x 9.25" W x 23.5" L (324 mm H x 235 mm W x 597 mm L)	
Weight:	52 lb (24 kg)	Weight less shipping kit or shipping materials

Environmental Characteristics		
DESCRIPTION	VALUE	NOTES
Operating Ambient Air Temperature:	0 - 40 °C	
Operating Humidity:	10 – 95 % Relative Humidity	(Non-condensing)

Interface Signals		
DESCRIPTION	VALUE	NOTES
Input / Output:	24V AC/DC inputs and outputs, 2500 V RMS optically isolated, hardware selectable positive or negative logic. Fail-safe emergency power off input. External or internal power supplied to inputs. Inputs to be current sourcing or sinking. Dedicated connectors for 24 V air head, 2-wire force firing switch, voltage sense cable, computer interface, foot switch. Additional connections for weld head, schedule selection, process inhibit, emergency stop. Four general purpose programmable relays.	RS-232 and RS-485 communications included

Firmware
Firmware is subject to change without prior notice. Contact AMADA WELD TECH for latest version.

DC25 LINEAR DC RESISTANCE WELDING CONTROL

APPENDIX B

ELECTRICAL AND DATA CONNECTORS


Introduction

This Appendix describes the electrical and data connectors located on the rear panel of the DC25. Each connector is illustrated with pin identification. Following each picture is a table listing the technical specifications for that connector. Connectors are described in the order in which they appear on the rear panel of the DC25, starting at the top left.

Note: The specifications listed in this Appendix may be changed without notice.

Voltage Sense Input

PIN #1 -- Analog Ground

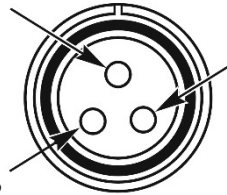

PIN #2 -- Input #1


PIN #3 -- Input #2

VOLTAGE SENSE INPUT CONNECTOR SPECIFICATIONS						
PIN NO.	SIGNAL		MAX VOLTAGE	MAX CURRENT	I/O	COMMENTS
	NAME	TYPE				
1	AGND					Analog Ground
2	Input #1	Pulse	15 V	0.1 A	I	Signal is differential between Input #1 and Input #2 (polarity is not important).
3	Input #2	Pulse	15 V	0.1 A	I	


APPENDIX B: ELECTRICAL AND DATA CONNECTORS

RS-485-IN and RS-485-OUT

NOTE: Pin connections and specifications for both **RS-485** connectors are identical.

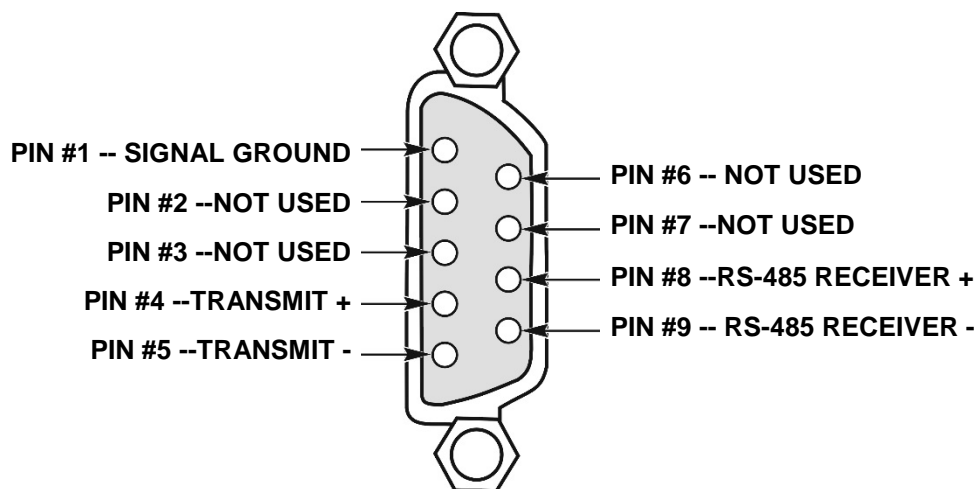


RS-485 IN/OUT CONNECTOR SPECIFICATIONS		
PIN NO.	DESCRIPTION	PIN TYPE
1	Signal Ground	Isolated ground (1 kVDC Isolation)
2	Not used	
3	Not used	
4	Transmit +	RS-485 Driver +
5	Transmit -	RS-485 Driver -
6	Not used	
7	Not used	
8	Receive +	RS-485 Receiver +
9	Receive -	RS-485 Receiver -

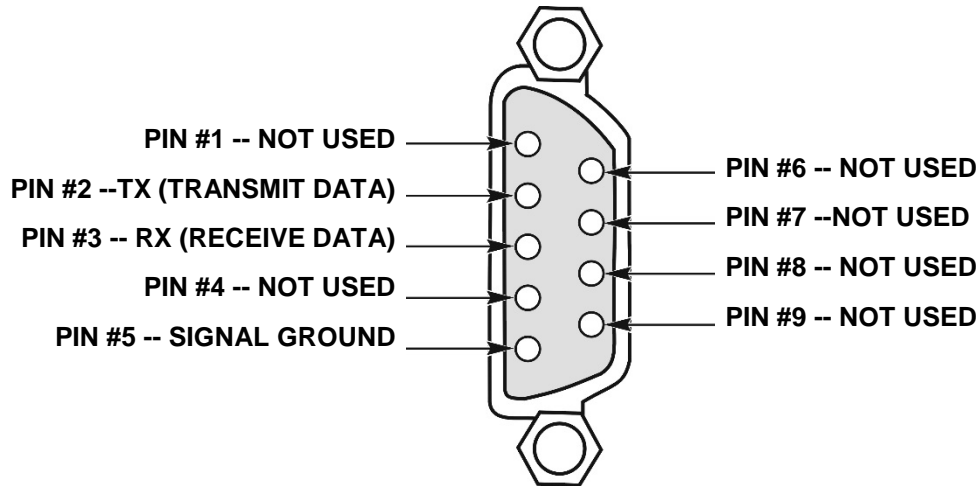RS-232

RS-232 CONNECTOR SPECIFICATIONS		
PIN NO.	DESCRIPTION	PIN TYPE
1	Not Used	
2	TX (Transmit Data)	RS-232 Driver
3	RX (Receive Data)	RS-232 Receiver
4	Not Used	
5	Signal Ground	Analog Ground (ISOGND1)
6	Not Used	
7	Not Used	
8	Not Used	
9	Not Used	

APPENDIX B: ELECTRICAL AND DATA CONNECTORS

I/O Signal Interface A

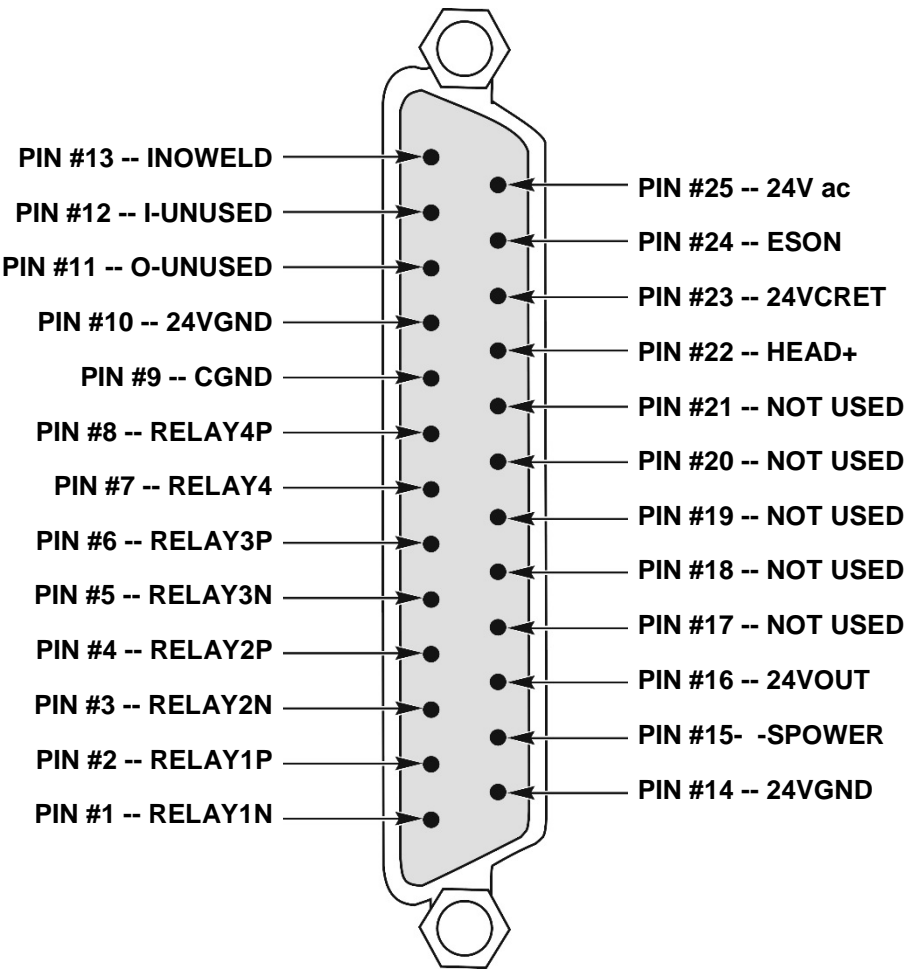


Specification Table on next page.

APPENDIX B: ELECTRICAL AND DATA CONNECTORS

I/O SIGNAL INTERFACE A CONNECTOR SPECIFICATIONS					
PIN NO.	NAME	VOLTAGE	CURRENT	I/O	COMMENTS
1	RELAY1N	250 VAC or 30 VDC	1 A	O	Relay output 1 Negative
2	RELAY1P	250 VAC or 30 VDC	1 A	O	Relay output 1 Positive
3	RELAY2N	250 VAC or 30 VDC	1 A	O	Relay output 2 Negative
4	RELAY2P	250 VAC or 30 VDC	1 A	O	Relay output 2 Positive
5	RELAY3N	250 VAC or 30 VDC	1 A	O	Relay output 3 Negative
6	RELAY3P	250 VAC or 30 VDC	1 A	O	Relay output 3 Positive
7	RELAY4N	250 VAC or 30 VDC	1 A	O	Relay output 4 Negative
8	RELAY4P	250 VAC or 30 VDC	1 A	O	Relay output 4 Positive
9	CGND	CGND			Chassis ground
10	+24VGND	GND			+24VDC GND
11	O-UNUSED				Not used
12	I-UNUSED				Not used
13	INOWELD	+24 V	10 mA	I	No weld input Switch normally open
14	24VGND	GND			+24 VDC GND
15	SPOWER	24 VDC	20 mA	I	Power can be from internal or external source for Schedule Select, Process Inhibit, Istop.
16	24VOUT	+24 VDC (open circuit)	48 mA at < 24 VDC	O	+24 VDC out through 200 ohm
17	Not used				
18	Not used				
19	Not used				
20	Not used				
21	Not used				
22	HEAD+	24 VAC	3 A	O	24 VAC Valve Driver
23	24VAC RET	24 VAC Return	3 A	O	24 VAC Valve Driver Return
24	ESON	24 VAC	3 A	I	Emergency Stop
25	24V ac	24 VAC	3 A	O	Internal 24 VAC

I/O Signal Interface B

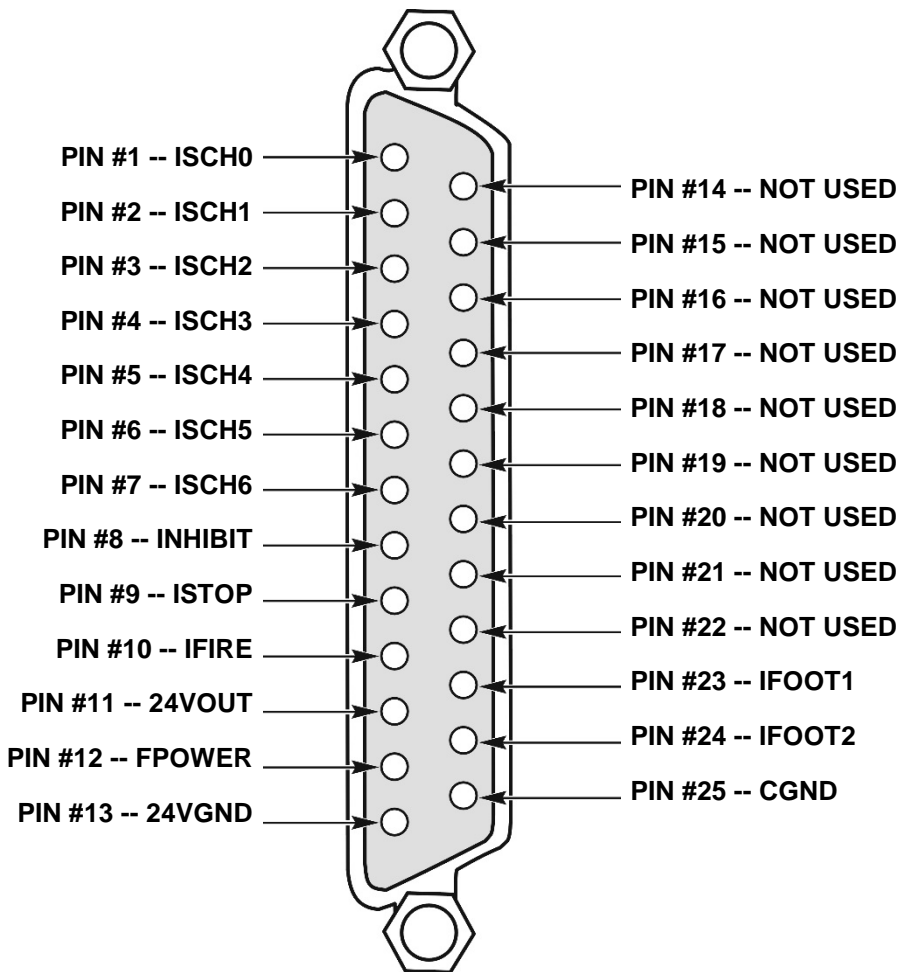

Specification Table on next page.

APPENDIX B: ELECTRICAL AND DATA CONNECTORS


I/O SIGNAL INTERFACE B CONNECTOR SPECIFICATIONS					
PIN NO.	NAME	VOLTAGE	CURRENT	I/O	COMMENTS
1	ISCH0	+24 VDC	10 mA	I	Remote Schedule Select 2 ⁰
2	ISCH1	+24 VDC	10 mA	I	Remote Schedule Select 2 ¹
3	ISCH2	+24 VDC	10 mA	I	Remote Schedule Select 2 ²
4	ISCH3	+24 VDC	10 mA	I	Remote Schedule Select 2 ³
5	ISCH4	+24 VDC	10 mA	I	Remote Schedule Select 2 ⁴
6	ISCH5	+24 VDC	10 mA	I	Remote Schedule Select 2 ⁵
7	ISCH6	+24 VDC	10 mA	I	Remote Schedule Select 2 ⁶
8	IINHIBIT	+24 VDC	10 mA	I	Stop next weld pulse
9	ISTOP	+24 VDC	10 mA	I	User convenience stop function.
10	IFIRE	+24 V	10 mA	I	Firing switch normally open
11	24VOUT	+24 VDC	48 mA at < 24 VDC	O	+24 VDC out through 200 ohm
12	FPOWER	+24 VDC	20 mA	I	Power can be from internal or external source for Footswitch, Firing Switch, INOWELD.
13	24VGND	GND			+24 VDC GND
14	Not used				
15	Not used				
16	Not used				
17	Not used				
18	Not used				
19	Not used				
20	Not used				
21	Not used				
22	Not used				
23	IFOOT1	+24 V	10 mA	I	Foot switch normally open, Level 1
24	IFOOT2	+24 V	10 mA	I	Foot switch normally open, Level 2
25	CGND	CGND			Chassis ground

APPENDIX B: ELECTRICAL AND DATA CONNECTORS

25-Pin Mating Plug with EMERGENCY STOP Shorting Wires for I/O Connector A.

This connector should be attached to I/O Connector A when it is shipped from the factory. Pins 24 & 25 are connected to the shorting wires (see illustration below) for the Emergency Stop Input, pins 15 and 16 (SPOWER) have an internal jumper between them. The external wires are provided so the user can connect to an Emergency Stop Switch. Opening the connection will cause the Power Supply to initiate an Emergency Stop. The LCD will display **Emergency Stop - Operator Activated** and a beep will sound. An Emergency Stop will disable all power outputs.

To reset the condition, the switch connection must be closed, and the **RUN** key must be pushed on the front panel to reset the Power Supply. Users should verify that the weld Schedule is correct. If not, reset to the correct schedule if necessary.

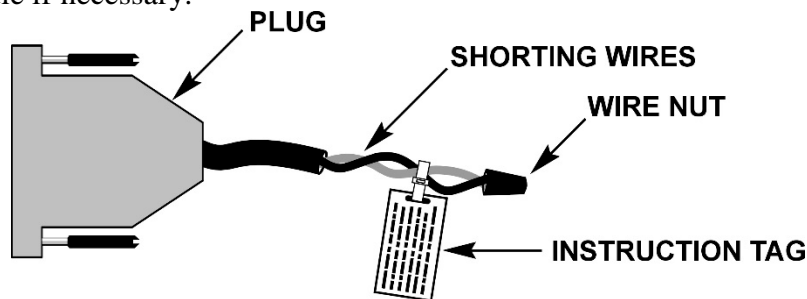

An instruction tag is attached to the shorting wires with a cable tie. Instructions are printed on the front and back of the tag in several languages (full text below).

- EMERGENCY STOP-

Open electrical circuit to retract weld head.

- DESCONEXION DE EMERGENCIA -

Abra el circuito eléctrico para retraer la cabeza de soldadura.

- PARADA DE EMERGÊNCIA -

Abrir o circuito elétrico para tirar a cabeça da máquina.

- ARRESTO D'EMERGENZA-

Interrompere l'alimentazione per risalita testa.

- HÄTÄKYTKIN POIS -

Avaa virtapiiri vetääkseen hitsauspään takaisin.

- ARRET D'URGENCE -

Ouvrez le circuit électrique pour retirer la tête de soudure.

- NOODSTOP -

Open het elektrische circuit om de laskop terug te trekken.

- NÖDSTOPP -

Öppna den elektriska kretsen för att dra tillbaka svetstråden.

- NOT AUSSCHALTER -

Wird den elektrischen Kreis öffnen, der Schweißkopf wird zurück gezogen.

Emergency Stop Switch Instruction Tag


25-Pin Mating Plug with Internal Jumper For I/O Connector B.

This connector should be attached to I/O Connector B when it is shipped from the factory. This plug has an *internal* jumper between pins 11 and 12 (FPOWER).

NOTE: In order to operate, *both* mating plugs *must* be attached to the I/O connectors, *or* I/O cables wired for the proper jumpers *must* be attached to the Power Supply.


APPENDIX B: ELECTRICAL AND DATA CONNECTORS

Air Valve Driver 24V

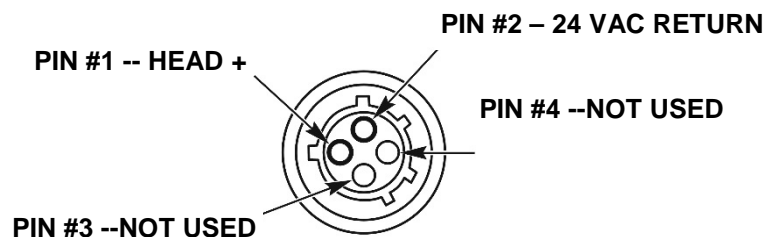

AIR VALVE DRIVER CONNECTOR SPECIFICATIONS						
PIN NO.	SIGNAL		MAX VOLTAGE	MAX CURRENT	I/O	COMMENTS
	NAME	TYPE				
1	HEAD+	AC	24 VAC	3 A	O	Air valve drive
2	24 VAC RET	AC	24 VAC	3 A	O	Air valve drive return
3	Not Used					
4	Not Used					

Firing Switch

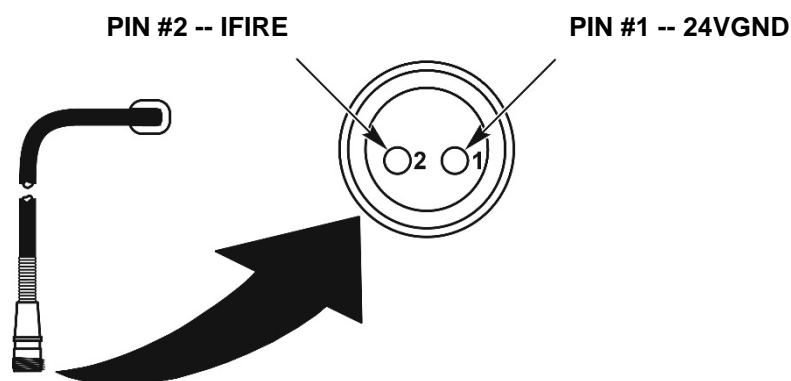


FIRING SWITCH CONNECTOR SPECIFICATIONS						
PIN NO.	SIGNAL		MAX VOLTAGE	MAX CURRENT	I/O	COMMENTS
	NAME	TYPE				
1	24 V GND	Digital.	SGND	20 mA	--	Firing Switch signal ground.
2	IFIRE	Digital	+24 V	10 mA	I	Firing Switch normally open.
SHIELD	CGND	--	CGND	--	--	Chassis ground.

NOTE: In addition to the debounce time, there is a delay of no greater than 2.5 ms before the start signal is recognized by the Power Supply.


APPENDIX B: ELECTRICAL AND DATA CONNECTORS

Foot Switch

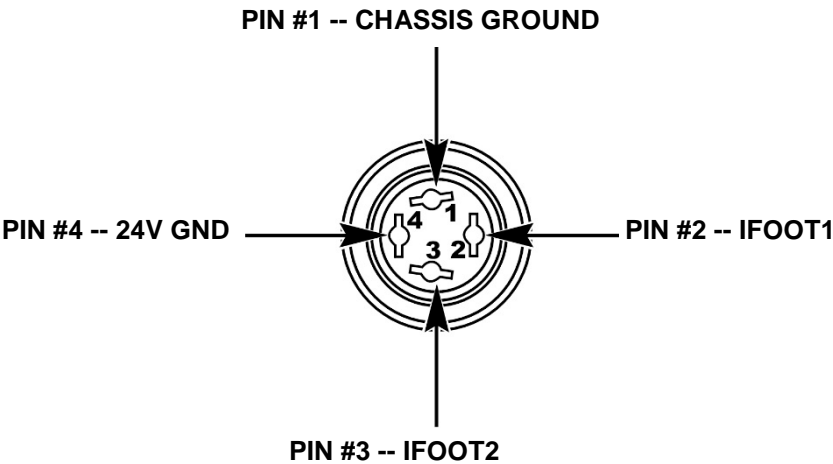


FOOT SWITCH CONNECTOR SPECIFICATIONS						
PIN NO.	SIGNAL		VOLTAGE	MAX CURRENT	I/O	COMMENTS
	NAME	TYPE				
1	CGND	--	--	--	--	Chassis ground
2	IFOOT1	Digital	+24 V	10 mA	I	Foot switch SW1 (Level 1) normally open
3	IFOOT2	Digital	+24 V	10 mA	I	Foot switch SW2 (Level 2) normally open
4	24V GROUND	Digital	SGND	20 mA	I	Foot switch signal ground

AC Input Power Connection

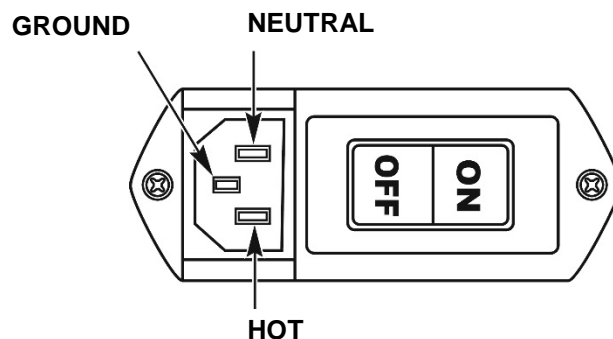

AC INPUT POWER CONNECTION SPECIFICATIONS			
MODEL	TERMINAL	MAXIMUM VOLTAGE	MAXIMUM CURRENT
DC25/115	Hot	132 volts	15 amps
	Neutral	--	--
	Ground	--	--
DC25/230	Hot	265 volts	10 amps
	Neutral	--	--
	Ground	--	--

Weld Terminals

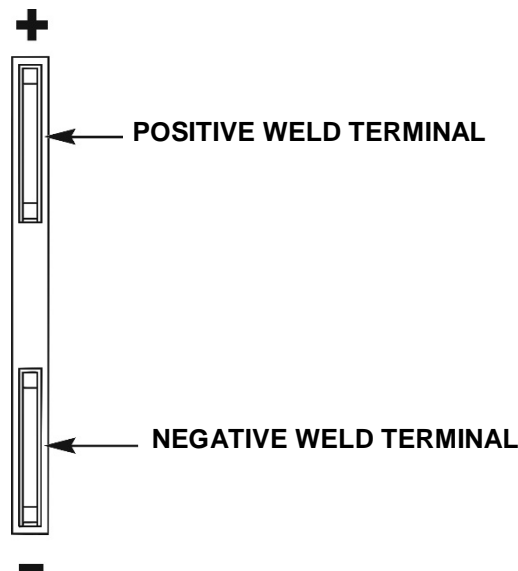

WELD TERMINAL SPECIFICATIONS			
TERMINAL	MAXIMUM VOLTAGE	MAXIMUM CURRENT	COMMENTS
+	9.9 volts	5,000 amps	Variable
-	--	--	Return

APPENDIX C


THE BASICS OF RESISTANCE WELDING

Resistance Welding Parameters

Resistance welding heat is produced by passing electrical current through the parts for a fixed time period. The welding heat generated is a function of the magnitude of the weld current, the electrical resistance of the parts, the contact resistance between the parts, and the weld force applied to the parts. Sufficient weld force is required to contain the molten material produced during the weld. However, as the force is increased, the contact resistance decreases. Lower contact resistance requires additional weld current, voltage, or power to produce the heat required to form a weld.

The higher the weld force, the greater the weld **current**, **voltage**, **power**, or **time** required to produce a given weld. The formula for amount of heat generated is I^2RT -- the square of the weld current [**I**] times the workpiece resistance [**R**] times the weld time [**T**].

Welding Parameter Interaction

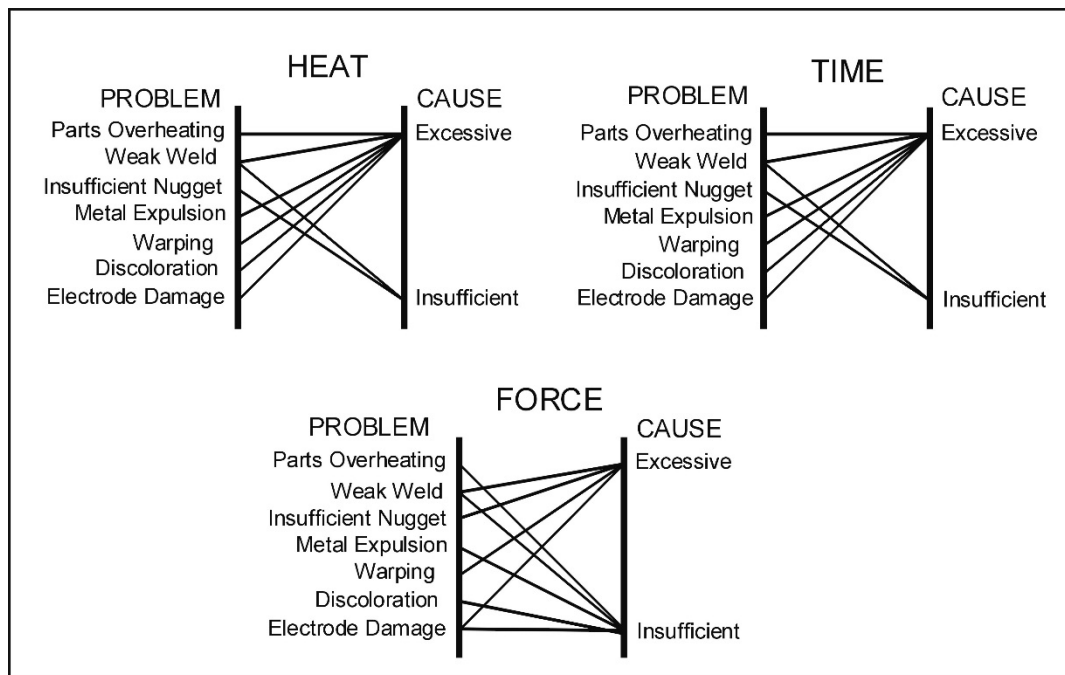

Interaction of Welding Parameters

APPENDIX C: THE BASICS OF RESISTANCE WELDING

Electrode Selection

Correct electrode selection strongly influences how weld heat is generated in the weld area. In general, use conductive electrodes such as a RWMA-2 (Copper alloy) when welding electrically resistive parts such as nickel or steel so that the weld heat is generated by the electrical resistance of the parts and the contact resistance between the parts. Use resistive electrodes such as RWMA-13 (Tungsten) and RWMA-14 (Molybdenum) to weld conductive parts such as copper and gold because conductive parts do not generate much internal heat so the electrodes must provide external heat. Use the following Electrode Selection Table for selecting the proper electrode materials.

MATERIAL	ELECT RWMA TYPE	MATERIAL	ELECT RWMA TYPE
Alumel	-2	Alumel	-2
Alumel	-2	Chromel	-2
Alumel	-2	Dumet	-2
Aluminum	-1	Aluminum	-1
Aluminum	-1	Aluminum Alloys	-1
Aluminum	-1	Cadmium Plating	-1
Aluminum	-1	Tinned Brass	-14
Aluminum	-1	Tinned Copper	-14
Aluminum	-1	Gold Plated Dumet	-2
Aluminum	-1	Gold Plated Kovar	-2
Aluminum	-1	Kovar	-2
Aluminum	-1	Magnesium	-1
Aluminum	-1	Cold Rolled Steel	-2
Aluminum	-1	Stainless Steel	-2
Beryllium Copper	-2	Beryllium Copper	-2
Beryllium Copper	-2	Brass	-2, -14
Beryllium Copper	-2	Copper	-14
Beryllium Copper	-2	Tinned Copper	-14
Beryllium Copper	-2	Nickel	-2

MATERIAL	ELECT RWMA TYPE	MATERIAL	ELECT RWMA TYPE
Beryllium Copper	-2	Cold Rolled Steel	-2
Beryllium Copper	-2	Stainless Steel	-2
Brass	-2, -14	Brass	-2, -14
Brass	-2, -14	Tinned Brass	-14
Brass	-2, -14	Consil	-2
Brass	-2, -14	Constantan	-2
Brass	-2, -14	Copper	-14
Brass	-2, -14	Tinned Copper	-14
Brass	-2, -14	Dumet	-2
Brass	-2, -14	Nichrome	-2
Brass	-2, -14	Nickel	-2
Brass	-2, -14	NiSpan C	-2
Brass	-2, -14	Paliney 7	-2
Brass	-2, -14	Silver	-11, -14
Brass	-2, -14	Cold Rolled Steel	-2
Brass	-2, -14	Stainless Steel	-2
Bronze	-2, -11	Bronze	-2, -11
Bronze	-2, -11	Tinned Copper	-14
Bronze	-2, -11	Iron	-2

APPENDIX C: THE BASICS OF RESISTANCE WELDING

MATERIAL	ELECT RWMA TYPE	MATERIAL	ELECT RWMA TYPE
Bronze	-2, -11	Nichrome	-2
Bronze	-2, -11	Nickel	-2
Chromel	-2	Chromel	-2
Chromel	-2	Constantan	-2
Chromel	-2	Copel	-2
Chromel	-2	Copper	-14
Chromel	-2	Tinned Copper	-14
Chromel	-2	Dumet	-2
Chromel	-2	Nichrome	-2
Chromel	-2	Cold Rolled Steel	-2
Consil	-2	Consil	-2
Consil	-2	Tinned Copper	-14
Consil	-2	Dumet	-2
Constantan	-2	Constantan	
Constantan	-2	Copper	-14
Constantan	-2	Tinned Copper	-14
Constantan	-2	Iron	-2
Constantan	-2	Nichrome	-2
Constantan	-2	Nickel	-2
Copper	-14	Copper	-14
Copper	-14	Dumet	-2
Copper	-14	Invar	-2
Copper	-14	Karme	-2
Copper	-14	Manganin	-2
Copper	-14	Nichrome	-2
Copper	-14	Nickel	-2
Copper	-14	Paliney 7	-2

MATERIAL	ELECT RWMA TYPE	MATERIAL	ELECT RWMA TYPE
Copper	-14	Silver	-11, -14
Copper	-14	Cold Rolled Steel	-2
Copper	-14	Stainless Steel	-2
Dumet	-2	Dumet	-2
Dumet	-2	Nichrome	-2
Dumet	-2	Nickel	-2
Dumet	-2	Platinum	-2
Dumet	-2	Cold Rolled Steel	-2
Evanohm	-14	Copper	-14
Gold	-14	Gold	-14
Gold	-14	Kovar	-2
Hastalloy	-2	Titanium	-2
Inconel	-2	Inconel	-2
Inconel	-2	Kulgrid	-2
Invar	-2	Invar	-2
Iridium	-2	Iridium	-2
Iridium	-2	Platinum	-2
Iron	-2	Iron	-2
Karma	-2	Karma	-2
Karma	-2	Nickel	-2
Karma	-2	Platinum	-2
Kovar, Gold Plate	-2	Kovar, Gold Plate	-2
Kovar, Gold Plate	-2	Kulgrid	-2
Kovar, Gold Plate	-2	Nickel	-2
Kovar, Gold Plate	-2	Silver	-11, -14
Kovar, Gold Plate	-2	Stainless Steel	-2
Magnesium	-1	Magnesium	-1

APPENDIX C: THE BASICS OF RESISTANCE WELDING

MATERIAL	ELECT RWMA TYPE	MATERIAL	ELECT RWMA TYPE
Molybdenum	-2	Nickel	-2
Molybdenum	-2	Tungsten	-2
Nichrome	-2	Nichrome	-2
Nichrome	-2	Nickel	-2
Nichrome	-2	Cold Rolled Steel	-2
Nichrome	-2	Stainless Steel	-2
Nickel	-2	Nickel	-2
Nickel	-2	Cold Rolled Steel	-2
Nickel	-2	Stainless Steel	-2
Nickel	-2	Tantalum	-2
Nickel	-2	Tungsten	-2
Nickel Alloy	-2	Nickel Alloy	-2
Nickel Alloy	-2	Tinned Brass	-14
Nickel Alloy	-2	Beryllium Copper	-2
Nickel Alloy	-2	Consil	-2
Nickel Alloy	-2	Tinned Copper	-14
Nickel Alloy	-2	Nichrome	-2
Nickel Alloy	-2	Nickel	-2
Nickel Alloy	-2	Cold Rolled Steel	-2

MATERIAL	ELECT RWMA TYPE	MATERIAL	ELECT RWMA TYPE
NiSpan C	-2	NiSpan C	-2
NiSpan C	-2	Cold Rolled Steel	-2
NiSpan C	-2	Stainless Steel	-2
Niobium	-2	Niobium	-2
Platinum	-2	Platinum	-2
Paliney 7	-2	Paliney 7	-2
Silver	-11, -14	Silver	-11, -14
Silver	-11, -14	Cadmium	-13
Cold Rolled Steel	-2	Cold Rolled Steel	-2
Cold Rolled Steel	-2	Stainless Steel	-2
Cold Rolled Steel	-2	Tantalum	-2
Stainless Steel	-2	Stainless Steel	-2
Stainless Steel	-2	Tungsten	-2
Tantalum	-2	Tantalum	-2
Titanium	-2	Titanium	-2
Tungsten	-2	Tungsten	-2
Tungsten	-2	henium	-2
Zinc	-14	Zinc	-14

Electrode Maintenance

Depending on use, periodic tip resurfacing is required to remove oxides and welding debris from electrodes. Cleaning of electrodes on production line should be limited to use of # 400 - 600 grit electrode polishing disks. For less critical applications, a file can be used to clean a badly damaged tip. However, after filing, polishing disks should then be used to ensure that the electrode faces are smooth. If this is not done, the rough surface of the electrode face will have a tendency to stick to the work piece.

Weld Schedule Development

Developing a weld schedule is a methodical procedure, which consists of making sample welds and evaluating the results. The first weld should be made at low energy settings. Adjustments are then made to each of the welding parameters *one at a time* until a successful weld is made.

- 1 Install the correct electrodes in the electrode holders on the Weld Head. See the preceding Table for electrode material recommendations.
- 2 Use a flat electrode face for most applications. Use a "domed" face if surface oxides are a problem. If either of the parts is a wire, the diameter of the electrode face should be equal to or greater than the diameter of the wire. If both parts are flat, the face should be at least one-half the diameter of the electrodes. Pencil point electrodes cause severe electrode sticking to the parts, unexplained explosions, and increase the weld heat substantially because of the reduced electrode-to-part contact area.
- 3 Use the Force Adjustment Knob on the Weld Head to set the Firing Force and adjust an Air Actuated Weld Head.
- 4 Program a weld schedule, then make your first weld. Always observe safety precautions when welding and wear safety glasses. For a complete procedure on making welds, refer to *Chapter 4, Operating Instructions*.
- 5 Use pliers to peel the welded materials apart. A satisfactory weld will show residual material pulled from one material to the other. Tearing of base material around the weld nugget indicates a material failure NOT a weld failure. Excessive electrode sticking and/or "spitting" should define a weld as unsatisfactory and indicates that too much weld current, voltage, power, or time has been used.
- 6 If the parts pull apart easily or there is little or no residual material pulled, the weld is weak. Increase the weld time in 1 ms increments. Increase weld current, voltage, or power if a satisfactory weld achieved using 10 ms of weld time.

NOTE: Actual weld strength is a user-defined specification.

- 7 Polarity, as determined by the direction of weld current flow, can have a marked effect on the weld characteristics of some material combinations. This effect occurs when welding materials with large differences in resistivity, such as copper and nickel or when welding identical materials with thickness ratios greater than 4 to 1. The general rule is that the more resistive material or the thinner material should be placed against the negative (-) electrode. Polarity on the Power Supply can only be changed by reversing the Weld Cables.

Weld Strength Testing

Destructive tests should be performed on a random basis using actual manufacturing parts. Destructive tests made on spot welds include tension, tension-shear, peel, impact, twist, hardness, and macro-etch tests. Fatigue tests and radiography have also been used. Of these methods torsional shear is preferred for round wire and a 45-degree peel test for sheet stock.

APPENDIX C: THE BASICS OF RESISTANCE WELDING

Weld Strength Profiles

Creating a weld strength profile offers the user a scientific approach to determining the optimum set of welding parameters and then displaying these parameters in a graphical form.


- 1 Start at a low weld current, voltage, or power, making five or more welds, then perform pull tests for each weld. Calculate the average pull strength. Increase weld current, voltage, or power and repeat this procedure. Do not change the weld time, weld force, or electrode area.
- 2 Continue increasing weld current, voltage, or power until any unfavorable characteristic occurs, such as sticking or spitting.
- 3 Repeat steps 1 through 3 for different weld forces, then create a plot of part pull strength versus weld current, voltage, or power for different weld forces as shown in the illustration below, *Typical Weld Strength Profile*.

Typical Weld Strength Profile

The picture on the right illustrates a typical weld strength profile. The 14 lb electrode force curve shows the highest pull strengths but the lowest tolerance to changes in weld current, voltage, or power. The 12 lb electrode force curve shows a small reduction in pull strength, but considerably more tolerance to changes in weld energy. Weld heat will vary as a result of material variations and electrode wear.

The 12 lb electrode force curve is preferred. It shows more tolerance to changes in weld current, voltage, or power and has nearly the same bond strength as the 14 lb electrode force curve.

A comparison of weld schedules for several different applications might show that they could be consolidated into one or two weld schedules. This would have obvious manufacturing advantages.

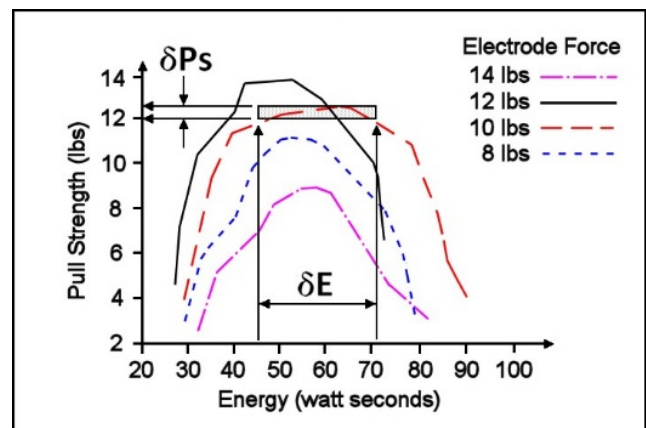

Typical Weld Strength Profile

APPENDIX D

Quality Resistance Welding Solutions: Defining the Optimum Process

Introduction

A quality resistance welding solution both meets the application objectives and produces stable, repeatable results in a production environment. In defining the optimum process the user must approach the application methodically and consider many variables. In this article we will look at the following key stages and principles to be considered when defining the optimum resistance welding process:

- Materials and their properties
- Basic resistance welding
- principles
- Weld profiles
- Approach to development
- Common problems
- Use of screening DOE's
- Use of factorial DOE's

Resistance Welding -- A Material World

The first consideration in designing a quality welding solution is the properties of the materials to be joined and the quality requirements of the desired welded joint. At this stage, it is worthwhile to review the way the resistance welding process works and the likely outcome when the parts are resistance welded.

There are four main types of structural materials:


- Metals (silver, steel, platinum)
- Ceramic (alumina, sand)
- Plastics/polymers (PVC, teflon)
- Semiconductors (silicon, germanium)

Of these, only metals can be resistance welded because they are electrically conductive, soften on heating, and can be forged together without breaking.

APPENDIX D: DEFINING THE OPTIMUM PROCESS

Alloys are a mixture of two or more metals. An alloy is normally harder, less conductive, and more brittle than the parent metal which has bearing on the type of joint one can expect when resistance welding a combination of different metals.

Metals atoms are naturally attracted to other metal atoms even in different parent materials. Metals and alloys will bond together once surface contaminants such as dirt, grease, and oxides removed. Resistance welding generates heat at the material interface, which decomposes the dirt and grease and helps to break up the oxide film. The resultant heat softens or melts the metal and the applied force brings the atoms on either side into close contact to form the bond. The strength of the joint develops as it cools and a new structure is formed.

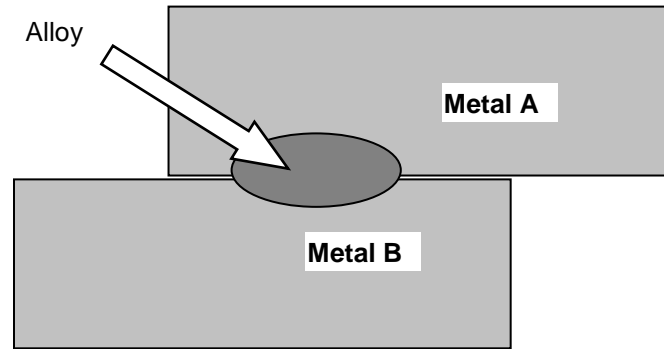

There are three main types of bonds that can be formed using the resistance welding process:

- **Solder or Braze Joint**

A filler material such as a solder or braze compound is either added during the process or present as a plating or coating. Soldered joints are typically achieved at temperatures less than 400 °C and brazed joints such as Sil-Phos materials melt at temperatures above 400 °C.

- **Solid-State Joint**

A solid state joint can be formed when the materials are heated to between 70 - 80% of their melting point.

- **Fusion Joint**

A fusion joint can be formed when both metals are heated to their melting point and their atoms mix.


Many micro-resistance welding challenges involve joining dissimilar metals in terms of their melting points, electrical conductivity, and hardness. A solid-state joint can be an ideal solution for these difficult applications; there is no direct mixing of the two materials across the weld interface thus preventing the formation of harmful alloys that could form brittle compounds that are easily fractured. Remember that in a solid-state joint, the metals are only heated to 70 - 80% of their respective melting points, resulting in less thermal stress during heating and subsequent joint cooling in comparison to a fusion weld. As there is no real melting of the materials in a solid-state joint, there is less chance of weld splash or material expulsion. A weld nugget can still be achieved with a solid-state joint.

Consider the Material Properties

The important material properties to be considered in the resistance welding process are:

- *Electrical and thermal conductivity*
- *Plating and coating*
- *Hardness*
- *Melting point*
- *Oxides*

The figure below illustrates the variance in resistivity and melting points for some of the more common materials used in micro resistance welding today.

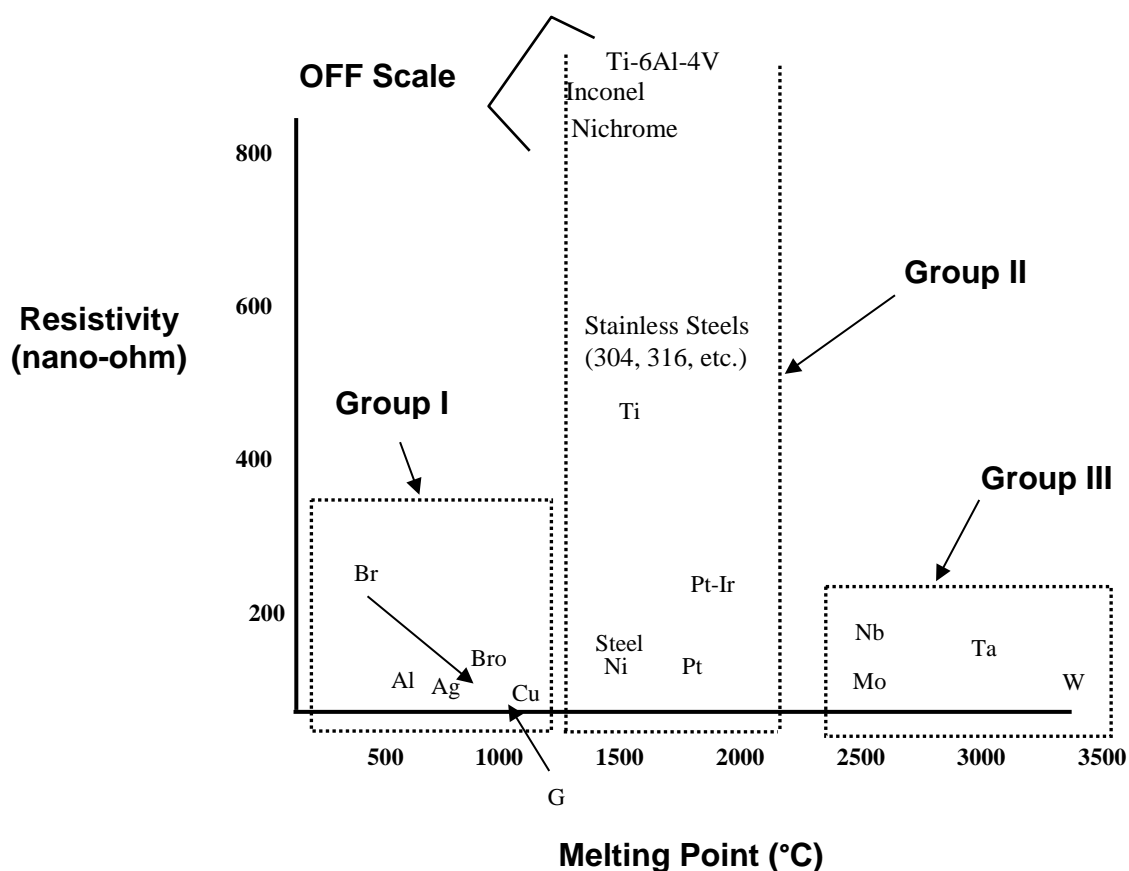

The materials can be grouped into three common categories. The types of joints achievable within each of the main groups are detailed below:

- **Group I – Conductive Metals**

Conductive metals dissipate heat and it can be difficult to focus heat at the interface. A solid-state joint is therefore preferred. Typically, resistive electrode materials are used to provide additional heating.

APPENDIX D: DEFINING THE OPTIMUM PROCESS

- Group II – Resistive Metals**

It is easier to generate and trap heat at the interface of resistive metals and therefore it is possible to form both solid state and fusion welds depending on time and temperature. Upslope can reduce contact resistances and provide heating in the bulk material resistance.


- Group III – Refractory Metals**

Refractory metals have very high melting points and excess heating can cause micro-structural damage. A solid-state joint is therefore preferred.

The chart below gives some guidance on the type of joint that can be expected and design considerations required when joining materials from the different groups.

	Group I	Group II	Group III
Group I (Copper)	<ul style="list-style-type: none">• Solid-State• W/Mo electrodes	<ul style="list-style-type: none">• Solid-State• Projection on Group I	<ul style="list-style-type: none">• Solid-State• Fine projections on Group III
Group II (Steel)		<ul style="list-style-type: none">• Solid-State or Fusion	<ul style="list-style-type: none">• Solid-state or braze of II on III• Projection on III
Group III (Moly)			<ul style="list-style-type: none">• Solid-State

Basic Principles

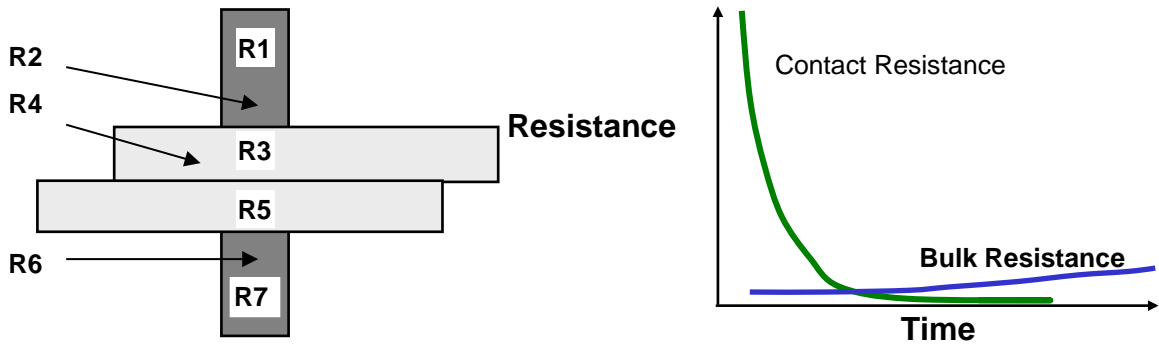

The figure above shows the key resistances in a typical opposed resistance weld and the relationship between contact resistances and bulk resistances over time, during a typical resistance weld:

APPENDIX D: DEFINING THE OPTIMUM PROCESS

- R1 & R7** The electrode resistances affect the conduction of energy and weld heat to the parts and the rate of heat sinking from the parts at the end of the weld.
- R2, R4 & R 6** The electrode-to-part and part-to-part “Contact Resistances” determine the amount of heat generation in these areas. The contact resistances decline over time as the parts achieve better fit up.
- R3 & R5** The metal “Bulk Resistances” become higher during the weld as the parts are heated.

If a weld is initiated when the contact resistances are still high, the heat generated is in relation to the level and location of the contact resistances, as the materials have not had a chance to fit up correctly. It is common for the heat generated at the electrode-to-part and part-to-part resistances to cause multiple welding problems when welding resistive materials including:

- Part marking and surface heating
- Weld splash or expulsion
- Electrode sticking
- Weak welds



Alternately, conductive materials can be welded by using high contact resistance and fast heating because their bulk resistance is not high and cannot be relied upon for heat generation.

If a weld is initiated when both parts and electrodes are fitted up correctly, the contact resistance is lower and bulk resistance now controls the heat generation. This type of weld is achieved with a slower heating rate and normally longer time is preferred for welding resistive materials, which can generate heat through their bulk resistance.



The contact resistances present at the weld when the power supply is fired have a great impact on the heat balance of a weld and, therefore, the heat affected zone.

APPENDIX D: DEFINING THE OPTIMUM PROCESS

The figure below shows a weld that is fired early on in the weld sequence when the contact resistance is still quite high.

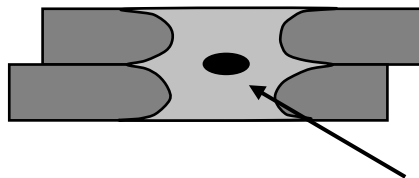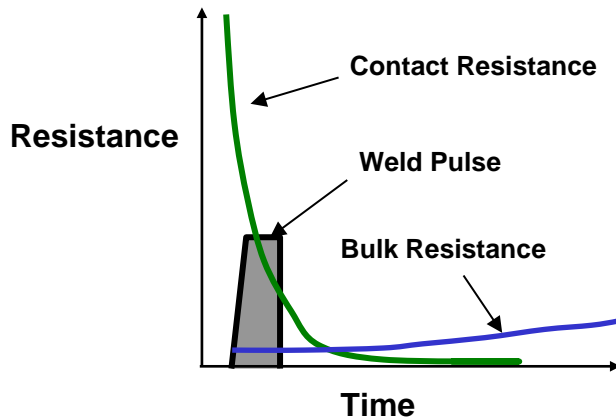

The figure shows a weld that is initiated when the contact resistance is lower; in this example, we are using bulk resistance to generate our weld heat.

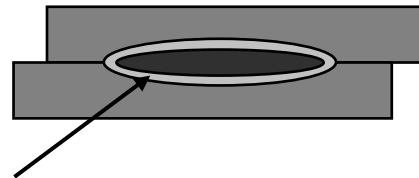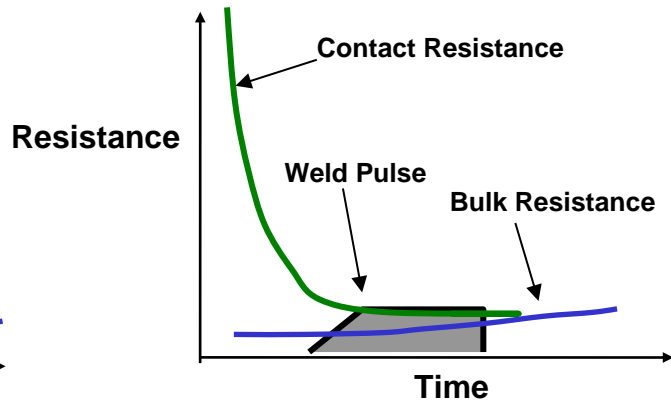


Heat Affected Zone

(NOTE: Larger nuggets are possible with longer weld times when using bulk resistance.)

In general, conductive materials benefit from a faster heating rate, as the higher contact resistances assist heat generation in the weld. Resistive materials benefit from slower heating rates which allow the contact resistances to reduce significantly. Bulk resistances, therefore, become the major source for heat generation. The heat-affected zone is also much smaller in this case producing a weld with less variation.

The following figure shows the three stages of heat generation for resistive materials in a fusion weld. In the first stage, the heat is focused in the part-to-part and electrode-to-part contact areas, since contact resistance is high relative to bulk resistance. In the second stage, contact resistance decreases as the electrodes seat better to the parts. Less heat is generated in the electrode-to-part contact areas, and a greater amount of heat is generated in the parts as the bulk resistance increases. In the third stage, the bulk resistance becomes the dominant heat-generating factor and the parts can reach their bonding temperature at the part-to-part interface. The stages of heat generation for conductive materials will be similar to that of resistive materials, but there will be less heat generated in the bulk resistance due to the conductivity of the materials.

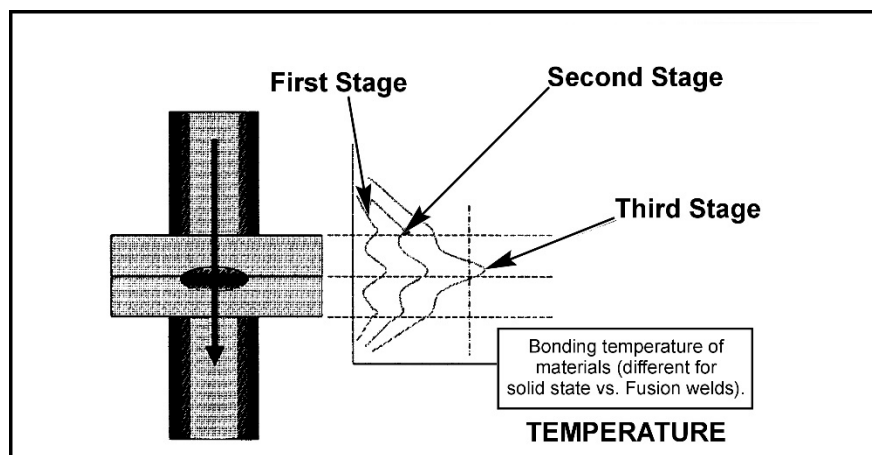


Weld Profiles

The basic welding profile (or schedule) consists of a controlled application of energy and force over time. Precision power supplies control the energy and time and therefore heating rate of the parts. The weld head applies force from the start to finish of the welding process.

The figure on the right shows a typical welding sequence where the force is applied to the parts; a squeeze time is initiated which allows the force to stabilize before the current is fired. Squeeze time also allows time for the contact resistances to reduce as the materials start to come into closer contact at their interface.

A hold time is initiated after current flows to allow the parts to cool under pressure before the electrodes are retracted from the parts. Hold time is important as weld strength develops in this period. This basic form of weld profile is sufficient for the majority of small part resistance welding applications.

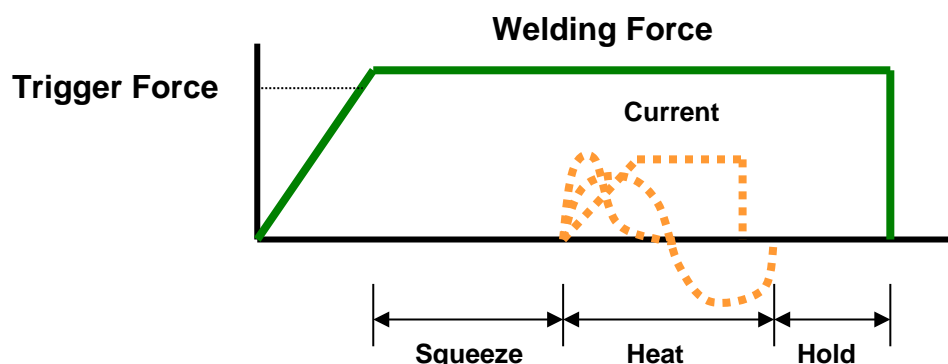

Power supply technology selection is based on the requirements of both the application and process. In general, closed loop power supply technologies are the best choice for consistent, controlled output and fast response to changes in resistance during the weld.

APPENDIX D: DEFINING THE OPTIMUM PROCESS

Approach to Weld Development

The first stage in developing a quality welding process is to fix as many of the variables as possible in the welding equipment set up. The welding variables can be grouped in the following categories:

- **Material Variables**
 - Base material
 - Plating
 - Size
 - Shape
- **Weld Head & Mechanical Variables**
 - Force, squeeze, hold
 - Actuation method
 - Electrode material and shape
- **Power Supply Variables**
 - Energy
 - Time (squeeze, weld, hold)
- **Process Variables**
 - Tooling, level of automation
 - Repetition rate
 - Part positioning
 - Maintenance, electrode cleaning
- **Quality Requirements**
 - Pull strength
 - Visual criteria
 - Test method, other weld joint requirements

The first stage in developing a quality welding process is to fix as many of the variables as possible in the welding equipment set up. Welding variables can be grouped in the following categories:

Initial Welding Trials -- The “Look See” Tests

“Look see” welding tests are a series of mini welding experiments designed to provide a starting point for further statistical development of the welding parameters. The user should adjust the key welding variables (energy, force, time) in order to identify the likely good “weld window.” Close visual inspection of the weld parts will promote better understanding of the heating characteristics of the application.

The mini-experiments should also be used to understand the weld characteristics from both application and process perspective. Key factors in this understanding are as follows:

Application Perspective

- Materials: Resistivity, melting point, thermal mass, shape, hardness, surface properties.
- Heat balance: Electrode materials, shape, Polarity, heating rate (upslope).
- Observation: visual criteria, cross section, and impact of variables on heat balance.


Process Perspective

- What are the likely variables in a production process?
- How will operators handle and align the parts?
- What tooling or automation will be required?
- How will operators maintain and change the electrodes?
- What other parameters will operators be able to adjust?
- What are the quality and inspection requirements?
- What are the relevant production testing methods and test equipment?
- Do we have adequate control over the quality of the materials?


Common Problems

During this stage of process development, it is important to understand that the majority of process problems are related to either materials variation, or part-to-electrode positioning. Some examples are shown below.


Material Control

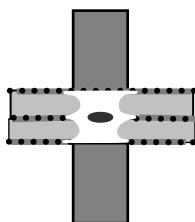

Part-To-Part Positioning

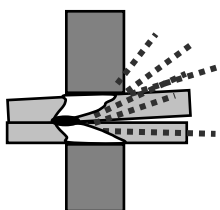


Electrode-To-Part Positioning

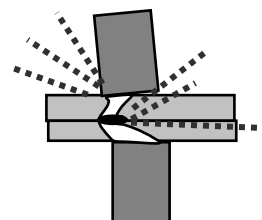

The changes detailed above generally result in a change in contact resistance and always affect the heat balance of the weld. During weld development these common problems must be carefully monitored so as not to mislead the course and productivity of the welding experiments.

In summary, the “look see” welding experiments should be used to fix further variables from an application and process perspective and also to establish a “weld window” for energy, time and force. This part of weld development is critical in order to proceed to a statistical method of evaluation (Design of Experiments or “DOEs”). Random explosions or unexpected variables will skew statistical data and waste valuable time.

APPENDIX D: DEFINING THE OPTIMUM PROCESS

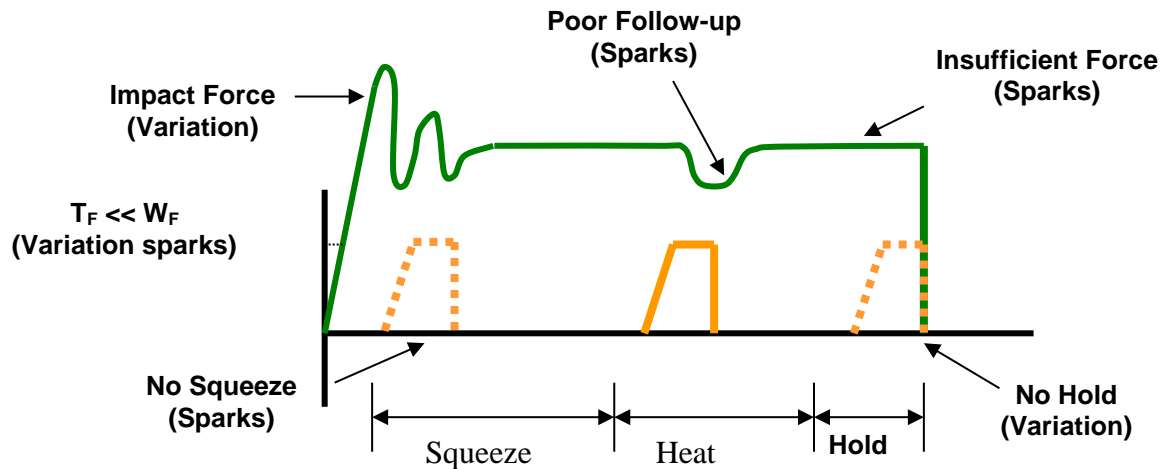

Common welding problems can often be identified in the basic set up of the force, energy, and time welding profile shown above. These problems can lead to weld splash, inconsistency, and variation (contact AMADA WELD TECH for further information and support).

What are Screening DOE'S?

The purpose of a Screening DOE is to establish the impact that welding and process parameters have on the quality of the weld. Quality measurement criteria should be selected based on the requirements of the application. A Screening DOE will establish a relative quality measurement for the parameters tested and the variation in the welded result. This is important, as identifying variation in process is critical in establishing the best production settings. Typically, welded assemblies are assessed for strength of joint and variation in strength.

A Screening DOE tests the high, low settings of a parameter, and will help establish the impact of a parameter on the process. A Screening DOE is a tool that allows the user to establish the impact of a particular parameter by carrying out the minimum number of experiments to gain the information. A five-factor screening DOE can be accomplished in as few as 24 welds, with three welds completed for each of 8 tests. By comparison, it would take 96 welds to test every combination. The DOE promotes understanding of many variables in a single experiment and allows the user to interpret results, thus narrowing the variables for the next level of statistical analysis. If many variables are still not understood, multiple Screening DOE's may be required. AMADA WELD TECH provides a simple Screening DOE tool that is run in Excel® and is sufficient for the majority of possible applications (contact AMADA WELD TECH for details). Sophisticated software is also available from other vendors designed specifically for this purpose.

Criteria for Success

Before running the series of experiments, the user must establish an acceptable window for energy, time, and force, thus preventing voided results. It is common practice to include one or all of the above variables in a Screening DOE. This is only recommended if sufficient understanding has been established for the other application and process variables that can impact quality. Users should first try to screen out all common application and process variables that require further exploration from the results of the “look see” mini experiments and then include the three key welding variables (energy, force and time). Several Screening DOE's may be required.

Results should be interpreted carefully. Typically, one would look for the highest result in terms of quality with the least variation. A Screening DOE provides only a measurement that indicates the relative importance of a parameter and not the ideal setting. Factorial DOE's should be used to establish the correct or best setting for a parameter once many of the other variables have been screened and fixed. This is also the time to assess the measurement accuracy and consistency of the test method and procedure. Variation in test method can invalidate the test and lead to misinterpretation of results.

What are Factorial DOE's?

The purpose of a Factorial DOE is to narrow in on the optimal setting for a particular parameter. This method is generally used when the critical or main key variables have been identified, and we need to establish the best settings for the process. A factorial DOE may also give an indication as to how wide the acceptable weld window is in relation to quality requirements. We recommend data be gathered from a monitoring perspective so that this can provide a starting point for establishing a relationship between quality and the monitored measurement parameter.

Criteria for Success

Critical parameters should be identified from the list of unfixed variables left from the Screening DOE's. A mini-experiment may be required establishing reasonable bounds for the combination of parameters to be tested. This will prevent void data and wasted time. At this stage, it is useful to record multiple relevant quality measurement or inspection criteria so that a balanced decision can be reached. For example, if part marking and pull strength are the relevant criteria, a compromise in ideal setting may be required.

As with all experiments, the test method should be carefully assessed as a potential source of variation and inconsistency. Once the optimum parameters have been established in this series of experiments, a validation study can be run which looks at the consistency of results over time. It is good practice to build in variables such as electrode changes and cleaning, as well as equipment set up by different personnel. This will ensure that the solution is one that can run in a real production environment. Welded assemblies should be tested over time and under real use conditions to ensure that all functional criteria will be met. Validation testing is usually required to prove the robustness of the process under production conditions.

Conclusion

The resistance welding process can deliver a reliable and repeatable joining solution for a wide range of metal joining applications. Defining the optimum welding process and best production settings can be achieved through a methodical and statistical approach. Time spent up front in weld development will ensure a stable welding process and provide a substantial return in quality and long term consistency. Welding problems can more easily be identified and solved if sufficient experimental work is carried out to identify the impact of common variables on the quality and variation of the welded assembly. AMADA WELD TECH frequently uses the Screening DOE tool to establish the impact of key variables and to assist customers with troubleshooting. Often, the testing described above will provide the information and understanding to predict common failure modes and causes. A troubleshooting guide can be requested in the form of a slide rule, to assist users in identification of welding problems and likely causes.

APPENDIX E

LCD DISPLAY MESSAGES

Introduction

The Power Supply displays three types of messages on the LCD screen to alert the operator of the status of the Power Supply:

- **Alarm**
- **Out of Limits**
- **General Status**

You may see these messages when setting-up and programming the Power Supply, or when performing spot welding.

Relay Activation

Alarm and **Out Of Limits** messages activate the output relays as described in *Appendix F, Relay Timing Diagrams*. **General Status** messages do *not* activate the output relays.

Clearing Alarm Conditions to Resume Operation

If an alarm condition occurs, you *must* do the following:

- 1 Take the **Corrective Action** shown next to the **Alarm** message in the list of messages.
 - 2 Clear the **Alarm** condition on the Power Supply in order to resume operation:
 - Press the **RUN** key on the front panel of the Power Supply.
- OR**
- Momentarily close the Process Inhibit input on I/O Connector B on the rear panel.

No action is required to resume operation if you see either **Out of Limits** or **General Status** messages.

List of Messages

The following pages list LCD display messages in alphabetical order.

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
ACCESS DENIED! SCHEDULE LOCK ON	Operator tried to change a weld schedule or individual weld parameters.	Press MENU , select System Security, then enter your access code to turn off Schedule Lock. NOTE: Entering a security code of 414 will always unlock the system.	GENERAL STATUS
ACCESS DENIED! SYSTEM SECURITY ON	Operator tried to change parameters of an individual weld schedule, I/O switch functions, or calibration parameters.	Press MENU , select System Security, then enter the correct access code to turn off the System or Calibration Lock protection features. NOTE: Entering a security code of 414 will always unlock the system.	GENERAL STATUS
CALIBRATION RESET TO DEFAULT	User entered calibration values have been reset to factory default values.	Execute the built-in calibration procedure to get the correct setting. See Calibration section in manual.	GENERAL STATUS
CAPACITY LIMIT EXCEEDED P1	Pulse 1 is below the % limit at the end of the waveform. NOTE: For weld times of less than 1.5ms, the DC25 may not have the capacity to reach the programmed value by the end of the programmed weld time.	Shorten weld time, lower energy setting, or reduce repetition rate. See Chapter 5 for programming instructions. If a weld time of less than 1.5ms is required, you may choose to turn the WAVEFORM CHECK function OFF. If WAVEFORM CHECK is required, increase the weld time in 1ms increments until the alarm no longer appears.	OUT OF LIMITS
CAPACITY LIMIT EXCEEDED P2	Pulse 2 is below the % limit at the end of the waveform.	Shorten weld time, lower energy setting, or reduce repetition rate. See Chapter 5 for programming instructions.	OUT OF LIMITS
CHAINED TO NEXT SCHEDULE	Chain Schedules function is active. Schedule has been incremented.	Normal operation. See Chapter 5 for more information.	GENERAL STATUS
CHECK CONTROL SIGNALS INPUT STATUS	One or more of the I/O input control signals (Schedule Selection, Process Inhibit, or ISTOP) is preventing the Power Supply from continuing to operate.	Remove the I/O input control signal condition preventing further Power Supply operation. For more information see Chapter 5. NOTE: The correct removal action depends on how the control signal select in the Setup 1 menu was programmed by the user.	ALARM

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
CHECK INPUT SWITCH STATUS	One or more of the Firing or Foot Switch input signals is preventing the Power Supply from continuing to operate.	Remove the I/O input control signal condition preventing further Power Supply operation. NOTE: The correct removal action depends on how the INPUT SWITCH SELECT in the Setup 1 menu was programmed by the user.	ALARM
CHK VOLTAGE CABLE & SECONDARY CKT	No electrode voltage measurement was made. Possible open circuit.	Check that a closed secondary circuit is present when the Power Supply fires. Verify that the Voltage Sense Cable is properly connected to the electrodes or electrode holder. NOTE: Polarity is not important for the cable connection. If message persists, possible blown internal fuse on Capacitor Charging Power Supply, contact AMADA WELD TECH for support.	OUT OF LIMITS
COOL TIME ADDED FOR DIFFERENT FEEDBACK	The Power Supply automatically added Cool Time to the schedule because Pulse 1 and Pulse 2 feedback modes are different, or Pulse 1 and Pulse 2 energy levels are different.	Normal operation.	GENERAL STATUS
COOL TIME MINIMUM	The operator programmed a cool time smaller than required.	Increase setting.	GENERAL STATUS
CURRENT 1 GREATER THAN UPPER LIMIT	Actual weld current is greater than the user set Upper Limit value for Pulse 1.	Determine the cause of the high current. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
CURRENT 1 LOWER THAN LOWER LIMIT	Actual weld current is less than the user set Lower Limit value for Pulse 1.	Determine the cause of the low current. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
CURRENT 2 GREATER THAN UPPER LIMIT	Actual weld current is greater than the user set Upper Limit value for Pulse 2.	Determine the cause of the high current. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified personnel and are designed to identify process variations.	OUT OF LIMITS
CURRENT 2 LOWER THAN LOWER LIMIT	Actual weld current is less than the user set Lower Limit value for Pulse 2.	Determine the cause of the low current. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified personnel and are designed to identify process variations.	OUT OF LIMITS
EMERGENCY STOP - OPERATOR ACTIVATED	The Operator Emergency Stop switch has been activated. All power outputs are disabled.	Remove any unsafe operating conditions at the welding electrodes. Reset the Operator Emergency Stop switch. Press RUN to reset, verify that correct weld schedule is selected.	ALARM
FIRING DIDN'T CLOSE IN 10 SECONDS	The Firing Switch input was not activated within 10 seconds after the Foot Switch was closed.	Press RUN to clear alarm. Check air pressure setting on weld head. Check Firing Switch connection.	ALARM
FIRING SWITCH BEFORE FOOT SWITCH	The Firing Switch input has been activated before the Foot Switch has been activated.	Check the weld head for an improperly adjusted firing switch. Automation Only - Check the timing on the PLC control lines to the Firing Switch and Foot Switch inputs.	ALARM
ILLEGAL SECURITY CODE ENTERED	The wrong security code was entered to de-activate the System, Schedule, or Calibration Lock protection features.	Press MENU , select System Security, then enter the correct access code to turn off System, Schedule, or Calibration Lock protection features. NOTE: Entering a security code of 414 will always unlock the system.	GENERAL STATUS
INHIBIT 2ND PULSE	A monitor action is programmed to inhibit the second pulse and the first pulse energy limit was reached.	Normal operation if this function is used. See Chapter 4, Operating Instructions.	OUT OF LIMITS

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
INHIBIT CONTROL SIGNALS ACTIVATED	The Inhibit input control signal is activated, preventing the Power Supply from continuing to operate. NOTE: Activating the Inhibit input terminates only future operations. It does NOT terminate any present Power Supply operation.	Remove the Inhibit signal condition preventing further the Power Supply operation. NOTE: The correct removal action depends on how the control signal I/O logic was programmed by the user.	ALARM
INPUT TOO LARGE	The user has attempted to program a weld energy or time that exceeds the capability of the Power Supply.	Re-program welding parameters to be within the capability of the Power Supply.	GENERAL STATUS
INPUT TOO SMALL	The user has attempted to program a weld energy or time that is below the capability of the Power Supply.	Re-program welding parameters to be within the capability of the Power Supply.	GENERAL STATUS
LOWER LIMIT GREATER THAN UPPER LIMIT	The user has tried to program a Lower Limit value that is greater than the Upper Limit value for Pulse 1 or Pulse 2 time periods.	Re-program the invalid Lower Limit value.	GENERAL STATUS
NO CURRENT READING	No current measurement was made. Possible open circuit.	Check that a closed secondary circuit is present when the Power Supply fires. If message persists, possible blown internal fuse on Capacitor Charging Power Supply, contact AMADA WELD TECH for support.	OUT OF LIMITS
NO LOWER LIMIT WITH STOP P1 ACTION	The user has attempted to program a lower limit with the APC PULSE 1 OUT OF LIMITS ACTION selected.	A lower limit is not allowed on Pulse 1 if the APC action is selected. The DC25 will automatically change the lower limit to NONE.	GENERAL STATUS
NO VOLTAGE READING	No voltage measurement was made. Possible open circuit or possible voltage lead connection problem.	Check that a closed secondary circuit is present when the Power Supply fires. Check voltage cable connection. If message persists, possible blown internal fuse on Capacitor Charging Power Supply, contact AMADA WELD TECH for support.	OUT OF LIMITS
P1 LOWER LIMIT DELAYS ADJUSTED	The user has attempted to program a lower limit delay, which results in a limit time of less than 0.5 milliseconds.	Verify that the automatic correction by the DC25 is acceptable. Reprogram if necessary.	GENERAL STATUS

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
P1 UPPER LIMIT DELAYS ADJUSTED	The user has attempted to program an upper limit delay, which results in a limit time of less than 0.5 milliseconds.	Verify that the automatic correction by the DC25 is acceptable. Reprogram if necessary.	GENERAL STATUS
P2 INHIBITED CAP BANK DEPLETED	The charge on the capacitor bank is too low to output Pulse 2. Pulse 1 energy level and time are too high.	Reduce the energy level and/or time setting on Pulse 1.	ALARM
P2 LOWER LIMIT DELAYS ADJUSTED	The user has attempted to program a lower limit delay, which results in a limit time of less than 0.5 milliseconds.	Verify that the automatic correction by the DC25 is acceptable. Reprogram if necessary.	GENERAL STATUS
P2 UPPER LIMIT DELAYS ADJUSTED	The user has attempted to program an upper limit delay, which results in a limit time of less than 0.5 milliseconds.	Verify that the automatic correction by the DC25 is acceptable. Reprogram if necessary.	GENERAL STATUS
POWER 1 GREATER THAN UPPER LIMIT	Actual weld power is greater than the user set Upper Limit value for Pulse 1.	Determine the cause of the high power. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
POWER 1 LOWER THAN LOWER LIMIT	Actual weld power is less than the user set Lower Limit value for Pulse 1.	Determine the cause of the low power. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
POWER 2 GREATER THAN UPPER LIMIT	Actual weld power is greater than the user set Upper Limit value for Pulse 2.	Determine the cause of the high power. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
POWER 2 LOWER THAN LOWER LIMIT	Actual weld power is less than the user set Lower Limit value for Pulse 2.	Determine the cause of the low power. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
POWER TRANSISTOR OVERHEATED	The power dissipated by the power transistors has exceeded the Power Supply specified capability.	Reduce duty cycle. Reduce weld time. NOTE: You must turn the power OFF and ON to reset the alarm.	ALARM
PULSE 1 LOWER LIMIT REACHED	The lower limit programmed for the A.P.C. feature was reached.	Normal operation. The energy for Pulse 1 will be terminate and Pulse 2 will be allowed to fire. See Chapter 3 for more information.	OUT OF LIMITS
PULSE 1 UPPER LIMIT REACHED	The upper limit programmed for the A.P.C. feature was reached.	Normal operation. The energy for Pulse 1 will be terminate and Pulse 2 will be allowed to fire. See Chapter 3 for more information.	OUT OF LIMITS
SCHEDULES ARE RESET	User programmed the Power Supply to automatically reset all 100 weld schedules to their factory set default values.	CAUTION: Be careful when using the MENU default features. There is no way to undo a reset to defaults action.	GENERAL STATUS
STABILITY LIMIT EXCEEDED P1	The average deviation of Pulse 1 is beyond the allowable amount programmed in the Stability Check function. The default value for the % limit is 7%. The default value for the delay at the start of the pulse is 2 milliseconds.	See Chapter 5 for programming instructions. Decide whether to adjust the % limit, delay, or schedule settings. NOTE: The WAVEFORM CHECK function can be turned OFF if desired.	OUT OF LIMITS
STABILITY LIMIT EXCEEDED P2	The average deviation of Pulse 2 is beyond the allowable amount programmed in the Stability Check function. The default value for the % limit is 7%. The default value for the delay at the start of the pulse is 2 milliseconds.	See Chapter 5 for programming instructions. Decide whether to adjust the % limit, delay, or schedule settings. NOTE: The WAVEFORM CHECK function can be turned OFF if desired.	OUT OF LIMITS
STOP ON CONTROL SIGNALS INPUT	The ISTOP function has been activated. Welding has been inhibited.	Remove any unsafe operating conditions at the welding electrodes. Reset the input to the ISTOP. See Appendix B for details.	ALARM

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
SYSTEM PARAMETERS ARE RESET	User programmed the Power Supply to automatically reset all I/O and other system parameters to their factory set default values.	CAUTION: Be careful when using the MENU default features. There is no way to undo a reset to defaults action.	GENERAL STATUS
TEST WELD? [MENU]=NO [RUN]=YES	The ASK test weld function is programmed in the SETUP 3 MENU screen. This is the prompt to the operator whether to do a test weld or not.	Normal Operation. Press MENU to skip the test weld. Press RUN to perform the test weld. See Chapter 5 for programming information.	GENERAL STATUS
UPSLOPE REQUIRED FOR LOWER LIMIT	User has attempted to program a Lower Limit value for Weld 1 or Weld 2 periods without using an upslope period.	Delete the Weld 1 or Weld 2 Lower Limit value. Add an upslope period before Weld 1 or Weld 2 if a Lower Limit value is desired.	GENERAL STATUS
VOLTAGE 1 GREATER THAN UPPER LIMIT	Actual weld voltage is greater than the user set Upper Limit value for Pulse 1.	Determine the cause of the high voltage. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
VOLTAGE 1 LOWER THAN LOWER LIMIT	Actual weld voltage is less than the user set Lower Limit value for Pulse 1.	Determine the cause of the low voltage. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
VOLTAGE 2 GREATER THAN UPPER LIMIT	Actual weld voltage is greater than the user set Upper Limit value for Pulse 2.	Determine the cause of the high voltage. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS

APPENDIX E: LCD DISPLAY MESSAGES

LCD Display Messages

MESSAGE	DESCRIPTION	CORRECTIVE ACTION (IF REQUIRED)	TYPE OF MESSAGE
VOLTAGE 2 LOWER THAN LOWER LIMIT	Actual weld voltage is less than the user set Lower Limit value for Pulse 2.	Determine the cause of the low voltage. Changes to the welding setup or process can affect the energy delivered. Refer to the Troubleshooting Chart in Chapter 6. Limits should be set by qualified by personnel and are designed to identify process variations.	OUT OF LIMITS
WELD FIRE LOCKOUT	A weld was initiated before the capacitor bank charge reached the required level as programmed in the WAVEFORM CHECK menu. Default value for WELD FIRE LOCKOUT is 90% charge. Reducing this value with high energy levels or longer weld times could exceed the capacity of the Power Supply.	Reduce the repetition rate. See Chapter 5 for programming information. See Appendix G for Repetition Rate and Power Supply capability details.	ALARM
WELD STOP - LIMIT REACHED	The user set Upper Limit value has been reached, and the weld energy has been terminated.	Normal operation if this function is used. See Chapter 4, Operating Instructions for information on WELD STOP.	OUT OF LIMITS
WELD SWITCH IN NO WELD POSITION	User has tried to activate the Power Supply with the WELD/NO WELD Switch in the No Weld Position. INOWELD signal might have been activated.	Set the WELD/NO WELD switch to the Weld position. Deactivate INOWELD .	OUT OF LIMITS
WELD TIME TOO SMALL	The user has attempted to program zero for all upslope, weld, and downslope time periods.	Re-program the welding parameters to be within the capability of the Power Supply.	GENERAL STATUS

APPENDIX F

RELAY TIMING DIAGRAMS


Introduction

Instructions for relay setup are in *Chapter 5, Section VI, Relay Settings*. Instructions cover the **ON/OFF** state, the **SET RELAY TO** and the **WHEN** states:

- **WELD**
- **END OF WELD**
- **ALARM**
- **OUT OF LIMITS**
 - **P1 HIGH LIMIT**
 - **P1 LOW LIMIT**
 - **P2 HIGH LIMIT**
 - **P2 LOW LIMIT**

The following diagrams show the timing sequence for each relay **WHEN** state.


WELD

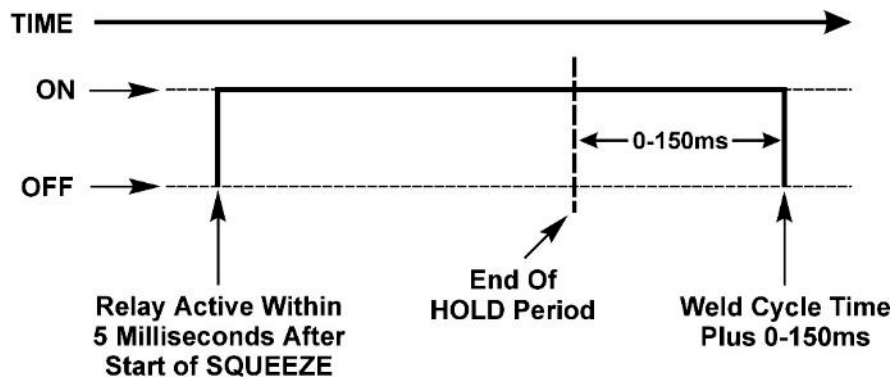

When welding, the relay output signal will start within 5 milliseconds after the start of **SQUEEZE** and will stay energized for 0 - 150 milliseconds after the end of the **HOLD** period.

APPENDIX F: RELAY TIMING DIAGRAMS


END OF WELD

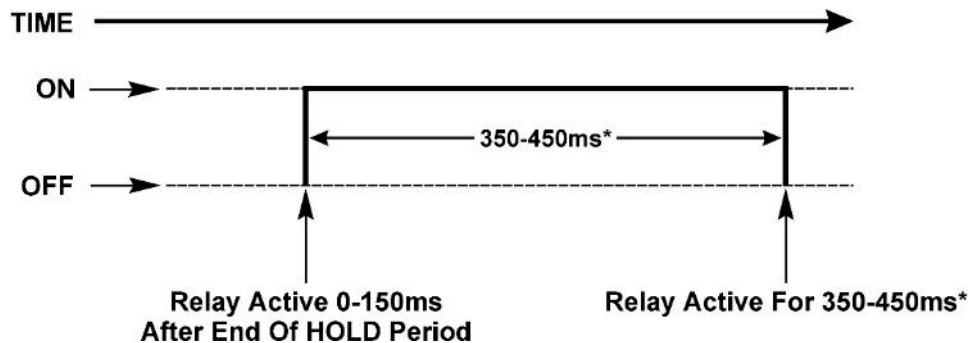

When welding, the relay output signal will start 0 - 150 milliseconds after the end of the **HOLD** period and will stay energized for 350 - 450 milliseconds.* The relay will still close in case of an aborted weld.

- * If another weld is initiated within this time, the **END OF WELD** relay will be reset at the start of the next weld.


ALARM

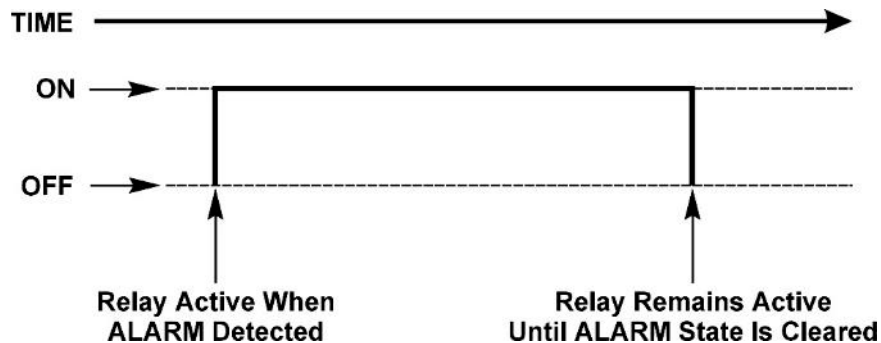

The relay output signal will start when the Control senses certain **ALARM** conditions (with the *exception* of **OUT OF LIMITS** alarms) and will stay energized until the **ALARM** state is cleared by pressing the **RUN** button (refer to *Appendix E, LCD Display Messages*).

OUT OF LIMITS

- **P1 HIGH LIMIT**
- **P1 LOW LIMIT**
- **P2 HIGH LIMIT**
- **P2 LOW LIMIT**

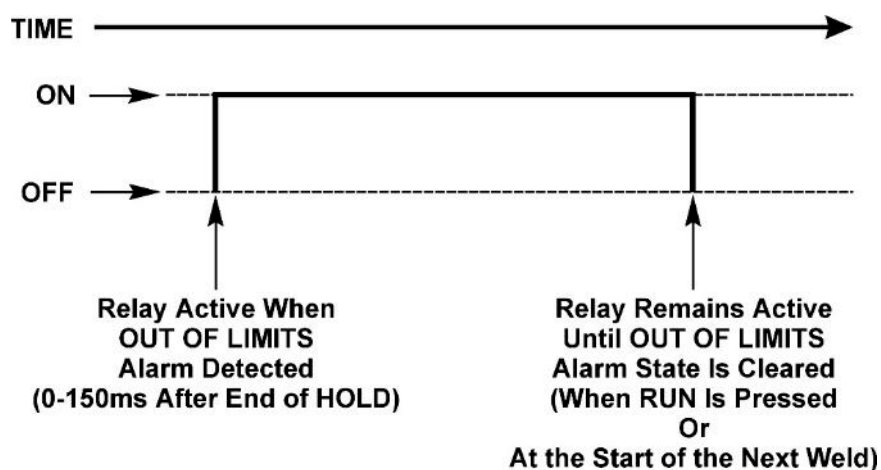

The relay will switch when the Control senses any **OUT OF LIMITS** condition. It will start 0 - 150 milliseconds after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld.

- **P1 HIGH LIMIT.** The relay signal will switch when the Control senses that the Pulse 1 energy is higher than the programmed upper limit. It will start 0 - 150 milliseconds after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld.
- **P1 LOW LIMIT.** The relay signal will switch when the Control senses that the Pulse 1 energy is lower than the programmed lower limit. It will start 0 - 150 milliseconds after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld.
- **P2 HIGH LIMIT.** The relay signal will switch when the Control senses that the Pulse 2 energy is higher than the programmed upper limit. It will start 0 - 150 milliseconds after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld.
- **P2 LOW LIMIT.** The relay signal will switch when the Control senses that the Pulse 2 energy is lower than the programmed lower limit. It will start 0 - 150 milliseconds after the end of **HOLD** and will stay energized until the **OUT OF LIMITS** alarm state is cleared by pressing the **RUN** button, or at the start of the next weld.

APPENDIX G

REPETITION RATES

Introduction

The term repetition rate refers to how often weld pulses can be repeated based on the Power Supplies recharging time. The DC25 stores energy internally in a capacitor bank. This energy is used to provide the desired weld pulses. There are limits to the duration of weld pulses the unit can provide, and time must be provided between welds for the capacitor bank to recharge.

The graph on the next page details the maximum acceptable pulse durations at various current levels for repetition rates of 1, 2, and 3 welds per second. The graph is divided into sections by the graphed lines. The portion of the graph below the lines is labeled *Acceptable Durations*, the area at the top-right is labeled *Durations Too Long*.


Weld pulses that fall below the lines in the *Acceptable Durations* section are within the capability of the Power Supply for the stated repetition rates. The time to be used in determining the duration is the sum of the weld period and ½ the periods of upslope and downslope, if any. For dual-pulse welding, the sum of both pulses must be compared to the chart. This graph requires the total resistance of the secondary circuit to be between 0.5 milliohms and 10 milliohms. Certain combinations of weld currents, durations and repetition rates in the top-right portion of the graph may be possible. This depends upon the secondary load and resistance. For assistance, contact our **Applications Lab** at the phone number listed in the *Foreword* of this manual.


For welds using the current control mode, the durations can be read directly off the chart. For welds in the voltage control or power control modes, the average current from the monitor screen and the programmed duration can be compared to this chart.

It is possible that longer durations may be provided by the Power Supply (depending upon the details of the secondary circuit) but the stability of the waveform may decrease. In this circumstance, a reduction of the secondary circuit resistance and/or inductance will be beneficial. (Shorten weld cables and/or tie them together.) Testing with the actual secondary circuit to be used will be required in this case.


APPENDIX G: REPETITION RATES

Repetition Rates

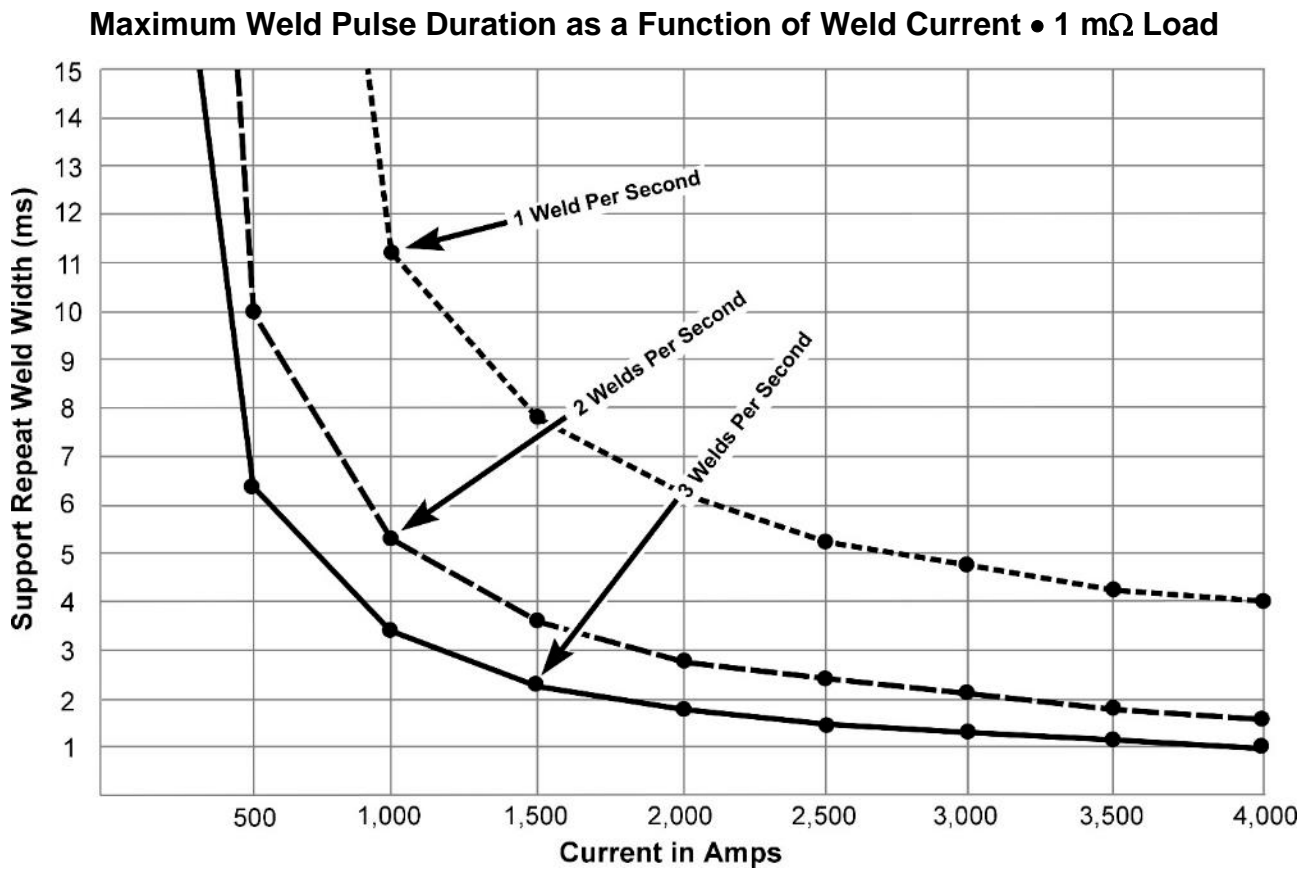

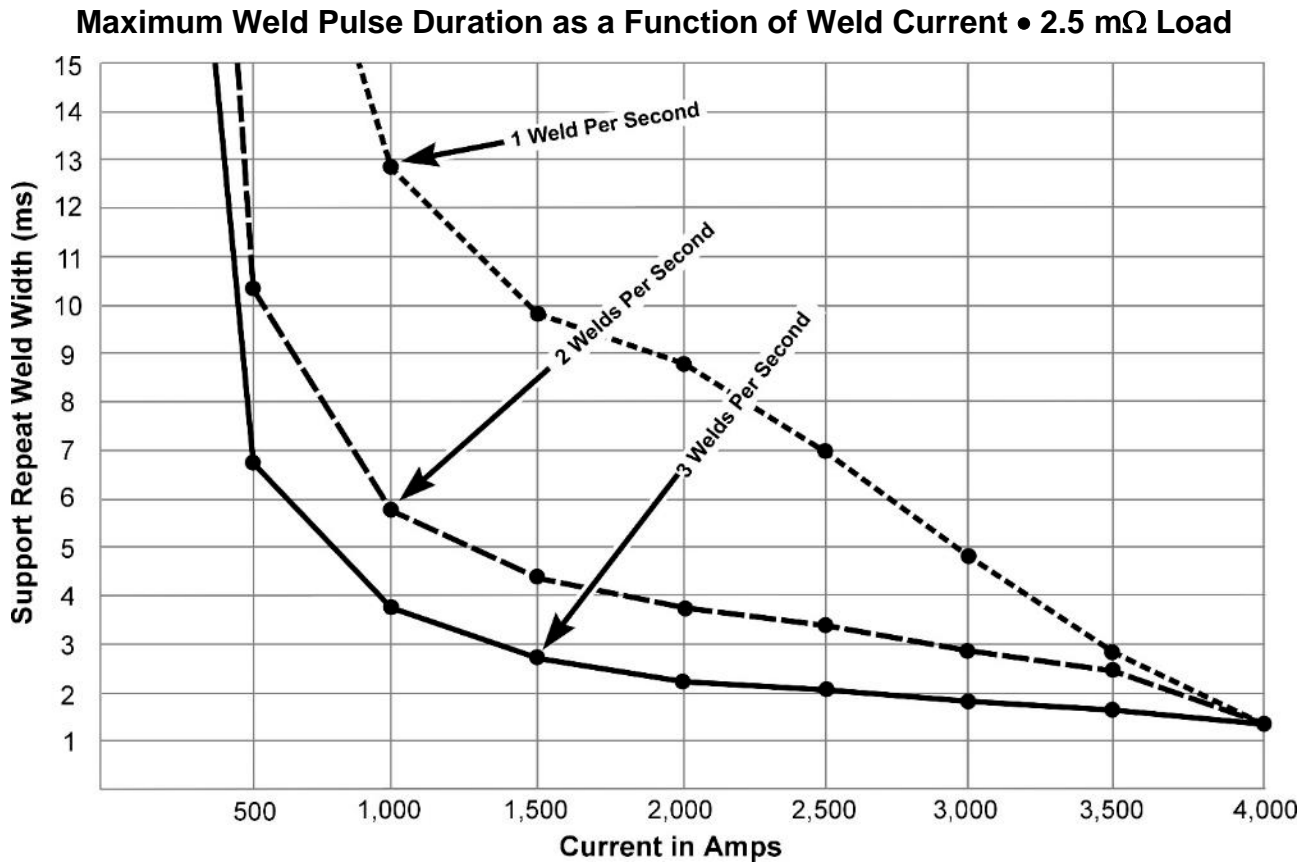

APPENDIX G: REPETITION RATES

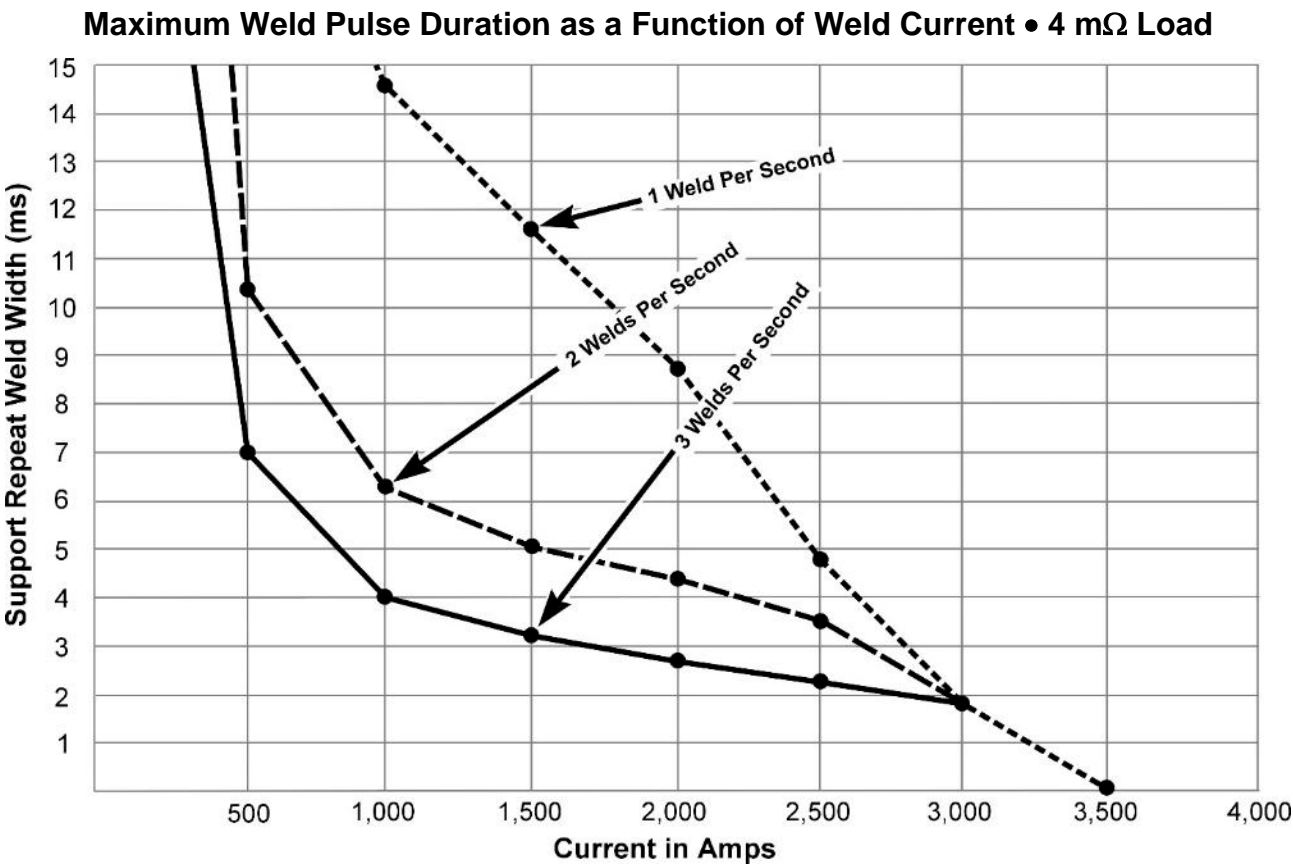

AMADA WELD TECH INC.

<http://www.amadaweldtech.com>

AMADA WELD TECH INC.

1820 South Myrtle Ave., Monrovia, CA 91016, U.S.A.

TEL. +1-626-303-5676 FAX, +1-626-358-8048

<http://www.amadaweldtech.com>

AMADA WELD TECH CO., LTD.

200, Ishida, Isehara-shi, Kanagawa 259-1196, Japan

AMADA WELD TECH KOREA CO., LTD.

28, Dongtanhana 1-gil, Hwaseong-si, Gyeonggi-do, 18423, Korea

TEL. +82-31-8015-6810 FAX. +82-31-8003-5995

AMADA WELD TECH SHANGHAI CO., LTD.

Unit 401, A206(C8), No. 77, Hongcao Road, Xuhui District, Shanghai, China

TEL. +86-21-6448-6000 FAX. +86-21-6448-6550

AMADA WELD TECH GmbH

Lindberghstrasse 1, DE-82178 Puchheim, Germany

TEL. +49-89-839403-0 FAX. +49-89-839403-68

AMADA WELD TECH TAIWAN CO., LTD.

Rm. 5, 2F., No. 9, Dehui St., Zhongshan Dist., Taipei 10461, Taiwan (R.O.C.)

TEL. +886-2-2585-0161 FAX. +886-2-2585-0162

AMADA VIETNAM CO., LTD.

469 Ha Huy Tap Road, Yen Vien, Gia Lam, Ha Noi, Vietnam

TEL. +84-4-6261-4583 FAX. +84-4-6261-4584

AMADA (THAILAND) CO., LTD.

Asia Industrial Estate Suvarnabhumi (AIES) 88/41 Moo 4, Khlongsuan, Bangbo, Samutprakarn 10560, Thailand

TEL. +66 2170-5900 FAX. +66 2170-5909

AMADA WELD TECH INDIA PVT. LTD.

G-A Ground Floor, 5C-409, 5th Cross, Kammanahalli Main Road, HRBR Layout, Kalyan Nagar, Bengaluru, - 560043, India

TEL. +91-80-4092-1749 FAX. +91-80-4091-0592

AMADA WELD TECH LTDA.

Av. Tamboré, 965/973, Salas P22e F11, bairro Tamboré, 06460-000-Barueri-SP, Brazil

TEL. +55-11-4193-1187

AMADA WELD TECH INC.

1820 South Myrtle Ave., Monrovia, CA 91016, U.S.A.

TEL. +1-626-303-5676 FAX. +1-626-358-8048